			TOFI	VED			
Form 3160-5			oRitries	V	1		
(August 2007) DE	UNITED STATES PARTMENT OF THE II IRFALLOF LAND MANA	S NTERIOR GEMENT	ORECEI	2014	OMB N	APPROVED D. 1004-0135 July 31, 2010	
SUNDRY	NOTICES AND REPO	RTS ON W	ELNANOCD /	ARTEON	6 Lease Serial No. NMNM29233		
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLING OCD ARTES Do not use this form for proposals to drill or to re-enter-am abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on reverse side.				7. If Unit or CA/Agreement, Name and/or No.			
 I. Type of Well □ Oil Well □ Gas Well ☑ Other: INJECTION 					8. Well Name and No. FEDERAL 12 1		
2. Name of Operator Contact: DAVID_STEWART OXY USA INC E-Mail: david_stewart@oxy.com					9. API Well No. 30-015-26742		
3a. Address P.O. BOX 50250 MIDLAND, TX 79710	3b. Phone No. (include area code) Ph: 432-685-5717 Fx: 432-685-5742			10. Field and Pool, or Exploratory LIVINGSTON RIDGE DELAWARE			
4. Location of Well <i>(Footage, Sec., T.</i>				11. County or Parish, and State			
Sec 12 T22S R31E SWSW 660FSL 660FWL 32.400570 N Lat, 103.737910 W Lon					EDDY COUNTY, NM		
12. CHECK APPF	OPRIATE BOX(ES) TO) INDICATI	E NATURE OF N	JOTICE, RE	PORT, OR OTHEI	R DATA	
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent	Acidize	🗖 Dee	epen	D Productio	on (Start/Resume)	UWater Shut-Off	
Subsequent Report	□ Alter Casing			🗖 Reclama	- 0,		
	Casing Repair		w Construction	🗖 Recompl		□ Other	
Final Abandonment Notice	Change Plans Convert to Injection	-			rarily Abandon Disposal		
Attach the Bond under which the wor following completion of the involved testing has been completed. Final Ab determined that the site is ready for fin OXY USA INC. respectfully red well to a SWD. The SWD-142 7/2/13. Due to some land issu 3rd quarter 2014.	operations. If the operation res andonment Notices shall be file nal inspection.) quests to temporarily aba 3 permit was approved 6.	sults in a multip ed only after all ndon this we /18/13 and th	le completion or recorrequirements, includi ell. It is planned to recompletion s	mpletion in a neighbor of convert this undry approvo proximately	ew interval, a Form 316 have been completed, a /ed the)-4 shall be filed once ind the operator has	
TD-8439' Perfs-8270-8336' 7042-7074'				SU	SUBJECT TO LIKE APPROVAL BY STATE		
13-3/8" 54.5# csg @ 828' w/ 9 8-5/8" 24-32# csg @ 4325' w/ 5-1/2" 15.5-17# csg @ 8439' w	1900sx, 11" hole, TOC-S / 1402sx, 7-7/8" hole, TC Accepted (fô	urf-Circ)C-5765'-CB	CONDI	TACHE			
		DRF 12	/29/14	<u>.</u>			
14. I hereby certify that the foregoing is true and correct. Electronic Submission #230074 verified by the BLM Well Informati For OXY USA INC, sent to the Carlsbad Committed to AFMSS for processing by JOHNNY DICKERSON on C Name (Printed/Typed) DAVID STEWART Title SR. REGULATOF				ad RSON on 01/1	7/2014 ()		
					PPROVE		
Signature (Electronic St	ubmission)		Date 12/19/20	13			
	THIS SPACE FO	R FEDERA	L OR STATE C	I 1		•	
Approved By			Title		Is/ Chris Wa		
Conditions of approval, if any, are attached certify that the applicant holds legal or equi which would entitle the applicant to conduc	table title to those rights in the		Office	BURI	AU OF LAND MANA CARLSBAD FIELD OF	FICE	
Title 18 U.S.C. Section 1001 and Title 43 U							

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **

•

Additional data for EC transaction #230074 that would not fit on the form

•

32. Additional remarks, continued


1

- RIH & set CIBP @ 8220' M&P 25sx CL C cmt, WOC-Tag
 RIH & set CIBP @ 6995' M&P 25sx CL C cmt, WOC-Tag
 Notify BLM/NMOCD of casing integrity test 24hrs in advance.
 RU pump truck, circulate well with treated water, pressure test casing to 500# for 30 min.

OXY USA WTP LP - Proposed Federal 12 #1 API No. 30-015-26742


1

「「「「「「「「「「「」」」」」「「「「「」」」」」」

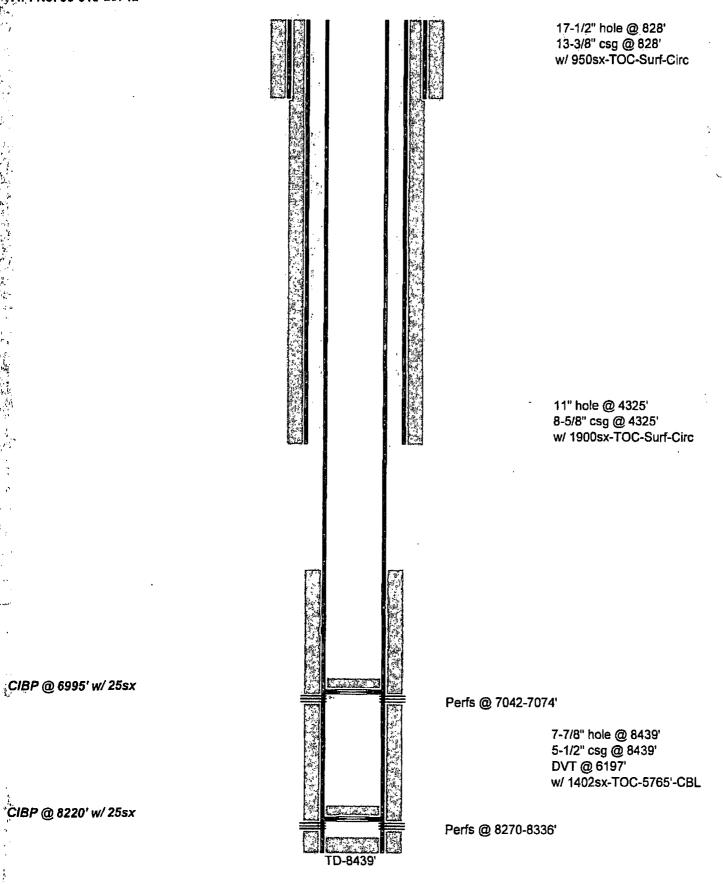

ĥ

OXY USA WTP LP - Current Federal 12 #1 API No. 30-015-26742

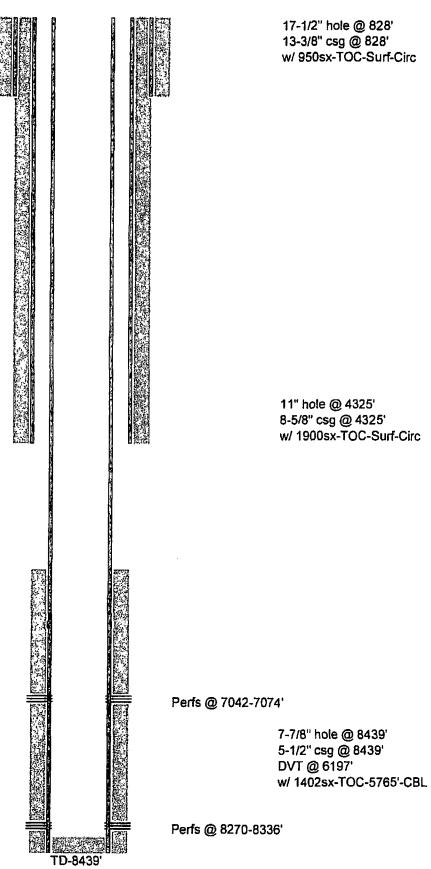

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.

a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, **placed with tubing**.

b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.

c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.

d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.

e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.

3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- 1. Submits a subsequent Sundry Notice (Form 3160-5) requesting TA approval <u>with well bore diagram</u> with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Federal 12 - #1

- 1. Well may be approved to be TA/SI for a period of 9 months or until 11/11/2014 after successful MIT and subsequent report is submitted.
- 2. Plug depths are acceptable, the first plug shall be a minimum of 180 feet in length and the second plug shall be a minimum of 170'
- **3.** Contact BLM 24 Hrs. prior to setting of plugs so as it may be witnessed.