Submit 1 Copy To Appropriate District Office	State of N	New Mexico			R	Form C-103 Revised August 1, 2011
District 1	Energy, Minerals ar		esources	WELL API		ic visca August 1, 2011
1625 N. French Dr.,Hobbs, NM 88240 District II					30-015-39	9009
811 A. First St., Artesia, NM 88210	OIL CONSERV	ATION DIV	/ISION	5. Indicate	Type of Lease	
<u>Disrtict III</u> 1000 Rio Brazos Rd. Aztec, NM 87410	1220 South	St. Francis D)r	}	STATE 🗹	FEE 🗌
District IV		, NM 87505	η.	6. State Oi	l & Gas Lease	NO.
1220 S. St. Francis Dr., Santa Fe, NM 87505		,			B0-6869-	0050
SUNDRY NOTICE	ES AND REPORTS ON WE	ELLS		7. Lease N	lame or Unit Ag	reement Name
(DO NOT USE THIS FORM FOR PROPO DIFFERENT RESERVIOR. USE "APPLIC				0. 14/- !! 11	Empire Ab	o Unit
PROPOSALS.) 1. Type of Well∶ Oil Well ☑ Gas Wel	I Other			8. Well Nu	415	
2. Name of Operator				9. OGRID Numer		
	che Corporation			40 Deel N	873	· · · · · · · · · · · · · · · · · · ·
3. Address of Operator 303 Veterans Airpark I	Lane, Ste. 3000, Midland,	TX 79705		10. Pool N	^{ame} Empire: Abo	(22040)
4. Well Location						_
Unit Letter G Section 2	: 1650 feet from the		line and 27E		feet from the	E line
	Township 18S 11. Elevation (Show whether I	Range DR. RKB.RT. (NMPM	Cou	nty Eddy
	The state of the s	565' GR			13	grand age
12. Check	Appropriate Box To Indica	te Nature of	Notice, Rep	ort, or Oth	ner Data	
NOTICE OF II	NTENTION TO:	•		SURSEO	UENT REPOR	RT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	(J	REMEDIAL '			(1 01 .
TEMPORARILY ABANDON	CHANGE PLANS		COMMENC		===	
PULL OR ALTER CASING	MULTIPLE COMPL		CASING/CE			
DOWNHOLE COMMINGLE			ALTERING (P AND A	CASING		
OTHER:			OTHER:		H	
 Describe proposed or completed ope any proposed work.) SEE RULE 11 						
CONDITIONS OF APPROVAL	* * *		J	• •	<u>'</u>	<u>'</u>
			Approved for	plugging of w	ell bore only.	
Approval Granted providi	ng work is		of C-103 (Sub	brequent Repo	ined pending recei ort of Well Pluggin	g)
Completed by	2016		which may be	e found at OCD Web Page under cemnrd.state.nm.us/ocd.		
0ct 30	12012		Forms, www.	cmnra.state.m	in.us/ocu.	
Apache Corporation proposes to be used for all fluid	P&A the above mentioned the from this wellbore and	_		-	Rule 19.15.17	
					IAIAI	OIL CONSERVATION ARTESIA DISTRICT
Spud Date:		Rig Release	e Date:			OCT 3 0 2014
						RECEIVED
I hereby certify that the information above is tru	e and complete to the best of my	knowledge and	belief.		· · · · · · · · · · · · · · · · · · ·	
SIGNATURE Suyung	Burles TITLE	Sr. Recla	amation Fo	reman	DATE	10/23/14
Type or print name Guin	n Burks E-mail add.	guinn.burk	s@apached	corp.com	PHONE:	432-556-9143
For State Use Only APPROVED BY:	TITLE	D576		RWISIN		130/2014
Conditions of Approval (if any):	Hacked Ca	DAS	·			• ,

EMBETHE !


4-

LEASE NAME	Empire Abo Unit			
WELL.#	415			
API#	30-015-39009			
COUNTY	EDDY, NM	· — · · · · · · · · · · · · · · · · · ·		

	WELL BORE INFO.	P2
0		
630	11" Hole 8 5/8" 24# @ 498' w/ 385 sx to surf	
1260		
1890		
2520		
3150	DVT @ 3013' w/ 520 sx to surf	
3780		
4410 5040		
50-70	CIBP # 5336' w/ 35' cmt	
5670		

7 7/8" Hole 5 1/2" 17# @ 6300' w/ 591 sx DVT @ 3013' w/ 520 sx to surf

6300

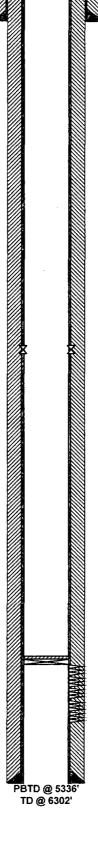

Abo perfs @ 5386'-5700'



 LEASE NAME
 Empire Abo Unit

 WELL #
 415

 API #
 30-015-39009

 COUNTY
 EDDY, NM

PROPOSED PROCEDURE

WELL BORE INFO. 0 11" Hole 8 5/8" 24# @ 498" w/ 385 sx to surf 630 1260 1890 2520 DVT @ 3013' w/ 520 sx to surf 3150 3780 4410

PBTD @ 5336' TD @ 6302'

5. PUH & spot 100 sx Class "C" cmt from 970' to surf (Yates, 7 Rvrs, Queen, Surf Shoe, & Water Board)

 PUH & spot 45 sx Class "C" cmt from 1739-1316" WOC/TAG (Grayburg/San Andres)

PUH & spot 70 sx Class "C" cmt from 3623'-2963'
 WOC/TAG (Glorieta, Yeso, Blinebry, & DV Tool)

 PUH & spot 25 sx Class "C" cmt from 4422'-4172' (Tubb)

1. MIRU, RIH & verify CIBP @ 5336', CIRC w/MLF & spot 40 sx Class "C" cmt from 5336'-4931' WOC/TAG (Top of Abo)

Abo perfs @ 5386'-5700'

7 7/8" Hole 5 1/2" 17# @ 6300' w/ 591 sx DVT @ 3013' w/ 520 sx to surf

CIBP # 5336' w/ 35' cmt

6300

5040

5670

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS	OF	APPROVAL	FOR P	LUGGING	& A1	BANDONMENT
------------	----	----------	-------	---------	------	------------

Operator: HUW	Sie	
Well Name & Number:	Enpire Apollut	# 415-
API#: 30 · 015		

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 1 year of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.

- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: 10/30/2014

APPROVED BY: Res

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).