

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED
OMB NO. 1004-0135
Expires: July 31, 2010**SUNDRY NOTICES AND REPORTS ON WELLS**
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.***SUBMIT IN TRIPLICATE - Other instructions on reverse side.**

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other		5. Lease Serial No. NMNM01165
2. Name of Operator MEWBOURNE OIL COMPANY		6. If Indian, Allottee or Tribe Name
Contact: JACKIE LATHAN E-Mail: jlathan@mewbourne.com		7. If Unit or CA/Agreement, Name and/or No.
3a. Address PO BOX 5270 HOBBS, NM 88241	3b. Phone No. (include area code) Ph: 575-393-5905	8. Well Name and No. GLOCK 17 B2EH FEDERAL 1H
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 17 T20S R29E Mer NMP SWNW 2320FNL 170FWL		9. API Well No. 30-015-42664
		10. Field and Pool, or Exploratory BONE SPRING
		11. County or Parish, and State EDDY COUNTY, NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other Drilling Operations
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompletable horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

10/16/14 TD 12 1/4" hole @ 3019'. Ran 3019' of 9 5/8" 36# J55 LT&C csg. Cement 1st stage with 500 sks Lite Class C (35:65:4) w/additives. Mixed @ 12.5 #/g w/2.20 yd. Tail w/200 sks Class C Neat. Mixed @ 14.8#/g w/1.32 yd. Plug down @ 10:00 PM 10/16/14. Set external csg packer w/2350#. Ddrop bomb & open DV tool w/875#. Circ 102 sks of cement off of DV tool to the pit. Cmt 2nd stage w/250 sks Lite Class C (35:65:4) w/additives. Mixed @ 12.5#/g w/2.21 yd. Tail w/100 sks Class C w/1% CaCl2. Mixed @ 14.8#/g w/1.33 yd. Plug down @ 2:45 A.M. 10/17/14. Circ 86 sks of cmt to the pit. WOC. Set Wellhead slips w/100k. Tested csg spool pack-off to 2000#. Tested BOPE to 3000# & Annular to 1500#. At 1:30 A.M. 10/18/14, tested csg to 1500# for 30 mins, held OK. Drilled out with 8 3/4" bit.

Charts & Schematic attached.

Accepted for record
NMOCNM OIL CONSERVATION
ARTESIA DISTRICT

FEB 06 2015

RND 2/16/15

RECEIVED

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #272289 verified by the BLM Well Information System
For MEWBOURNE OIL COMPANY, sent to the Carlsbad
Committed to AFMSS for processing by DEBORAH HAM on 01/28/2015

Name (Printed/Typed) JACKIE LATHAN

Title AUTHORIZED REPRESENTATIVE

Signature (Electronic Submission)

Date 10/21/2014

ACCEPTED FOR RECORD

FEB 4 2015

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

BUREAU OF LAND MANAGEMENT
CARLSBAD FIELD OFFICE

Approved By

Title

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

**** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ****

Additional data for EC transaction #272289 that would not fit on the form

32. Additional remarks, continued

Bond on file: NM1693 nationwide & NMB000919

Bond on file: 22015694 nationwide & 022041703 Statewide

MAN WELDING SERVICES, INC.

Company NewBoys ^{clock} Date 10-17-14
Lease Clock 17 BETH Ford-HH County Eddy County
Drilling Contractor Patterson 41 Plug & Drill Pipe Size 11C-22 7/2x4
Accumulator Pressure: 3000 Manifold Pressure: 1500 Annular Pressure: 000

Accumulator Function Test - OO&GO#2

To Check - USABLE FLUID IN THE NITROGEN BOTTLES (III.A.2.c.i. or ii or iii)

- Make sure all rams and annular are open and if applicable HCR is closed.
- Ensure accumulator is pumped up to working pressure! (Shut off all pumps)
 - 1. Open HCR Valve. (If applicable)
 - 2. Close annular.
 - 3. Close all pipe rams.
 - 4. Open one set of the pipe rams to simulate closing the blind ram.
 - 5. For 3 ram stacks, open the annular to achieve the 50+ % safety factor. (5M and greater systems).
 - 6. Record remaining pressure 1275 psi. Test Fails if pressure is lower than required.
 - a. {950 psi for a 1500 psi system} b. {1200 psi for a 2000 & 3000 psi system}
 - 7. If annular is closed, open it at this time and close HCR.

To Check - PRECHARGE ON BOTTLES OR SPHERICAL (III.A.2.d.)

- Start with manifold pressure at, or above, maximum acceptable pre-charge pressure:
 - a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system}
- 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure)
- 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to.
- 3. Record pressure drop 1000 psi. Test fails if pressure drops below minimum.
- Minimum: a. {700 psi for a 1500 psi system} b. {900 psi for a 2000 & 3000 psi system}

To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.)

- Isolate the accumulator bottles or spherical from the pumps & manifold.
- Open the bleed off valve to the tank, {manifold psi should go to 0 psi} close bleed valve.
 - 1. Open the HCR valve, {if applicable}
 - 2. Close annular
 - 3. With pumps only, time how long it takes to regain the required manifold pressure.
 - 4. Record elapsed time 1:31.42. Test fails if it takes over 2 minutes.
 - a. {950 psi for a 1500 psi system} b. {1200 psi for a 2000 & 3000 psi system}



Pg. 1 of 2



Invoice # 69725

Ring # 41

Tester: T. J. [Signature]


Installed BOP:

• Check Valve Must Be Open/Disabled To Test Kill Line Valves

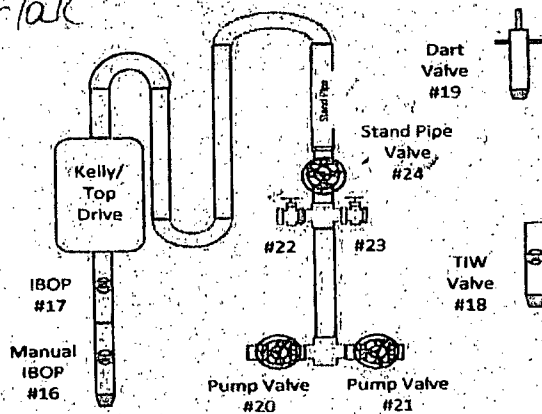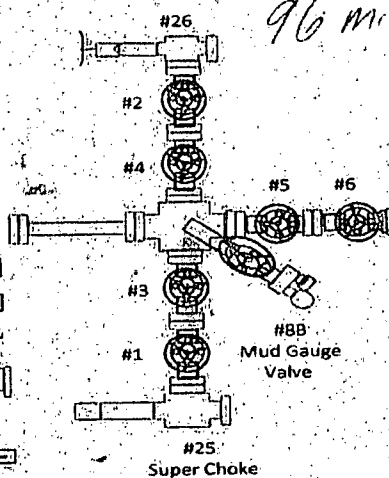[illegible]

5 PRINTED IN U.S.A. 6 PM 57

5 6 AM New York

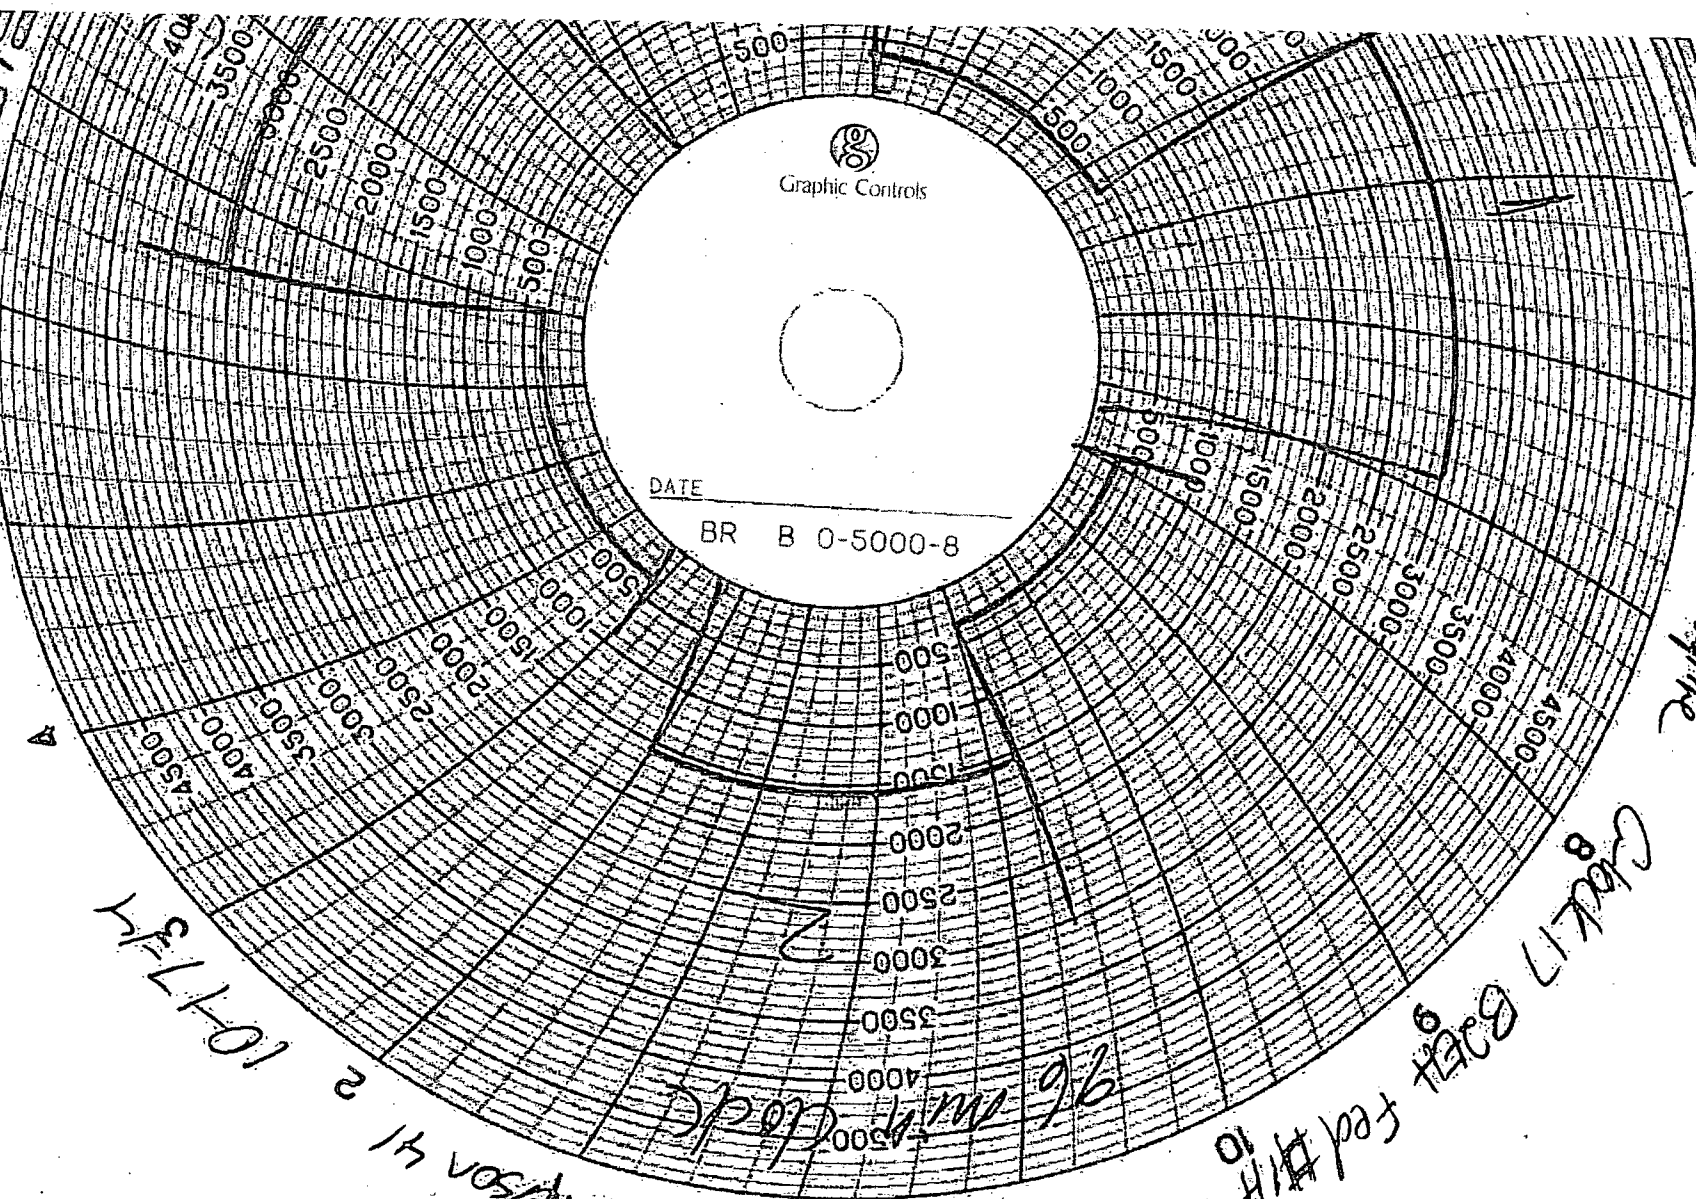


10-17-34

Watson 41 2

Eddy County NOON

fed #11 10

8 Oct 17 824

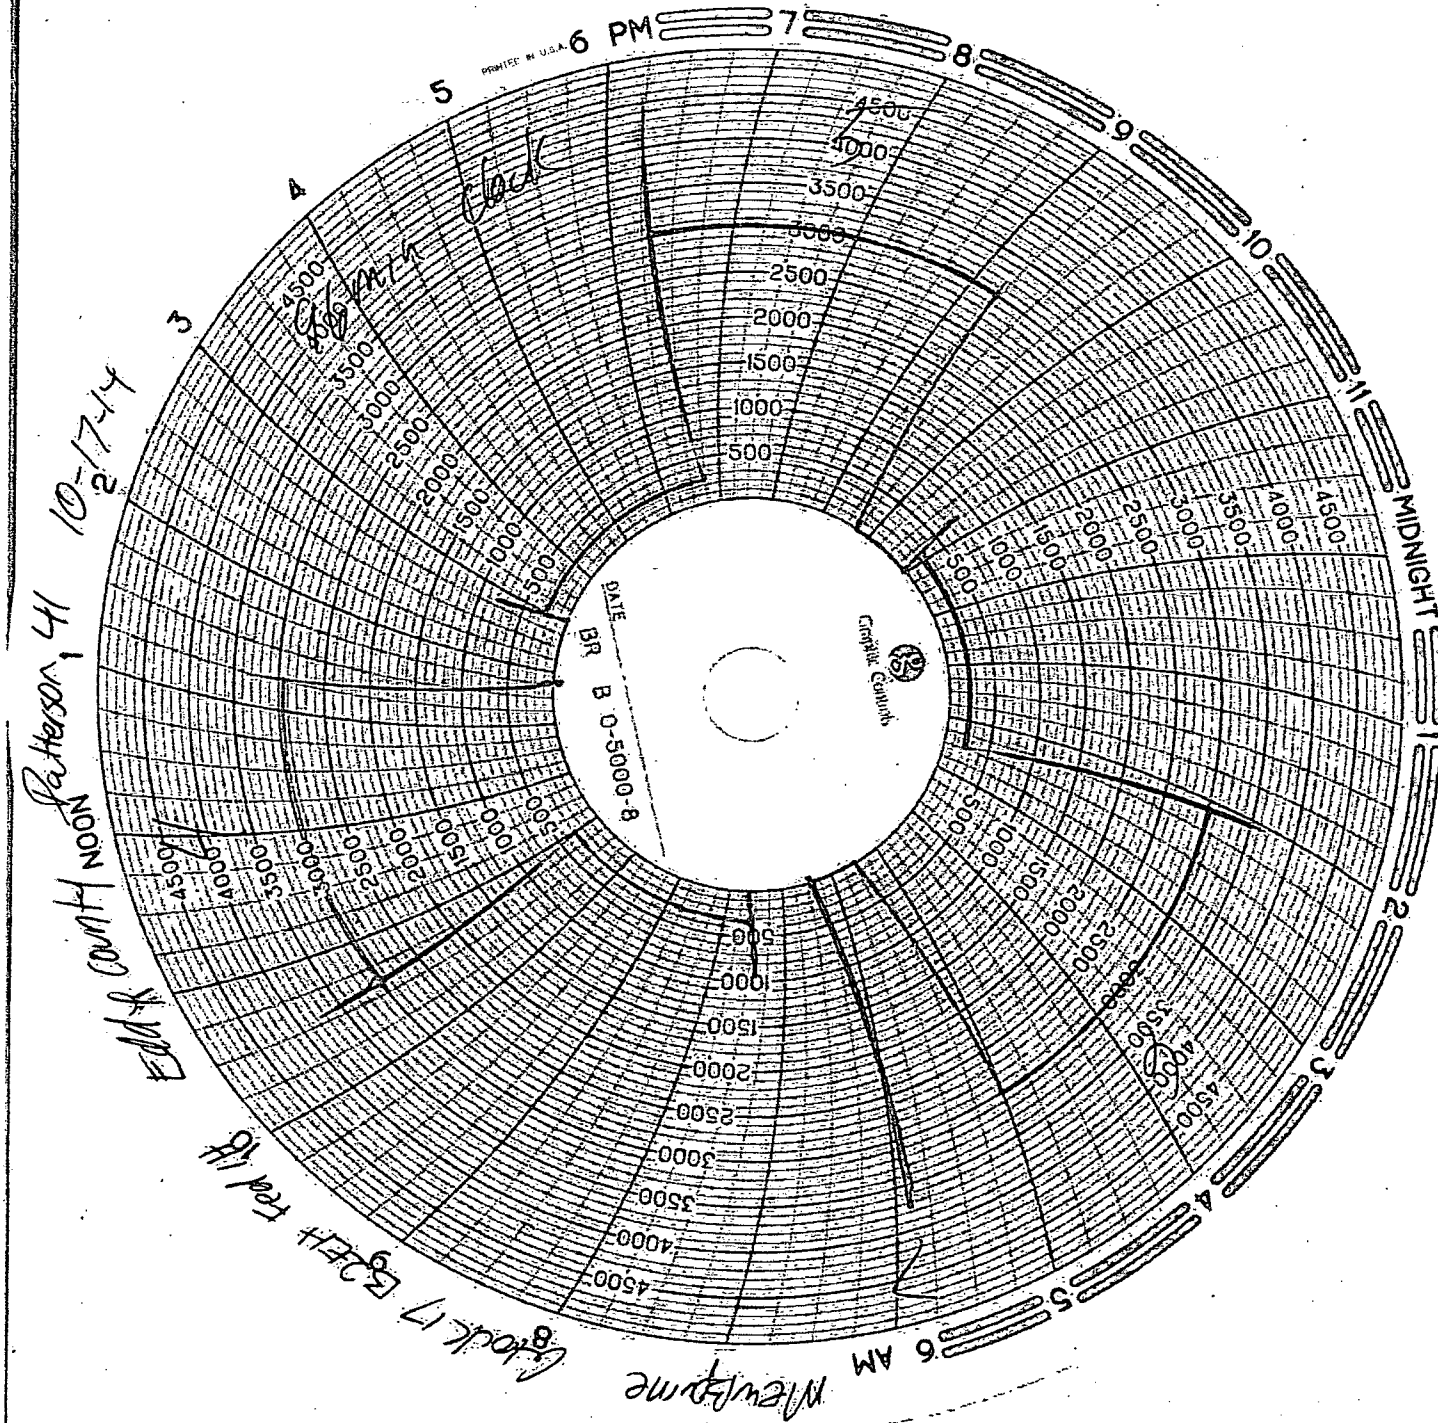

3W Borne Clock 17 BZEH FEB 10 H

10-11-50 NOON

Eddy count 2 10-11-54

