Form 3160-5 (Aug ast 2007)

DEPARTMENT OF THE INTERIOR ARTES OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

3 2015 ΔIIG

5. Lease Serial No.

BUREAU OF LAND MANAGEMENT // CARL SRAD FIFED OFFICE

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals RECEIVED					6. If Indian, Allottee or Tribe Name		
							SUBMIT IN TRIPLICATE - Other instructions on reverse side.
Type of Well					8. Well Name and No. TODD 26K FED 10		
Name of Operator DEVON ENERGY PRODUCT	EAL COM		9. API Well No. 30-015-27102-00-S1				
3a. Address 333 WEST SHERIDAN AVE OKLAHOMA CITY, OK 73102		3b. Phone No. (include area code) Ph: 405-228-8429		10. Field and Pool, or Exploratory INGLE WELLS			
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)	1)			11. County or Parish, and State		
Sec 26 T23S R31E NESW 19				EDDY COUNTY, NM			
12. CHECK APPI	ROPRIATE BOX(ES) TO	INDICATE	NATURE OF N	OTICE, R	EPORT, OR OTHER	R DATA	
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent	☐ Acidize	☐ Deepen ☐ Prod		□ Produc	tion (Start/Resume)	■ Water Shut-Off	
- .	☐ Alter Casing	☐ Fracture Treat ☐ Recl		Reclam	nation	Well Integrity	
☐ Subsequent Report	□ Casing Repair	☐ New Construction ☐ Reco		□ Recom	plete	Other	
☐ Final Abandonment Notice	☐ Change Plans	☐ Plug and Abandon 🖪		▼ Tempo	emporarily Abandon		
	☐ Convert to Injection	t to Injection Plug Back		☐ Water	☐ Water Disposal		
Attach the Bond under which the wo following completion of the involved testing has been completed. Final Al determined that the site is ready for f Devon Energy Production Conthe following procedures: -Test Anchors -MIRU WSU -ND WH, NU BOPE and test -Unset TAC and TOH w/ 2-7/8 -MIRU WL unit & make gauge -RIH and WL set CIBP @ 8,11 -Dump bail 35? cement on top -RIH and WL set CIBP @ 689 -Dump bail 35? cement on top	d operations. If the operation result of the operation result of the operation result of the operation result of the operation.) Impany, LP respectfully required from the structure of the operation results of the operatio	PBTD at 8,15 a bove to BTD at 6,90	e completion or reco equirements, includi an MIT on the re SE CC 55? KBM P MOST POST 100? KBM	mpletion in a ng reclamatic ferenced w	new interval, a Form 3160 in, have been completed, a rell with ACHED FOR IONS OF API	0-4 shall be filed once and the operator has	
Comm Name(Printed/Typed) REBECC	Electronic Submission #30 For DEVON ENERGY nitted to AFMSS for processi A DEAL	PRODUCT	ON CO LP, sent t FER SANCHEZ o	o the Carls n 07/29/201	bad [*]	/]/	
Signature (Electronic	Submission)		Date 07/09/20	015	APPROXIFI	7-//	
	THIS SPACE FOR	R FEDERA	L OR STATE	OFFICE	ISÉ //	71	
Approved By			Title		JUL 2/9 2015	man	
Conditions of approval, if any, are attached. Approval of this notice does not war certify that the applicant holds legal or equitable title to those rights in the subject				BU//	AU OF LAND MANAGI	EMENT	

Office

-which would entitle the applicant to conduct operations thereon.

Additional data for EC transaction #308655 that would not fit on the form

32. Additional remarks, continued


-RD WL
-TIH with SN and 2-7/8? tubing to 6,850? KBM.
-Load and circulate hole with 2% KCL and corrosion inhibitor
-Test 5-1/2? casing and CIBP w/ cement plug to 500 psi at surface for 30 minutes, chart test and have BLM witness test
-Bleed off pressure, ND BOPE, NU WH
-RDMO WSU
Shut in well


-Shut-in well

Devon respectfully requests a 2 year TA status for the captioned well.

TA?ing well to bring well into OCD compliance, until well can be evaluated.

Attached: Current and Proposed Wellbore Schematics.

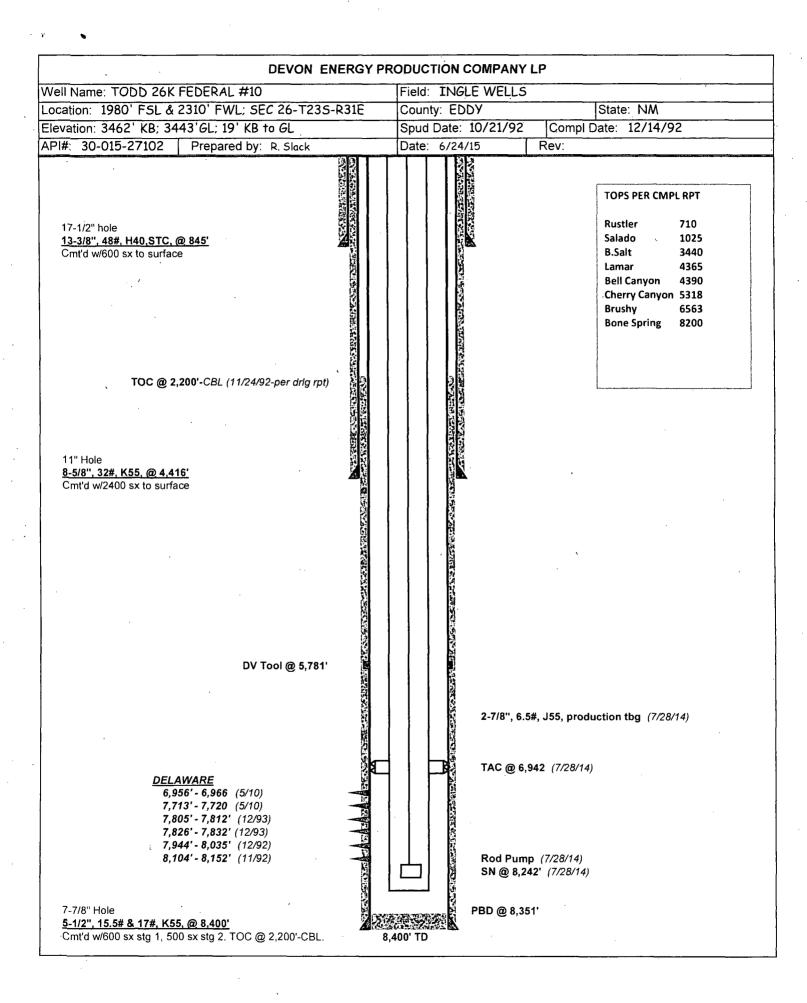

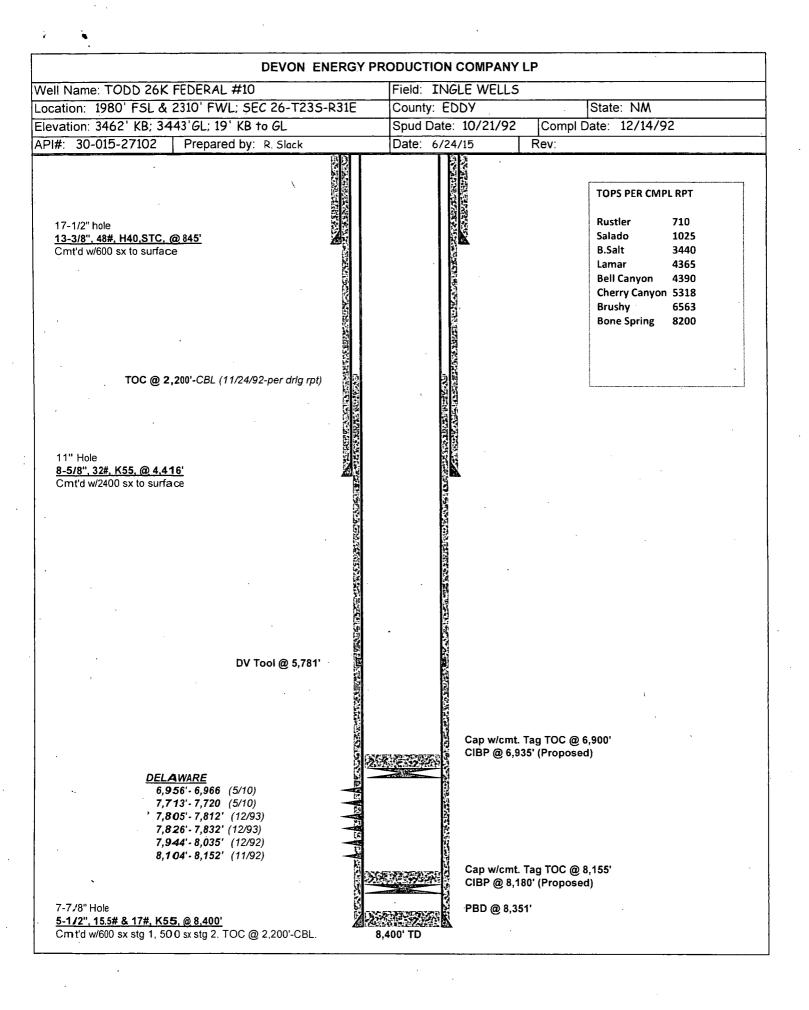

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Work to be completed by 01/28/2016.

1. Operator shall set a CIBP at 6,906' (50' above top most perf) and <u>place 170' Class C</u> cement on top.

TA status approved for a period of 12 months ending 01/28/2017 subject to conditions of approval.

Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.
 - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, placed with tubing, or 35 feet of cement if placed with bailer.
 - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.
 - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
 - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
 - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- 1. Submits a subsequent Sundry Notice (Form 3160-5) requesting TA approval with well bore diagram with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Todd 26K Fed 10

- 1. Well is approved to be TA/SI for a period of 12 months or until 01/28/2017
- 2. This will be the last TA approval for this well.
- 3. Must submit NOI to recomplete or NOI to P&A. Must be submitted by 01/28/2017
- 4. COA's met at this time.