## $1 \le s \eta^{3^{k}}$ Form 3160-5 (August 2007)

# NM OIL CONSERVATION

**UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT ARTESIA DE TAHETSIA 3 2015 AUG

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

	Expires, July
5.	Lease Serial No.
	NMNM0405444

		AND REPORTS		
Do not use this	s form for p	roposals to drill	or to re-enter an	

Do not use thi abandoned wel	6. If Indian, Allottee or Tribe Name						
SUBMIT IN TRII	7. If Unit or CA/Agreement, Name and/or No.						
1. Type of Well	8. Well Name and No. TODD 10P FED 16						
☑ Oil Well ☐ Gas Well ☐ Oth							
Name of Operator     DEVON ENERGY PRODUCT	9. API Well No. 30-015-32692-00-S1						
3a. Address 333 WEST SHERIDAN AVE OKLAHOMA CITY, OK 73102	2	(include area code) 8-8429	)	10. Field and Pool, or Exploratory INGLE WELLS-DELAWARE			
4. Location of Well (Footage, Sec., T.		11. County or Parish, and State					
Sec 10 T23S R31E SESE 510		EDDY COUNTY, NM					
12. CHECK APPE	ROPRIATE BOX(ES) TO	INDICATE	NATURE OF 1	NOTICE, RE	PORT, OR OTHER	R DAȚA	
TYPE OF SUBMISSION			TYPE O	F ACTION			
- N	☐ Acidize	☐ Deep	oen .	☐ Producti	on (Start/Resume)	☐ Water Shut-Off	
■ Notice of Intent	☐ Alter Casing		ture Treat	☐ Reclama		☐ Well Integrity	
☐ Subsequent Report	☐ Casing Repair	□ New	Construction	□ Recomp	lete	☐ Other	
☐ Final Abandonment Notice	☐ Change Plans	🗖 Plug	and Abandon		arily Abandon		
	☐ Convert to Injection	ection Plug Back Water Disposal		isposal			
Attach the Bond under which the wo following completion of the involved testing has been completed. Final Al determined that the site is ready for f Devon Energy Production Corthe following procedures:	operations. If the operation respondenment Notices shall be file inal inspection.)	sults in a multipled only after all i	e completion or rec requirements, includ	ompletion in a r ding reclamation	new interval, a Form 3160 n, have been completed, a	0-4 shall be filed once	
-Test Anchors -MIRU WSU -ND WH, NU BOPE and test, -Unset TAC and TOH w/ 2-7/8? tubing -MIRU WL unit & make gauge run to 8,255? KBM -RIH and WL set CIBP @ 8,250? KBM							
-Dump bail 35? cement on top -RIH and WL set CIBP @ 6,4 -Dump bail 35? cement on top additional cement	o of CIBP, estimating top of 34? KBM — o of CIBP, estimating new	PBTD at 6,3	99? KBM		Accepted find NMO	A 5 7	
14. Thereby certify that the foregoing is  Comm  Name (Printed/Typed) REBECC	#Electronic Submission # For DEVON ENERG nitted to AFMSS for proces	Y PRODUCT	ON CO LP, sent IFER SANCHEZ	to the Carlsb on 07/28/2015	ad ,	,	
Signature (Electronic	Submission)		Date 07/09/2	015 <b>/</b>	DODOVED		
·	THIS SPACE FO	R FEDERA	L OR STATE	1	SE NOVED	7/1	
Approved By			. Title		UL 28 2015/	,Earle	
Conditions of approval, if any, are attache certify that the applicant holds legal or eq which would entitle the applicant to condition	uitable title to those rights in the	Office	BUREAU	m The			
Title 19 H.S.C. Section 1001 and Title 42	II C C   Continu 1212 makes it a			J. mc/LARL	SKAD KIEHO OFFICE	-111 Catalana	

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly ahd—States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*

#### Additional data for EC transaction #308644 that would not fit on the form

#### 32. Additional remarks, continued

-RĎ WL


-RD WL
-TIH with SN and 2-7/8? tubing to 6,350? KBM.
-Load and circulate hole with 2% KCL and corrosion inhibitor
-Test 5-1/2? casing and CIBP w/ cement plug to 500 psi at surface for 30 minutes, chart test and have BLM witness test
-Bleed off pressure, ND BOPE, NU WH
-RDMO WSU


-Shut-in well

TA?ing well to bring well into OCD compliance, until well can be evaluated.

Secon Devon respectfully requests a 2 year TA status for the captioned well.

Attached: Current and Proposed Wellbore Schematics.

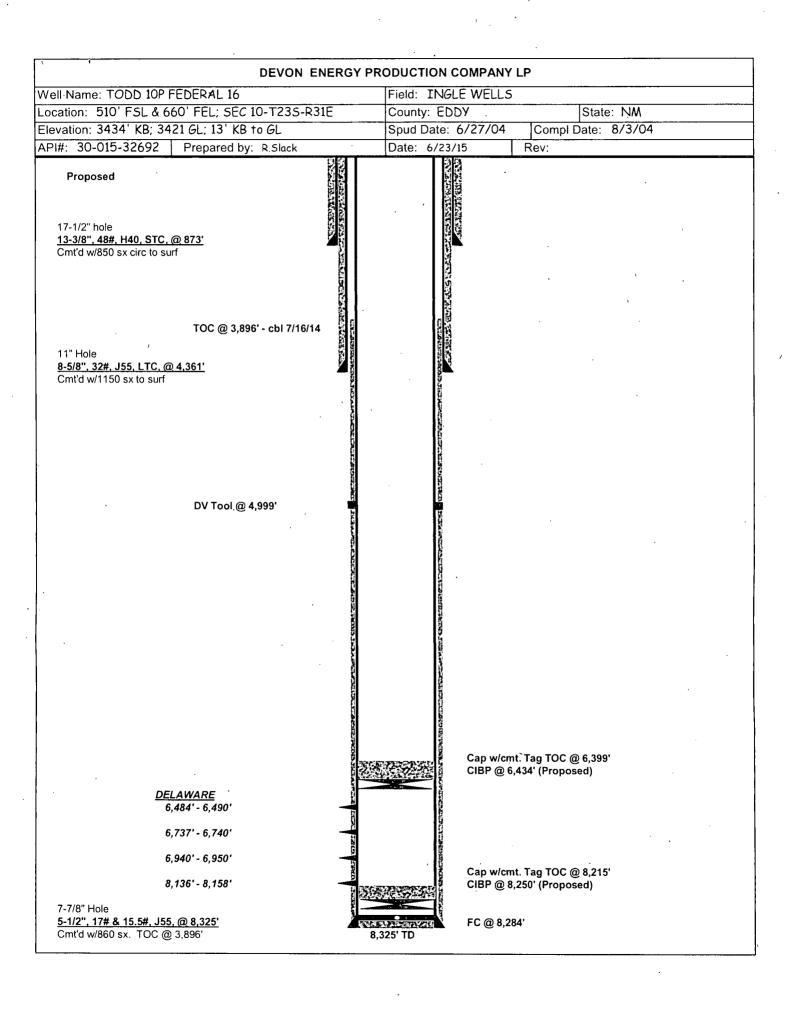

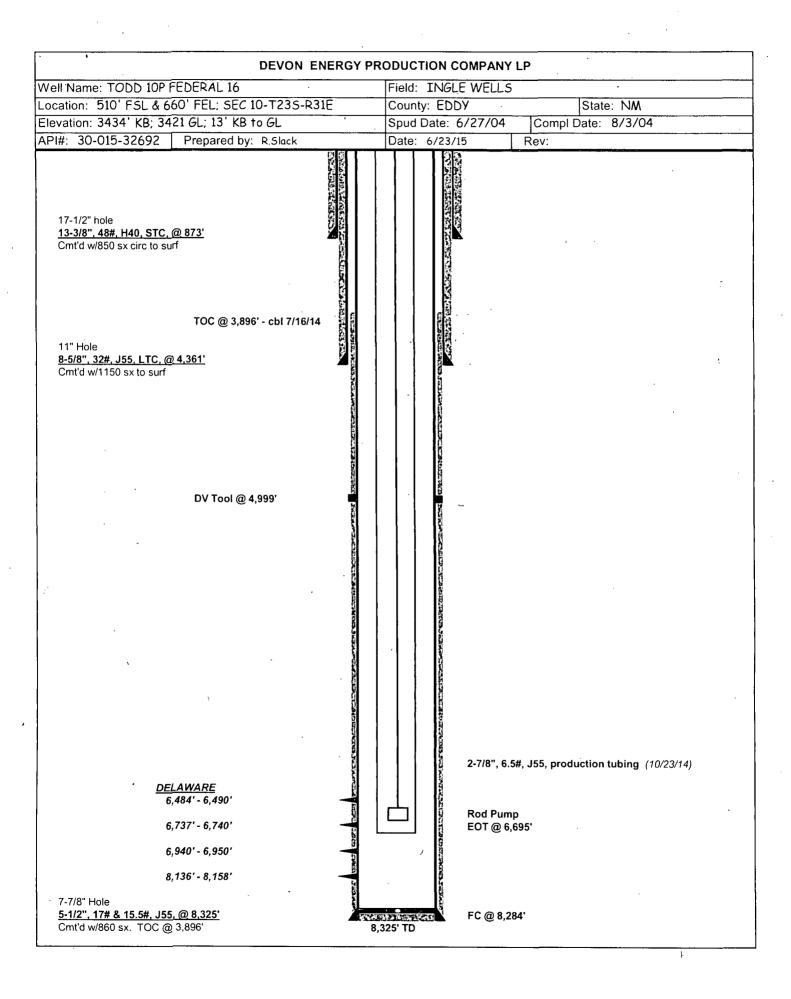

#### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

#### Work to be completed by 10/28/2015.

TA status approved for a period of 12 months ending 10/28/2016 subject to conditions of approval.

#### Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.
  - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, placed with tubing, or 35 feet of cement if placed with bailer.
  - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.
  - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
  - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
  - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 3 Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- 1. **Submits a subsequent Sundry Notice** (Form 3160-5) requesting TA approval <u>with well bore diagram</u> with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

### Todd 10P Fed 16

- 1. Well is approved to be TA/SI for a period of 12 months or until 10/28/2016
- 2. This will be the last TA approval for this well.
- $\textbf{3.} \ \ \textbf{Must submit NOI to recomplete or NOI to P\&A. } \ \ \textbf{Must be submitted by 010/28/2016}$
- 4. COA's met at this time.