

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0135
Expires: January 31, 2004

SUNDRY NOTICES AND REPORTS ON WELLS
**Do not use this form for proposals to drill or to re-enter an
abandoned well. Use Form 3160-3 (APD) for such proposals.**

5. Lease Serial No.

NM 19842 A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

Artemis Federal Com #2

9. API Well No.

30-015-34391

10. Field and Pool, or Exploratory Area

Dublin Ranch Morrow 76140

11. County or Parish, State

Eddy County, NM

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

NADEL AND GUSSMAN PERMIAN, LLC

3a. Address

601 N. MARIENFELD MIDLAND, TX 70701 Suite 508

3b. Phone No. (include area code)

(432) 682-4429

4. Location of Well (Footage, Sec., T, R., M., or Survey Description)

UL L Sec. 33 T22S R28E 1,200' FSL & 1,400' FEL

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


TYPE OF SUBMISSION	TYPE OF ACTION			
☐ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☒ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recomplete	☒ Other <u>CMT Inter. CSG</u>
	☐ Change Plans	☐ Plug and Abandon	☐ Temporarily Abandon	
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

3. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

11/17/05 TOO H L/D 8" DC and held safety meeting. Rig up casing crew and run 44 joints of 40# P-110 and 91 joints of N-80 LTC. RU Schlumberger and circulate complete casing and annulus volumes. Pump 1,956 sx 35/65 poz C + additives and 200 sx of class C + adds circulated 340 sx. Rig down Schlumberger WOC 18 hours and jet pits nipple down BOP. Set slips under full tension and cut off. Nipple up BOP.

11/18/05 Nipple up BOP w/o tester. Test BOP, Choke, and Accumulator 2,500# high and 250# low for 30 minutes OK. P/U New BHA and 23 6" drill collars TIH and L/D 13 joints of DP. Drilling Cement and float collar.

11/19/05 Test casing for 30 minutes 1,500 psi high and 250 low. Drill out cement and float shoe.

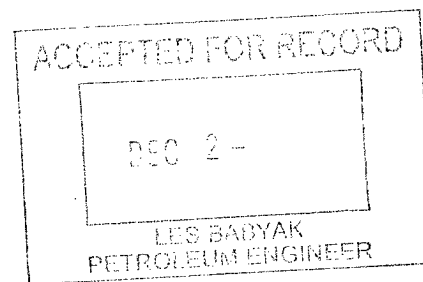

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

JOSH FERNAU

Title STAFF ENGINEER

Signature

Date 11/22/04

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by (Signature)

Name
(Printed/Typed)

Title

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Date

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Continued on next page)