Form 3160-5 (March 2012)

NMOCD Artesia

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

FORM APPROVED OMB No. 1004-0137

NM 100542


	Expires:	October	31
Lease Serial Mo			

SUNDRY NOTICES AND REPORTS ON WELLS
o not use this form for proposals to drill or to re-enter an
andoned well. Use Form 3160-3 (APD) for such proposals


6. If Indian, Allottee or Tribe Name

	Use Form 3160-3 (APL					
SUBMIT IN TRIPLICATE - Other instructions on page 2.			7. If Unit of CA/Agi	reement, Name and/or No.		
1. Type of Well						
Oil Well Gas V	Vell Other			8. Well Name and N	PAISANO FEDERAL #1	
2. Name of Operator JALAPENO	CORPORATION			9. API Well No.	30-005-63840	•.
3a. Address P.O. BOX 1608, ALBQUERQUE	E, NM 87103	Phone No. (inclu 505-242-2050	· ·	10. Field and Pool o Wolf Lake, Sar	r Exploratory Area n Andres, South	
4. Location of Well (Footage, Sec., T.,	R M or Survey Description	505-242-2050		11. County or Parish		
SEC. 12, T-9S, R-27E 330' FSL & 330' FE	, ,	. ,		CHAVES, NM		
12. CHEC	CK THE APPROPRIATE BOX(ES) TO INDICATI	NATURE OF N	OTICE, REPORT OR OT	HER DATA	
TYPE OF SUBMISSION			TYPE OF	ACTION		
Notice of Intent	Acidize	Deepen Deepen		Production (Start/Resume)	Water Shut-Off	
<u></u>	Alter Casing	Fracture Tre	at 🔲	Reclamation	Well Integrity	
Subsequent Report	Casing Repair	New Constr	iction 🔲	Recomplete	Other	
Cussiquent report	Change Plans	Plug and At	andon 🔲	Temporarily Abandon		
Final Abandonment Notice	Convert to Injection	Plug Back		Water Disposal	·	
		S WELL. HOWE	/ER, WE CONTI	INUED TO PRODUCE 1	THE WELL BEYOND THE F	
PBTD OF THE WELL IS 2	245'. WE PROPOSE TO:				5.00 m m m	
1. SET A CEMENT PLUG FROM PBTD TO 50FT ABOVE TOP PERFORATIONS (APPR. 2142. WAIT FOR CEMENT TO DRY AND TAG AT OR ABOVE 2145. 3. FILL HOLE WITH MUD 50FT BELOW SURFACE SHOE. 4. PERFORATE 50FT BELOW SURFACE SHOE AND CIRCULATE CEMENT HOLE TO SUF 5. WAIT FOR CEMENT TO DRY.			·	NM OIL CON: ARTESIA D APR 1 8	ISTRICT	
6. SET DRY HOLE MARKI				·.*:	RECEIV	/Pm
,	Accepted for reco			OR_ 3 _MONTH L 1 4 2016	1 PERIOD	VED
14. I hereby certify that the foregoing is t	rue and correct. Name (Printed/T	yped)				
H. EMMONS YA	ATES III	Title	VICE PRESIDE	ENT		
Signature 4 Com	10	Date	04/11/2016			
	THIS SPACE FO	OR FEDERAL	OR STATE	OFFICE USE		
Approved by /C/ DAV/	DR. GLASS	<u> </u>			ADD 1 1 2014	
Conditions of approval, if any, are attache that the applicant holds legal or equitable	d. Approval of this notice does no	t warrant or certify		um'engineer Poswell Field (Date APR 1 4 2016 OFFICE	
NOTE: In The Future, Pleas Notice" For Notice Of Inter		y for any person k			nent or agency of the United State	es any false,
Plugging Approval For Wells Needed Prior To Comme	I If Additional Time		,	SEE ATTAC	CHED FOR	
Thanks.	- 33 3		CO	NDITIONS ()F APPROVAL	-

SCHEMATIC PRIOR TO PLUG AND ABANDON
JALAPENO CORPORATION
PAISANO FEDERAL #1
CHAVES COUNTY, NEW MEXICO
API NO. 30-005-63840

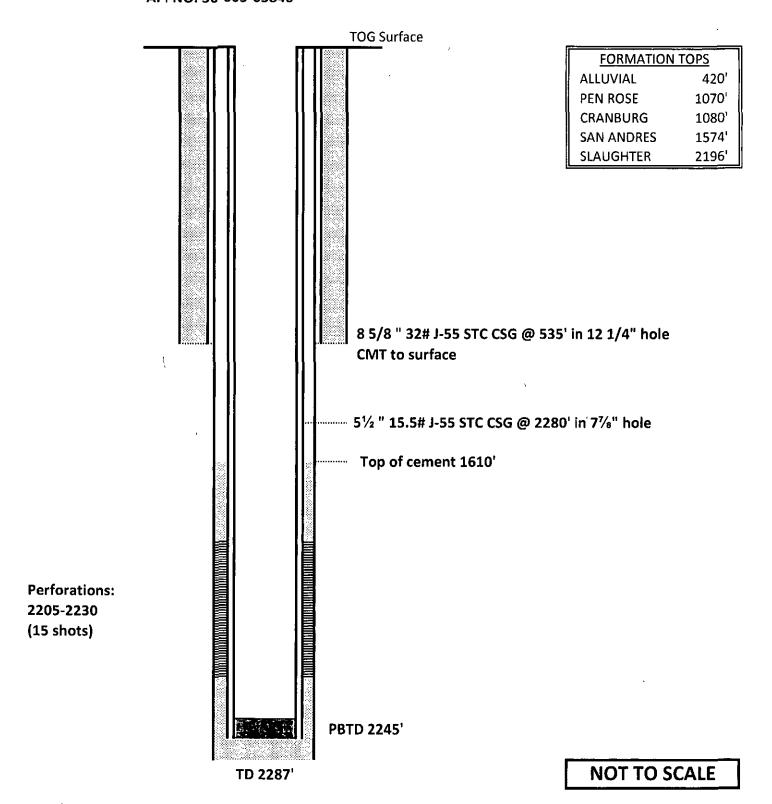

SCHEMATIC AFTER PLUG AND ABANDON
JALAPENO CORPORATION
PAISANO FEDERAL #1
CHAVES COUNTY, NEW MEXICO
API NO. 30-005-63840

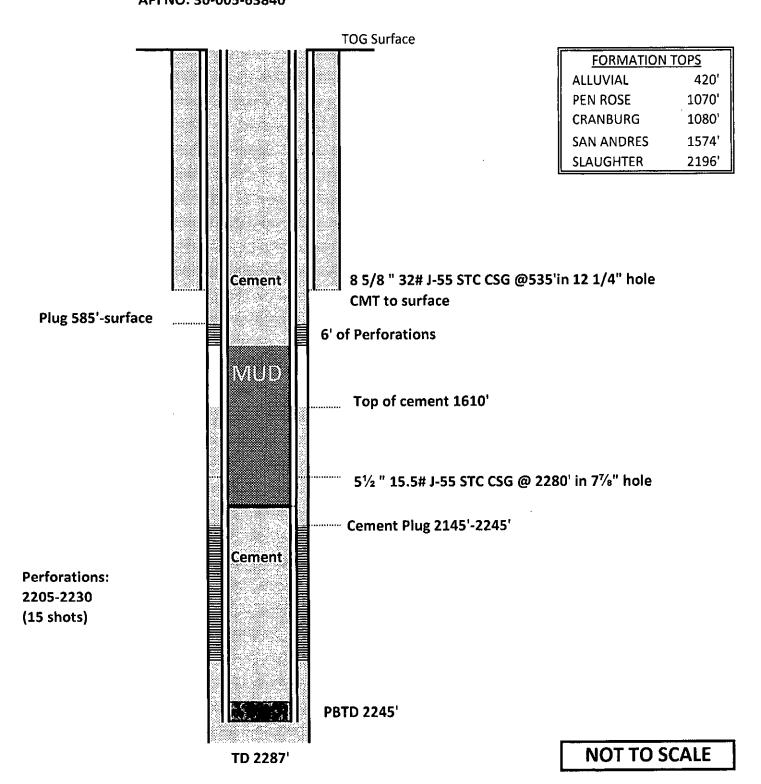

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

- 1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office (RFO), prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.
- 2. <u>Notification:</u> Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.
- 3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

- 6. <u>Dry Hole Marker:</u> All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.