Form 3160-5 (August 2007)	UNITED STATE	NMOCD	FC	DRM APPROVED
, DE	DEPARTMENT OF THE INTERIOR ALLESIA			1B NO. 1004-0135 bires: July 31, 2010
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.			5. Lease Serial N NMNM1038	
			6. If Indian, Allo	ttee or Tribe Name
SUBMIT IN TRI	PLICATE - Other instruc	ctions on reverse side.	7. If Unit or CA/	Agreement, Name and/or No.
I. Type of Well ☐ Oil Well ⊠ Gas Well ☐ Other			8. Well Name and NITRAM AVI	l No. N FEDERAL 1
2. Name of Operator YATES PETROLEUM CORPO	Contact:	TINA HUERTA espetroleum.com	9. API Well No. 30-005-623	 26-00-S2
3a. Address 105 SOUTH FOURTH STREET ARTESIA, NM 88210		3b. Phone No. (include area code Ph: 575-748-4168 Fx: 575-748-4585	e) 10. Field and Poo FOOR RAN PECOS SLO	ICH-WOLFCAMP
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)) ·	11. County or Pa	
Sec 34 T8S R26E SWSW 660FSL 660FWL			CHAVES C	OUNTY, NM
12. CHECK APPR	OPRIATE BOX(ES) TO	D INDICATE NATURE OF	I NOTICE, REPORT, OR OT	HER DATA
TYPE OF SUBMISSION	TYPE OF ACTION			
Notice of Intent		Deepen	Production (Start/Resume	e) 🔲 Water Shut-Off
	Alter Casing	Fracture Treat	□ Reclamation	Well Integrity
Subsequent Report	Casing Repair	New Construction	Recomplete	Other
Final Abandonment Notice	□ Change Plans □ Convert to Injection	Plug and Abandon Plug Back	Temporarily Abandon Water Disposal	
 MIRU any safety equipment RIH and tag CIBP at 4441 ft the Abo. Perforate at 2256 ft. Spot a the Glorieta inside and outside Perforate at 1195 ft. Spot a the 8-5/8 inch casing shoe insi 5. Perforate at 60 ft. Spot a 25 outside the 4-1/2 inch casing Cut off wellhead. If needed 	and dump 35 ft Class C 35 sx Class C cement pl the casing WOC & T 30 sx Class C cement pl de and outside the casing sx Class C cement plug	ug from 2136 ft - 2256 ft. Th 49 ug from 1085 ft - 1195 ft. Th g - WUC & Tag from 60 ft up to surface insic	is will cover JUN	DNSERVATION JA DISTRICT 2 4 2016 ECEIVED
	#Electronic Submission For YATES PETR nmitted to AFMSS for pro-	342392 verified by the BLM We DLEUM CORPORATION, sent cessing by DAVID GLASS on 0	to the Roswell 6/17/2016 (16DRG0290SE)	
Name (Printed/Typed) TINA HUE				ted for record
Signature (Electronic S	·	Date 06/17/2		MOCD
<u>Approved By DAVID R GLASS</u> Conditions of approval, if any, are attached ertify that the applicant holds legal or equi which would entitle the applicant to conduc	table title to those rights in the	not warrant or		Date 06/17/20
itle 18 U.S.C. Section 1001 and Title 43 U States any false, fictitious or fraudulent sl	J.S.C. Section 1212, make it a	crime for any person knowingly and	i willfully to make to any department	nt or agency of the United
			····	
PPROVED FOR 3_MC	NTH PERIOD) ** BLM REVISED ** BLI	SEE ATTACHE	DFOR

Additional data for EC transaction #342392 that would not fit on the form


32. Additional remarks, continued


7. Install dry hole marker and clean location.

Wellbore schematics attached

•

.

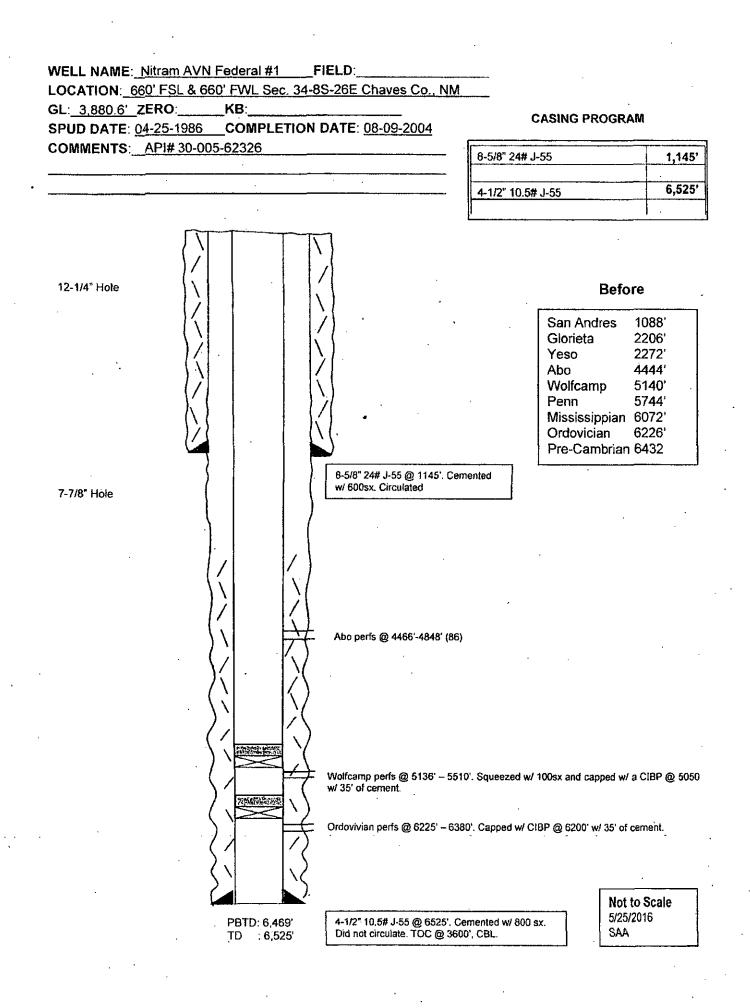

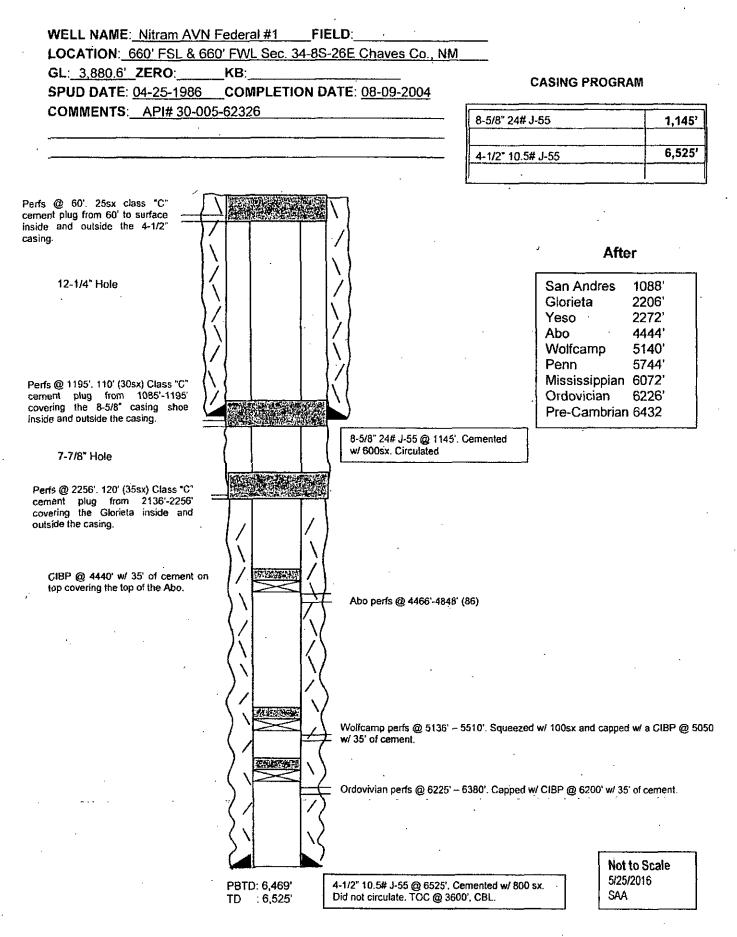

د

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office (RFO), prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.

2. <u>Notification</u>: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.