Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR NO OIL CONSERVATION BUREAU OF LAND MANAGEMENT ARTESIA DISTREMENT RY NOTICES AND DESCRIPTION

FORM APPROVED OMB NO. 1004-0137 expires: January 31, 2018

| | Expires: | January | 31, | 2 |
|----------|-----------|---------|-----|---|
| Lease Se | erial No. | | | |
| | | | | |

| SUNDRY NOTICES AND REPORTS ON WELLS $\eta \in \mathbb{C}$ |
|---|
| Do not use this form for proposals to drill or to re-enter an |
| abandoned well. Use form 3160-3 (APD) for such proposals. |


| BUREAU OF LAND MANAGEMENT 1838 ARTESIA 2016 | | | | | | nuary 31, 2018 | | | |
|--|---|--------------------------------------|--------------------------------|-----------|---|------------------|--|--|--|
| SUNDRY NOTICES AND REPORTS ON WELLS OF ? 2 2010 | | | | | 5. Lease Serial No. NMNM82896 | | | | |
| Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. | | | | | 6. If Indian, Allottee or Tribe Name | | | | |
| SUBMIT IN TRIPLICATE - Other instructions on page 2 | | | | | 7. If Unit or CA/Agreement, Name and/or No. | | | | |
| Type of Well Gas Well Other | | | | | 8. Well Name and No. NIMITZ 13 FED 1 | | | | |
| 2. Name of Operator Contact: DAVID STEWART | | | | | 9. API Well No. 30-015-29892-00-S1 | | | | |
| | | | . (include area code) | | | | | | |
| 5 GREENWAY PLAZA SUITE 110 Ph: 432.68 HOUSTON, TX 77046-0521 | | | | WILDCAT | | | | | |
| 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) | | | 11. County or Parish, State | | | tate | | | |
| Sec 13 T24S R30E NWNW 660FNL 330FWL | | | | | EDDY COUNTY, NM | | | | |
| 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA | | | | | | | | | |
| TYPE OF SUBMISSION | | | ACTION | | | | | | |
| Notice of Intent | ☐ Acidize | ☐ Dee | pen | ☐ Product | ion (Start/Resume) | ☐ Water Shut-Off | | | |
| _ | ☐ Alter Casing | □ Нус | ☐ Hydraulic Fracturing ☐ Recla | | ation | ■ Well Integrity | | | |
| ☐ Subsequent Report | ☐ Casing Repair | sing Repair | | ☐ Recomp | olete | ☐ Other | | | |
| ☐ Final Abandonment Notice | ☐ Change Plans | | | - | porarily Abandon | | | | |
| | ☐ Convert to Injection | Convert to Injection Plug Back Water | | □ Water I | Disposal | | | | |
| 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. | | | | | | | | | |
| TD-8200' PBTD-5938' Perfs-6426-7936' CIBP-6376' | | | | | | | | | |
| 13-3/8" 54.5# csg @ 624' w/ 740sx, 17-1/2" hole, TOC-Surf-Circ 8-5/8" 24-32# csg @ 4050' w/ 1275sx, 11" hole, TOC-Surf-Circ 5-1/2" 17# csg @ 8200' w/ 1540sx, DVT @ 6086', 7-7/8" hole, TOC-3160'-CBL | | | | | | | | | |
| 1. RIH & tag Cement/CIBP @ 5938' 2. M&P 25sx cmt @ 5120-4945' WOC-Tag 3. M&P 35sx cmt @ 4406:3850' WOC-Tag 4. Perf @ 2325', sqz 40sx cmt to 2200' WOC-Tag 5. Perf @ 875', sqz 250sx cmt to surface 10# MLF between plugs 14. I hereby certify that the foregoing is true and correct. Electronic Submission #351738 verified by the BLM Well Information System | | | | | | | | | |
| 14. I hereby certify that the foregoing is true and correct. Electronic Submission #351738 verified by the BLM Well Information System For OXY USA INCORPORATED, sent to the Carlsbad | | | | | | | | | |
| Commi | For OXY USA itted to AFMSS for process | | | | 6 (16DLM0954SE) | 7 | | | |
| Name (Printed/Typed) DAVID STEWART | | | Title REGULATORY ADVISOR | | | | | | |
| Signature (Electronic Submission) | | | Date 09/19/20 | 16 | | | | | |
| THIS SPACE FOR FEDERAL OR STATE OFFICE USE | | | | | | | | | |
| Approved By H | | | Title Eng. Date | | | Date | | | |
| Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. | | | Office CFO | | | | | | |
| Fitle 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United | | | | | | | | | |

Additional data for EC transaction #351738 that would not fit on the form

32. Additional remarks, continued


Above ground steel tanks will be utilized

OXY USA Inc. - Proposed Nimitz 13 Federal #1 API No. 30-015-29892

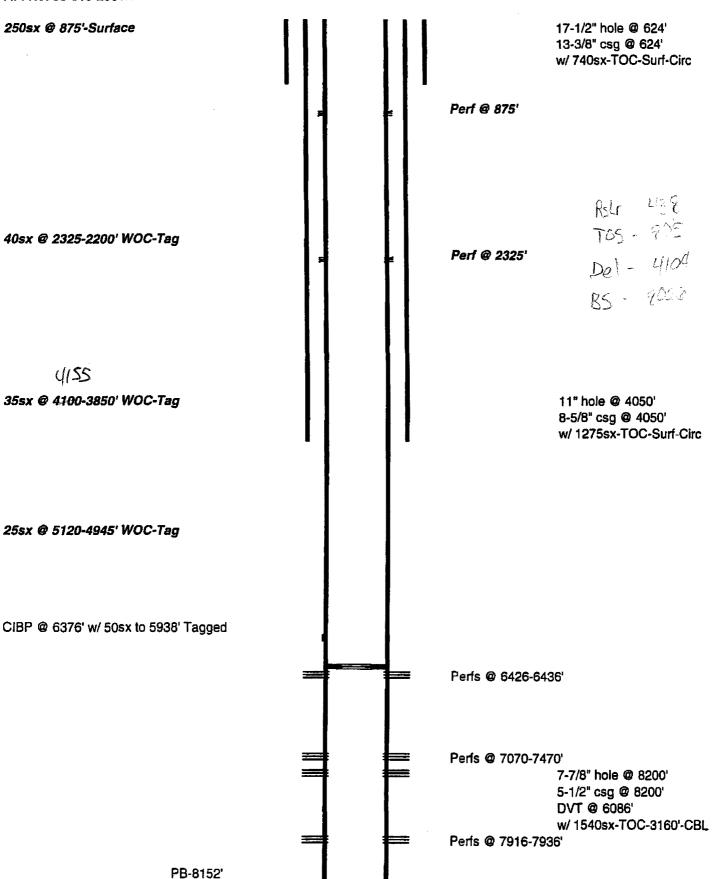

TD-8200

OXY USA Inc. - Current Nimitz 13 Federal #1 API No. 30-015-29892

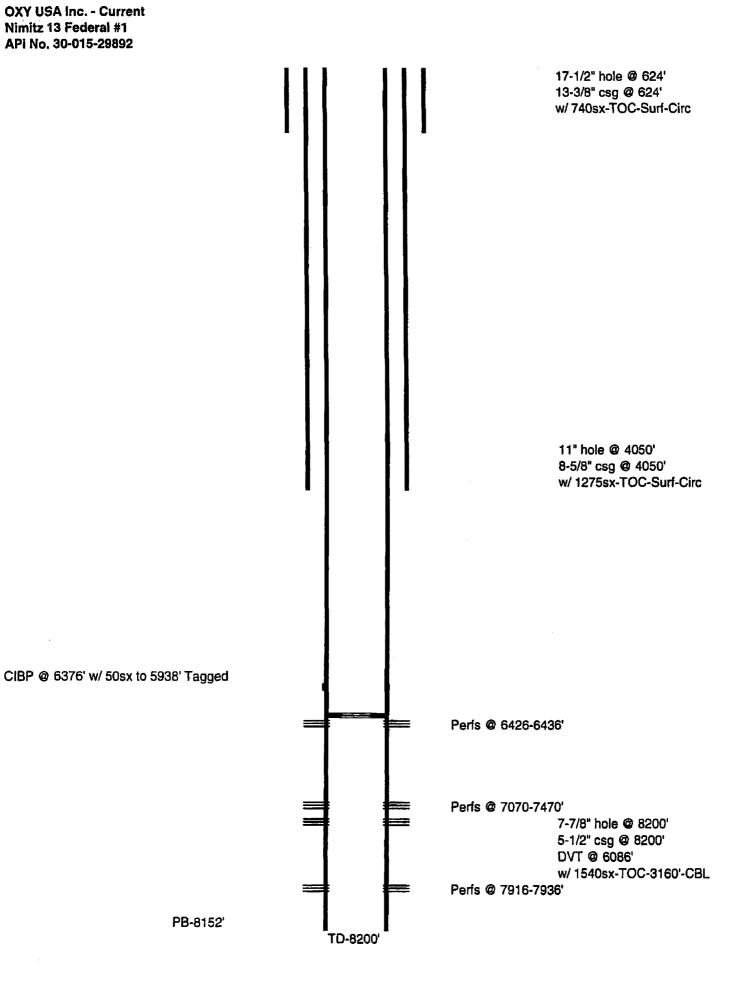

NM OIL CONSERVATION

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

DEC 2 2 2016

RECEIVED

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.