Form 3160-5 (June 2015)

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

**NMOCD** 

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

### 5. Lease Serial No. NMLC068282B

BUREAU OF LAND MANAGEMENT  SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					Expires: January 31, 2018		
					<ol><li>Lease Serial No. NMLC068282B</li></ol>		
					6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well					8. Well Name and No. GOLDEN SPUR		
⊠ Oil Well					9. API Well No.		
CONOCOPHILLIPS COMPANY E-Mail: ashley.bergen@conocoph					30-015-41230-00-S1		
3a. Address MIDLAND, TX 79710 1810  3b. Phone Ph: 432-			(include area code) 8-6938		10. Field and Pool or Exploratory Area WC 015 G 05 S263125N		
4. Location of Well (Footage, Sec., 7			11. County or Parish,	State			
Sec 25 T26S R31E SWSW 46			EDDY COUNTY, NM				
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	ΓE NATURE O	F NOTICE,	REPORT, OR OTI	HER DATA	
TYPE OF SUBMISSION TYPE OF ACTION							
D National Charles	☐ Acidize	☐ Dee	oen	☐ Production (Start/Resume)		☐ Water Shut-Off	
■ Notice of Intent	☐ Alter Casing	☐ Hyd	raulic Fracturing	☐ Reclama	ation	■ Well Integrity	
☐ Subsequent Report	ent Report		Construction	☐ Recomplete		☐ Other	
☐ Final Abandonment Notice	☐ Change Plans	☐ Plug	and Abandon		arily Abandon		
	☐ Convert to Injection	Plug	Back	☐ Water Disposal			
testing has been completed. Final Aldetermined that the site is ready for f ConocoPhillips respectfully re 2018, when market conditions in status that expires 1/1/17. TA prior to Christmas. This work the procedure for the TA of the 1.Test Anchors as needed. 2.Notify Champion we will be	inal inspection.  quest to TA this wellbore to improve and target idention copy would like to bring a rork will be done in accordants well is as follows:  RU on well.	o preserve it fied. The wel ig on Decem	for a potential si is currently in a ber 12-22,2016 i 1-2016-017.	detrack in pproved shu to complete	at Accepte	nd for record MOCD (2) 1/4/17	
3.Review JSA prior to RU on v 4.MI & RU WSU. 5.Kill well, function test BOP. 6.POOH & LD tubing with gas	ND wellhead, NU BOP. lift mandrels/valves. Send	d tubing and (			B E	OIL CONSERVATION ARTESIA DISTRICT	
14. I hereby certify that the foregoing is	Electronic Submission #3	HILLIPS COM	PANY, sent to the	e Carlsbad	_	RECEIVEN	
Name (Printed/Typed) ASHLEY		ATORY SPE					
Signature (Electronic Submission)			Date 11/30/20	016			
	L OR STATE		se/ /				
<del></del>	THIS OF AGE TO	THE COLIN	LOKOTATE	<del>                                      </del>	77///		
Approved By			Title			Date	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or ertify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office		DEC 14/195	Malm	
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a distancements or representations as	crime for any pe to any matter wi	rson knowingly and thin its jurisdiction.	winfulfy 6 mia	kelib ah k dephilmen ye RESBAD FIELD SEP	age of the United	
Instructions on page 2) ** BLM REV	ISED ** BLM REVISED	** BLM RE	VISED ** BLW	KEVISED	** BLM REVISE	D** //	

#### Additional data for EC transaction #359412 that would not fit on the form

#### 32. Additional remarks, continued

inspection. 7. RIH with bit, scraper, and tubing down to +/- 8,850?. 8.COOH with tubing, scraper, and bit. 9.TIH with CIBP (5.5?, 17lb/ft, P-110) and tubing. Set CIBP @ +/- 8,800? (KOP @ 8,830?). Shear off CIBP. POOH with tubing.

10.Dump 30 sacks cement on top of the CIBP.

11.RU pump truck to casing. Load casing with produced water. Test casing to 600 psi for 30 minutes. Circulate packer fluid. Estimated total volume of casing with CIBP set will be an estimated 204 bbls.

12.Top off casing with packer fluid. 13.ND BOP. Secure wellhead. RD WSU.

14. Notify BLM 48 hours prior to test.

15.Chart well @ 550# for 30 minutes.

16.A MIT chart will be submitted to Regulatory for BLM submittal.

The current and proposed wellbore diagrams are attached.


Subsequent report with test results will be submitted as required following the TA completion.

#### Schematic - Current ConocoPhillips GOLDEN SPUR FEDERAL FBS 25.3H State/Province API / UWI PERMIAN UNCONVENTIONAL RED HILLS WEST 3001541230 EDDY NEW MEXICO Surface Legal Location East/West Reference North/South Distance (ft) Original Spud Date East/West Distance (ft) North/South Reference 8/20/2013 Section 25, Township 26 530.00 FWL 465.00 FSL S, Range 31 E HORIZONTAL - Original Hole, 11/29/2016 3:17:29 PM TVD MD (ftKB) (ftKB) Directional schematic (actual) 30.4 27 2 Perforated; 13,762.0-13,764.0; 2/23/2014 1,025 4 1,026.2 Perforated; 13,811.0-13,813.0; 2/23/2014 1,874.5 1,879 9 Perforated; 13,861.0-13,863.0; 2/23/2014 3.964 9 3.947.8 Perforated, 13,920.0-13,922.0; 1/15/2014 4.930 4 4 907.2 Perforated; 13,960.0-13,962.0; 1/15/2014 6.576 1 6 546 9 Perforated; 14,015.0-14,017.0; 1/15/2014 6 748 7 6.719 4 Perforated; 14,070.0-14,072.0; 1/15/2014 8.187 4 8 217 5 Float Collar; 14,082.7-14,084.0; 1.30; 5 1/2; 4.89. 9.332.7 9,500 0 Casing Joints; 14,084.0-14,125.5; 41.54; 5 1/2; 4. 9,458.5 9.956 0 Float Shoe; 14,125.5-9 460 5 ]14,127.0; 1.50; 5 1/2; 4.8. 10.104 0 10,296 9 9 460 4 10,4521 9.460 4 Application is a fill being the determine the kenter described and the contract of the section o 10 637 1 9.458 8 9,461 0 10.916.0 9,466.0 11,089 9 9 468 5 11.227 0 11,567 9 9 474 2 11,701.1 9.471.8 11,868 1 9.470.9 9.471.8 11,996 1 12,357.9 9.469 9 12,519 0 9 467 7 12,725 1 9.466 8 9,469 2 12.865 2 13,069 9 9,471 5 9 472 2 13,223 1 9,472.4 13,416 0 9,471.1 13,565 9 13,762.1 9,473.5 13,921 9 9,474 0 14,082 7 9 472 8 Note: Directional schematic does not correlate to other tracks



#### Schematic - Proposed

#### **GOLDEN SPUR FEDERAL FBS 25 3H**

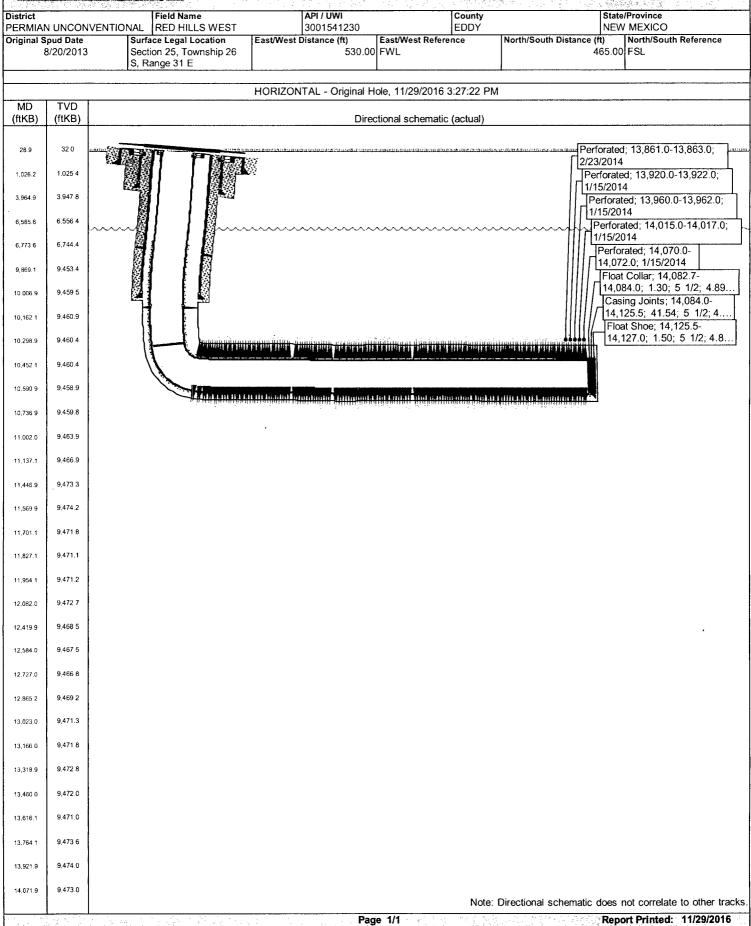

#### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Approved for a period of 1 year ending 12/14/2017 subject to conditions of approval.

#### Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.
  - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, placed with tubing, or 35 feet of cement if placed with bailer.
  - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.
  - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
  - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
  - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- 1. **Submits a subsequent Sundry Notice** (Form 3160-5) requesting TA approval <u>with wellbore diagram</u> with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

#### Golden Spur 25 FBS 3H

- 1. Well is approved to be TA/SI for a period of 1 year or until 12/14/2017
- 2. Must submit NOI to recomplete or NOI to P&A. Must be submitted by 12/14/2017
- 3. COA's met at this time.