Form	3160-5
(June	2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter a abandoned well. Use form 3160-3 (APD) for such proposa	NMOCD Artesia	FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM29233 6. If Indian, Allottee or Tribe Name
SUBMIT IN TRIPLICATE - Other instructions on page 2		7. If Unit or CA/Agreement, Name and/or No.

				1		
1. Type of Well Ø Oil Well Gas Well Other			8. Well Name and No. FEDERAL 12 6			
2. Name of Operator OXY USA INC.	Contact: E-Mail: david_stew	DAVID STEWART wart@oxy.com		9. API Well No. 30-015-26917		
3a. Address P.O. BOX 50250 MIDLAND, TX 79710		3b. Phone No. (include area code) Ph: 432-685-5717		10. Field and Pool or Exploratory Area LIVINGSTON RIDGE DELAWARE		
4. Location of Well (Footage, Sec., 7)		11. County or Parish,	State		
Sec 12 T22S R31E NESW 23 32.405109 N Lat, 103.734711			EDDY COUNTY, NM			
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICATE NATURE O	F NOTICE,	REPORT, OR OTH	IER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION					
	🗖 Acidize	Deepen	D Product	ion (Start/Resume)	□ Water Shut-Off	
Notice of Intent	Alter Casing	Hydraulic Fracturing	🗖 Reclama	ation	Well Integrity	
Subsequent Report	Casing Repair	New Construction	🗖 Recomp	lete	□ Other	

ARTESIA DISTRICT NOV 06 2017

		Convert to Injection	Plug Back	U Water Disposa	1
If the propose Attach the Bo following cor testing has be	I is to deepen direction and under which the ward of the involve o	nally or recomplete horizontally, giv ork will be performed or provide the ed operations. If the operation result Abandonment Notices must be filed	re subsurface locations and r Bond No. on file with BLN ts in a multiple completion of only after all requirements, i	measured and true vertical de A/BIA. Required subsequent or recompletion in a new inte including reclamation, have b	work and approximate duration thereof. pths of all pertinent markers and zones. t reports must be filed within 30 days rval, a Form 3160-4 must be filed once been completed and the operator has
TD-8525'	PBTD-8485'	Perfs-7052-7096'	Acce	NMOCD AT	NM OIL CONSERVATION

Plug and Abandon

🛛 Temporarily Abandon

TD-8525'	PBTD-8485'	Perfs-7052-7096
----------	------------	-----------------

🗖 Final Abandonment Notice

OXY USA Inc respectfully requests to temporarily abandon this well. It is currently being evaluated for possible future recompletion in the upper Brushy Canyon. An offsetting well is a currently completed in both the upper and lower Brushy Canyon. A program is currently being reviewed to do a water shut-off of the lower Brushy Canyon. If the results are good and economical, then this well is a future candidate.	•
economical, then this well is a future candidate.	

Change Plans


			ECEIVE		
 POOH w/ prod equipment, RIH & set CIBP @ +/- 7002' w/ 25sx cmt to 6840', WOC-Tag Notify BLM/NMOCD of casing integrity test 24hrs in advance. RU pump truck, circulate well with treated water, pressure test casing to 500# for 30 min. 	SEE ATTA	ACH	HP F(R	
/	CONDITIO	JNS	OF A	PPR	lov
14. I hereby certify that the foregoing is true and correct.				7	

	Electronic Submission #391155 verne For OXY USA INC., Committed to AFMSS for processing b	sent to	the Carlsbad	í	$I \qquad \qquad$	1	/	/
Name (Printed/Typed)	-	Title	1		ADVISOR	$\sqrt{.}$		
Signature	(Electronic Submission)	Date	10/06/201	7	APPR	NED	$\overline{1}$	
	THIS SPACE FOR FEDERA	L OR	STATE O	RFICE U	E COT Y	1 6017	\overline{M}	
Approved By		Title		V	N	TX1	Y.	
certify that the applicant hol	y, are attached. Approval of this notice does not warrant or ds legal or equitable title to those rights in the subject lease licant to conduct operations thereon.	Office			JREAU OF LY CAELSEAU			M
	1 and Title 43 U.S.C. Section 1212, make it a crime for any pe or fraudulent statements or representations as to any matter w			illfully to ma	ke to any departme	ent or agency	of the U	nited
(Instructions on page 2) *	* OPERATOR-SUBMITTED ** OPERATOR-	SUBM	ITTED **	OPERAT	OR-SUBMIT	red **	T7	,

OXY USA Inc. - Current Federal 12 #6 API No. 30-015-26917

٠

۲

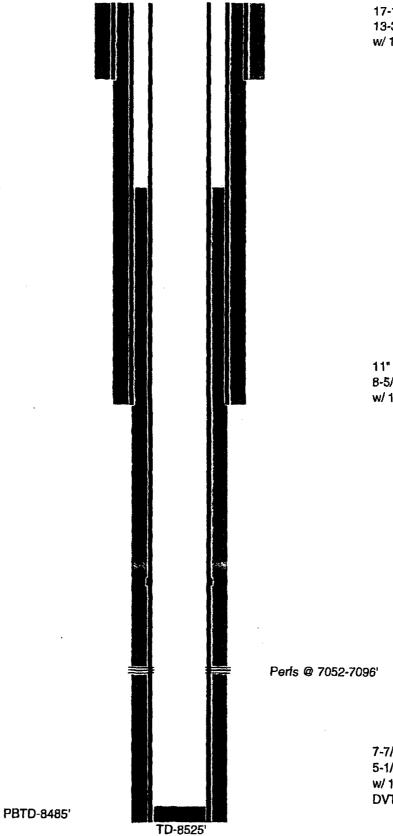


17-1/2" hole @ 818' 13-3/8" csg @ 818' w/ 1000sx-TOC-Surf-Circ

11" hole @ 4310' 8-5/8" csg @ 4310' w/ 1700sx-TOC-Surf-Circ


7-7/8" hole @ 8525' 5-1/2" csg @ 8525' w/ 1375sx-TOC-2200'-CBL DVT @ 6176' OXY USA Inc. - Proposed Federal 12 #6 API No. 30-015-26917

CIBP @ 7002' w/ 25sx cmt to 6840'

1

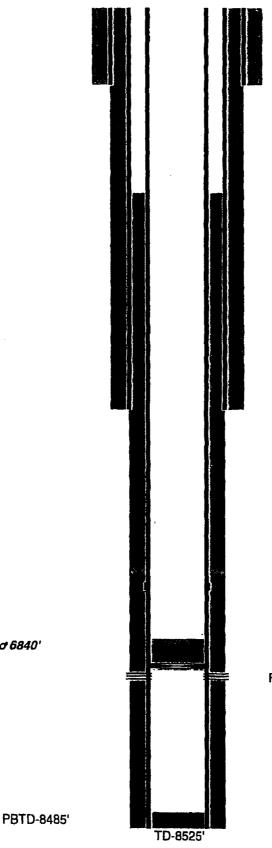

17-1/2" hole @ 818' 13-3/8" csg @ 818' w/ 1000sx-TOC-Surf-Circ

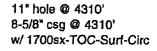

Perfs @ 7052-7096'

7-7/8" hole @ 8525' 5-1/2" csg @ 8525' w/ 1375sx-TOC-2200'-CBL DVT @ 6176'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Approved for a period of 12 months ending 10/26/2018 subject to conditions of approval.

Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.

a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, placed with tubing, or 35 feet of cement if placed with bailer.

b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.

c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.

d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.

e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.

3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- 1. Submits a subsequent Sundry Notice (Form 3160-5) requesting TA approval <u>with well bore diagram</u> with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Federal 12 6

- 1. Well is approved to be TA/SI for a period of 12 months or until 10/26/2018
- 2. This will be the last TA approval for this well.
- 3. Must submit NOI to recomplete or NOI to P&A. Must be submitted by 10/26/2018
- 4. COA's met at this time.