Form 3160-5 (June 2015)

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Artesia

FORM APPROVED

OMB NO. 100 Expires: January	4-0	137
Lease Serial No		

SUNDRY Do not use th	NMLC057634	NMLC057634			
Do not use the abandoned we	6. If Indian, Allottee	6. If Indian, Allottee or Tribe Name			
SUBMIT IN	TRIPLICATE - Other instruct	ions on page 2	7. If Unit or CA/Ag	reement, Name and/or No.	
1. Type of Well  Oil Well Gas Well Oth	ner		8. Well Name and N MCINTYRE A W		
2. Name of Operator COG OPERATING LLC	9. API Well No. 30-015-37 <del>18</del> 9	31789			
3a. Address 600 W ILLINOIS AVE MIDLAND, TX 79701		Phone No. (include area code) 432-685-4332	10. Field and Pool o LOCO HILLS;	r Exploratory Area GLORIETA YESO	
4. Location of Well (Footage, Sec., T Sec 20 T17S R30E Mer NMP	• • •		11. County or Parish		
12. CHECK THE AF	PPROPRIATE BOX(ES) TO I	NDICATE NATURE OF	F NOTICE, REPORT, OR OT	HER DATA	
TYPE OF SUBMISSION		TYPE OF	ACTION		
Notice of Intent     ■	☐ Acidize☐ Alter Casing	☐ Deepen ☐ Hydraulic Fracturing	☐ Production (Start/Resume) ☐ Reclamation	Water Shut-Off	
☐ Subsequent Report	Casing Repair	☐ New Construction	Recomplete	☐ Well Integrity ☐ Other	
☐ Final Abandonment Notice	☐ Change Plans	☐ Plug and Abandon	☐ Temporarily Abandon	O Ottle	
	Convert to Injection	☐ Plug Back	☐ Water Disposal		
testing has been completed. Final Abdetermined that the site is ready for fit COG Operating LLC respectfur MCINTYRE A West #17 We are going to set a CIBP at have our PBTD @ 4,354? We 3,630?-4,015? Ideally, we like bottom hole assembly room and desired rathole space, this give later time.  Equipment Pull Procedure? MIRU WSU, NU BOP? Unset pump and POOH with	ally requests to recomplete from 4,394? (50? above the YESO e plan to have our top perfs from to have 200?-300? of rathole and prevent tubing from getting es COG the option to re-enter code and tog	perfs) w/ 40? of CMT on m 3,215? ? 3,590? and below our bottom perfs to stuck with sand. In additional the Glorietta/Yeso format	top of the plug to ottom perfs from on to having ion at a	CONSERVATION ESIA DISTRICT N 2 7 2018 ECEIVED	
14. I hereby certify that the foregoing is  Name(Printed/Typed) KANICIA (	Electronic Submission #42255 For COG OPERA Committed to AFMSS for proce	7 verified by the BLM Well TING LLC, sent to the Cal ssing by JENNIFER SANC Title PREPAR	rlsbad HEZ on 06/05/2018 ()		
Signature (Electronic S	ubmission)	Date 06/04/20	18 APPROVER	<del>-/</del> / /	
	THIS SPACE FOR FI	EDERAL OR STATE		7 / /	
Approved By	<u></u>	Title	JUN & 2018		
onditions of approval, if any, are attached ertify that the applicant holds legal or equ thich would entitle the applicant to condu	itable title to those rights in the subject	arrant or	BURFAN OF LAND MANAGE	HENT	
itle 18 U.S.C. Section 1001 and Title 43 ( States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a crime tatements or representations as to any	for any person knowingly and versity and versity and versity matter within its jurisdiction.	villtully to make to any department o	r agency of the United	
nstructions on page 2) ** OPERAT	OR-SUBMITTED ** OPER	ATOR-SUBMITTED **	OPERATOR-SUBMITTED	7-5-18	

# Additional data for EC transaction #422557 that would not fit on the form

#### 32. Additional remarks, continued

- ? PU scraper and scrape down to 4,442?

- ? PU scraper and scrape down to 4,442?
  ? RU Wireline
  ? Make gauge ring/ junk basket run
  ? Set CIBP @ 4,394?
  ? Wireline truck dump 40? Class C cement of top of CIBP
  ? Tag cement plug to verify depth of 4,354?
- ? Pull up 4? to circulate hole clean with fresh water, and displace w/ 2% KCL and 1% packer corrosion inhibitor.

  ? Test Casing to 4,300 psi and report back to engineering if the pressure holds.
- ? Dump bail acid in the perf interval
- ? RIH w/ perforating guns and perforate San Andres Zone from 3,630?4,015?, w/ 3 spf, 120? phasing,
- 54 holes ? NU 5K frac valve
- ? Secure wellbore ? RDMO WSU

- Tentative Recompletion Procedure
  ? RU Elite Well Services Frac Crew
  ? Acidize w/ 3,000 gals of 15% HCl.
  ? XL Frac zone w/ 375,000 # of sand.
  ? Record ISIP and FG, Get 5, 10, 15 min SIP
  ? Rig up Wireline
  ? RIH w/ WL and set Composite Plug @ 3,600?
  ? Perforate San Andres Zone from 3,215?-3,590?, w/ 3 spf, 120? phasing, 54 holes.
  ? Acidize w/ 3,000 gals of 15% HCl.
  ? XL Frac zone w/ 375,000 # of sand.
  ? Record ISIP and FG, Get 5, 10, 15 min SIP
  ? RDMO Elite

- ? RDMO Elite
- Please see attachment for complete procedure.

### **MCINTYRE A West #17**

We are going to set a CIBP at 4,394' (50' above the YESO perfs) w/ 40' of CMT on top of the plug to have our PBTD @ 4,354'. We plan to have our top perfs from 3,215' – 3,590' and bottom perfs from 3,630'-4,015'. Ideally, we like to have 200'-300' of rathole below our bottom perfs to give our bottom hole assembly room and prevent tubing from getting stuck with sand. In addition to having desired rathole space, this gives COG the option to re-enter the Glorietta/Yeso formation at a later time.

### **Equipment Pull Procedure**

- MIRU WSU, NU BOP
- Unset pump and POOH with rod and tbg
- PU scraper and scrape down to 4,442'
- RU Wireline
- Make gauge ring/junk basket run
- Set CIBP @ 4,3941
- Wireline truck dump 40' Class C cement of top of CIBP
- Tag cement plug to verify depth of 4,3541
- Pull up 4' to circulate hole clean with fresh water, and displace w/ 2% KCL and 1% packer corrosion inhibitor.
- Test Casing to 4,300 psi and report back to engineering if the pressure holds.
- Dump bail acid in the perf interval
- RIH w/ perforating guns and perforate San Andres Zone from β,630°4,015¹, w/ 3 spf, 120° phasing, 54 holes
- NU 5K frac valve
- Secure wellbore
- RDMO WSU

#### **Tentative Recompletion Procedure**

- RU Elite Well Services Frac Crew
- Acidize w/ 3,000 gals of 15% HCl.
- XL Frac zone w/ 375,000 # of sand.
- Record ISIP and FG, Get 5, 10, 15 min SIP
- Rig up Wireline
- RIH w/ WL and set Composite Plug @ 3,600
- Perforate San Andres Zone from β,215'-3,590', w/ 3 spf, 120° phasing, 54 holes.
- Acidize w/ 3,000 gals of 15% HCl.
- XL Frac zone w/ 375,000 # of sand.
- Record ISIP and FG, Get 5, 10, 15 min SIP
- RDMO Elite

### **Return to Production Procedure**

- MIRU WSU
- RIH with bit and bailer to drill out composite plug
- Clean out fill to new PBTD @ 4,354
- RIH with production tubing as follows:
  - o (96) jts 2-7/8" J55 6.5# tbg
  - o (1) 2' marker joint


- o (2) jts 2-7/8" J55 6.5# tbg
- o TAC @3,187'
- o (27) jts 2-7/8" J55 6.5# tbg
- o SN @ 4,064'
- o (1) D3405 Cavins Desander
- o (4) jts 2-7/8" J55 BPMA
- o EOT @ 4,194'
- ND BOP, set TAC, flange up WH
- RIH w/ rod design as follows:
  - o (1) 26' x 1-1/2" SMPR
  - o (1) 6' x 34" rod sub
  - o (1) 8' x ¾" rod sub
  - o (156) 3/4" D rods
  - o (6) 1-5/8" K bars
  - o (1) 25-150 RHBC-20' Pump
- Please reuse as many rods as possible and pull the rest from inventory
- PLEASE ADJUST UNIT TO 7.5 SPM
- PLEASE ENSURE UNIT IS IN LONG HOLE ON CRANKS (86" Stroke length)
  - o If crank rotation is not CCW, please make sure it is CCW
- Hang on, load tubing and note pump action and alignment
- Clean location
- Update rod and tubing detail in Well View
- All charges will hit recompletion AFE (800/500) code
- PWOP and contact Robby Miller before turning on
- RDMO, TOTP

# COG Operating LLC

### Current

Lease & Well # McIntyre A West # 17

Spud: 7/27/01

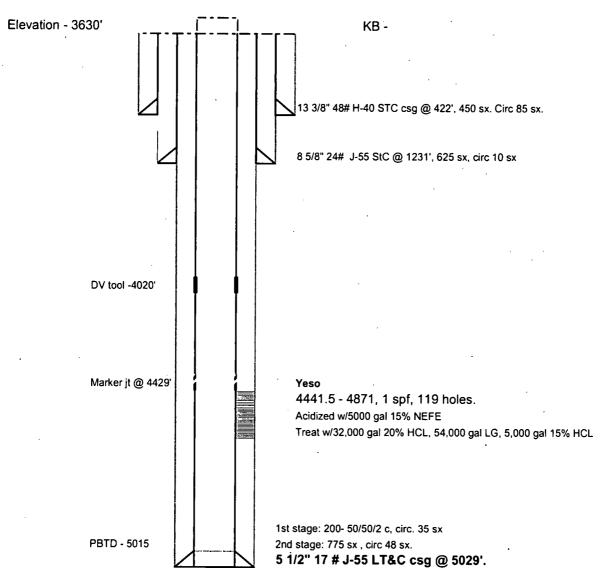

# COG Operating LLC

Proposed McIntyre A West # 17 Lease & Well # **WELL NAM** SHL: BHL: Spud: 7/27/01 **FORMATIC** LEGAL: Elevation - 3630' KB -13 3/8" 48# H-40 STC csg @ 422', 450 sx. Circ 85 sx. 8 5/8" 24# J-55 StC @ 1231', 625 sx, circ 10 sx San Andres 3215 - 3590, 3 spf, 54 holes. Acidized w/3,000 gal 15% HCI Frac'd with 375,000 lbs sand COMPOSITE PLUG @ 3630 - 4015, 3 spf, 54 holes. Acidized w/ 3,000 gal 15% HCI Frac'd with 375,000 lbs sand DV tool -4020' PBTD @ 4354' CIBP w/ 40' cmt plug on top @ 4394' Marker jt @ 4429' 4441.5 - 4871, 1 spf, 119 holes. Acidized w/5000 gal 15% NEFE Treat w/32,000 gal 20% HCL, 54,000 gal LG, 5,000 gal 1

1st stage: 200- 50/50/2 c, circ. 35 sx

2nd stage: 775 sx , circ 48 sx.

**PBTD - 5015** 

								LATION		
<u>District I</u>					State of Nev	w Mexico	ONSER	arc.		Form C-102
1625 N. French D District II	r., Hobbs, N	M 88240	Е	State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION ART 1220 South St. Francis Dr.			mbell CA DIST	κι <u>-</u>	Revise	ed June 10, 2003
1301 W. Grand A	venue. Artes	ia. NM 88210	)	OIL	CONSERVAT	OPRIVID MOIT	NARTESI OTS	DAM to A	ppropriat	ed June 10, 2003 e District Office Lease - 4 Copies
District III	,	,		1	220 South St	Francis Dr	IUN &		State	Lease - 4 Copies
1000 Rio Brazos F	Rd., Aztec, N	NI 87410		1220 South St. Francis Dr.			RECE	THED	Fee !	Lease - 3 Copies
District IV					Santa Fe, N	M 87505	QECF		_	
1220 S. St. Franci	s Dr., Santa I								] AMEN	DED REPORT
	_		WELL LO			REAGE DEDIC				
	API Numbe	· <del>-</del>	· · ·	<sup>2</sup> Pool Code <sup>3</sup> Pool Name						
	-015-317	89		28509			rayburg Jackson	; SR-Q-G-S	SA	·
<sup>4</sup> Property					<sup>5</sup> Property				6 Well Number ∕	
30252					McIntyre A	A West				17
OGRID'	No.				<sup>8</sup> Operator	Name			<sup>9</sup> Elevation	
22913	7		·· ·-	<del></del>	COG OPERAT		<u> </u>			3630
					10 Surface	Location				
UL or lot no.	Section	Township	Range	Lot Ide	Feet from the	North/South line	Feet from the	East/West	line	County
J	20	17S	· 30E		1775	South	1625	East		Eddy
			11 Bo	ottom Ho	ole Location I	f Different From	n Surface			
UL or lot no.	Section	Township	Range	Lot Ide		· · · · · · · · · · · · · · · · · · ·	Feet from the	East/V	Vest line	County
12 Dedicated Acre	es <sup>13</sup> Joint o	r Infill	Consolidation	Code 15 O	rder No.	l				_
NO ALLOW	ABLE WI	LL BE A				JNTIL ALL INTEI APPROVED BY	THE DIVISION	ERATOR	CERT	TED OR A NO TIFICATION n contained hereiv
							is true and		•	my knowledge and
_							belief.			
						1	\ \ \ \		-	•
		٠.				·	Signature			
								Kanicia C	astillo	
				1			Printed Name	•		
							Title and E-n	Regulator	y Advis	or
								0	6/04/18	
							Date		2.0 1110	
					- <del>  </del>	2210	I hereby ce	ertify that the	well locati	FICATION on shown on this factual surveys
		ŀ		1	1	2310'	Pian Pi			

made by me or under my supervision, and that the same is true and correct to the best of my belief.

Signature and Seal of Professional Surveyor:

Date of Survey

Certificate Number

						•	-a4	NATIO	A		
District I					State of I	New Mexico oural Resources Market ATION DIVISIO St. Francis Dr.	CONSE	RICT		Form C-102	
1625 N. French D District II	r., Hobbs, N	M 88240	E	nergy, Mir	nerals & Nat	ural Resources	artment SIA DIS	2018	Revi	sed June 10, 2003	
1301 W. Grand A	venue, Artes	ia, NM 88210		OIL C	ONSERV	ATION DIVISIO	N N 27	Submit to	Appropri	sed June 10, 2003 ate District Office Lease - 4 Copies	
District III	·	•		1′	220 South	St Francis Dr	7014		State	e Lease - 4 Copies	
1000 Rio Brazos F	Rd., Aztec, N	N1 87410		1220 South St. 1 Iunels D1.			-05	RECEIVED Fee Lease - 3 Cop			
District IV 1220 S. St. Franci	c Dr. Santa	F. N.1 97505			Santa Fe	, NM 87505	RECE	· · · · · · · · · · · · · · · · · · ·	¬		
1220 S. St. Franci	s Dr., Santa		ELL LO		NI ANID A		DATIONEDI	l Var	AME	ENDED REPORT	
	API Numbe		ELL LO	Pool Code		CREAGE DEDIC	JAHON PLA Pool Na			<del></del>	
1	-015-317	-		96718		Loco Hills;Glo			,		
<sup>4</sup> Property				70710	5 Prope	erty Name	Loco mins, Oro	ricta- i esu			
30252						re A West		•	- •	6 Well Number	
7 OGRID	No.			· · · · ·		ator Name				17 Elevation	
22913						RATING LLC				3630	
<u> </u>	1		<del></del>			ce Location		l		3030	
UL or lot no.	Section	Township	Range	Lot Ida	Feet from th		Feet from the	East/We	st line	County	
J	20	175	30E		1775 ·	South	1625	East		Eddy	
<u> </u>	·	<u>.                                    </u>	11 Bc	ttom Ho	le Locatio	n If Different From	m Surface	l			
UL or lot no.	Section	Township	Range	Lot Idn	Feet from		Feet from the	East	/West line	County	
İ										2022.7	
12 Dedicated Acre	s 13 Joint o	r Infill 14 C	onsolidation	Code 15 Or	der No.		£	L,			
40											
	<u></u>			<b>-</b>							
NO ALLOW	ABLE WI	LL BE ASS	IGNED T	O THIS C	OMPLETIO	N UNTIL ALL INTEI	RESTS HAVE E	REEN CO	NSOL ID	ATED OD A NON	
		22 22 . 100				EN APPROVED BY			130010	ATED OR A NON	
					<del></del>	-			R CFR	TIFICATION	
	;									ion contained herein	
i				,			II .			f mv knowledge and	
H							belief.	•	•		
						·					
							Signature				
								Kanicia	<u>Castillo</u>		
							Printed Name	2			
							<b>.</b>	Regulato	ry Advi	sor	
							Title and E-n	nail Address			
Į.							l l		06/04/18	3	

2310'

<sup>18</sup>SURVEYOR CERTIFICATION

I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys

made by me or under my supervision, and that the same is true and correct to the best of my belief.

Signature and Seal of Professional Surveyor:

Date of Survey

Certificate Number

# Mcintyre A West 17 30-015-37189 COG Operating LLC June 05, 2018 Conditions of Approval

Work to be completed by September 05 2018.

1. Operator shall place a CIBP at 4,391' and place 40' Class C Cement on top of the CIBP. WOC and TAG.

Note: At a later date, operator will need to add cement to the CIBP to properly seal the Glorietta Formation and the DV tool.

- 2. Must conduct a casing integrity test before perforating and fracturing. Submit results to BLM. The CIT is to be performed on the production casing to max treating pressure. Notify BLM if test fails.
- 3. Before casing or a liner is added or replaced, prior BLM approval of the design is required. Use notice of intent Form 3160-5.
- 4. Surface disturbance beyond the originally approved pad must have prior approval.
- 5. Closed loop system required.
- 6. All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of work over operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.
- 7. Operator to have H2S monitoring equipment on location.
- 8. A minimum of a 2000 (2M) BOP to be used. All blowout preventer (BOP) and related equipment (BOPE) shall comply with reasonable well control requirements. A two ram system with a blind ram and a pipe ram designed for the size of the work string shall be adequate. Tapered work strings will require an additional pipe ram. The manifold shall comply with Onshore Oil and Gas Order #2 Attachment I (2M Diagrams of Choke Manifold Equipment). The accumulator system shall have an immediately available power source to close the rams and retain 200 psi above pre-charge. The pre-charge test shall follow requirements in Onshore Order #2.

- 9. Subsequent sundry required detailing work done and completion report for the formation. Operator to include new well plat and well bore schematic of current well condition when work is complete.
- 10. See attached for general requirements.

**JAM 060518** 

# BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street

Carlsbad, New Mexico 88220 575-234-5972

## General Requirements for Plug Backs

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from this approval.

If you are unable to plug back the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. For wells in Eddy County, call 575-361-2822.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement.

Before pumping cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either **Neat Class "C"**, for up to 7,500 feet of depth or **Neat Class "H"**, for deeper than 7,500 feet plugs.

- 6. <u>Subsequent Plug back Reporting:</u> Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date work was completed.</u>
- 7. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.