

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-31973
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator BOPCO, LP		6. State Oil & Gas Lease No. E052290009
3. Address of Operator 6401 Holiday Hill Rd. Bldg 5, Midland, TX 79707		7. Lease Name or Unit Agreement Name Poker Lake Unit
4. Well Location Unit Letter <u>K</u> : <u>1750</u> feet from the <u>South</u> line and <u>1650</u> feet from the <u>West</u> line Section <u>32</u> Township <u>23S</u> Range <u>30E</u> NMPM County <u>Eddy, NM</u>		8. Well Number <u>186</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3270' GR		9. OGRID Number 260737
		10. Pool name or Wildcat Nash Draw; Delaware/BS (Avalon Sand)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

BOPCO, LP respectfully submits this sundry to report plugging and abandonment of the referenced well

10/21/18 - 10/22/18

MIRU. TOH w/rods. ND wellhead, NU BOP. FT/PT. POOH w/tbg.

10/23/18 - 10/24/18

PU 5-1/2" CIBP, RIH to 7300', set, RIH w/WS, tag CIBP @ 7300'. Circulate 170 bbls salt gelled mud. PT csg to 500 psi (good). Spot 25 sx cmt 7300'-7053'. SDFD.

10/25/18 - 10/28/18

Tag cmt @ 7046'. Run CBL 3790'-380'. TOC 1750'. RIH, spot 25 sx C 5106'-4859'. WOC, tag cmt @ 4850'. Spot 170 sx 3435'-1750'. WOC overnight.


(Continued on attachment)

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

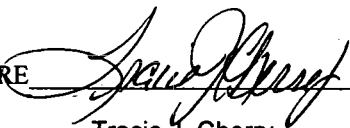

TITLE Regulatory Coordinator

DATE

11/20/18

Type or print name Tracie J. Cherry

E-mail address: tracie_cherry@xtoenergy.com

PHONE: 432-221-7379

For State Use Only

APPROVED BY:



TITLE



DATE

11-27-18

Conditions of Approval (if any):

ENTERED
11/27/18

BOPCO, LP
Poker Lake Unit 186
30-015-31973
32 23S-30E

10/29/18

Tag cmt @ 1765'. Perf 1750'. Attempt to EIR, could not establish circulation to surface. Set pkr @ 1179'. Sqz 100 sx C cmt 175' - 1381'. WOC 4 hrst, tag @ 1386'. Perf 1300'. Attempt to EIR, could not circulate to surface. Sqz 100 sxs C 1300'-931'

10/30/18

Tag TOC @ 915'. Perf @ 800'. Attempt to EIR. Could not establish circulation to surface. Sqz 100 sx C cmt 800'-431'. WOC 4 hrs. PUH set pkr @ 60'. TBIH tag TOC @ 416'. Perf @ 100. EIR. Sqz 35 sx C 100' to surface

10/31/18

Verify cmt at surface. Cut off well head. Install marker. Well is P&A'd

Plugging procedure after CBL recommended by and all plugs approved by NMOCD, Gil Cardero.