Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137

Expires: January 31, 2018

SUNDRY N	OTICES ANI	D REPORT	S ON WELLS	S
Do not use this	form for prop	osals to dri	ill or to re-ente	er an
bandoned well.				

5. Lease Serial No. NMNM85893

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Ag	greement, Name and/o	or No.	
1. Type of Well						No. ON 21 FEDERAL 1		
2. Name of Operator Contact: DAVID STEWART								
OXY USA INCORPORATED E-Mail: david_stewart@oxy.com					9. API Well No. 30-015-28354-00-S1			
3a. Address 5 GREENWAY PLAZA SUITE HOUSTON, TX 77046-0521	(include area code) 5.5717		10. Field and Pool or Exploratory Area CEDAR CANYON					
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State			
Sec 21 T24S R29E NENE					EDDY COUNTY, NM			
				′				
12. CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE OI	F NOTICE, I	REPORT, OR O	THER DATA		
TYPE OF SUBMISSION TYPE OF ACTION								
Notice of Intent	☐ Acidize	☐ Dee	pen	☐ Production	on (Start/Resume)	☐ Water Shu	t-Off	
	☐ Alter Casing	☐ Hydraulic Fracturing		☐ Reclamation		□ Well Integr	rity	
☐ Subsequent Report	□ Casing Repair	■ New Construction		☐ Recomplete		Other		
☐ Final Abandonment Notice	□ Change Plans	Plug and Abandon		☐ Temporarily Abandon				
	Convert to Injection	– <i>v</i>		☐ Water Disposal g date of any proposed work and approx				
following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be file testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator determined that the site is ready for final inspection. TD-6766' PBTD-6708' Perfs-5212-5242' 8-5/8" 24# csg @ 580' w/ 450sx, 11" hole, TOC-Surf-Circ 4-1/2" 11.6# csg @ 6766' DVT @ 5446',3491'w/1790sx, 7-7/8"hole, TOC-Surf-Circ 1. RIH & set CIBP @ 5162', M&P 25sx cmt to 4915' 2. M&P 25sx cmt @ 3616-3366' WOC-Tag 3. M&P 25sx cmt @ 3616-3366' WOC-Tag 3. M&P 25sx cmt @ 630' to Surface 1. M&P 55sx cmt @ 630' to Surface 1. M&P 55sx cmt @ 630' to Surface 1. Cachello and inspection or recompletion in a new interval, a Form 3160-4 must be file testing has been completed and the operator determined that the site is ready for final inspection. NM OIL CONSERVAL ARTESIA DISTRICT AUG 2 1 2019 RECEIVED SEE ATTACHED FOR CONDITIONS OF APPROVAL CONDITIONS OF APPROVAL							s FION	
	d by the BLM Well TED, sent to the (RAH MCKINNEY o	Carlsbad n 07/29/2019 ((19DLM0587SE)					
Name (Printed/Typed) DAVID STEWART			THE REGULA	ATORY ADV	ISUR			
Signature (Electronic S	Date 07/29/20	110						
(2.000,000	THIS SPACE FO	R FEDERA			<u> </u>			
	7				_			
Approved By James (. Comes		Title SPE	7		B-4 Date	-19	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office CFO					
Title 18 U.S.C. Section 1001 and Title 43 U.S. States any false, fictitious or fraudulent st	J.S.C. Section 1212, make it a catements or representations as	crime for any pe to any matter wi	rson knowingly and v thin its jurisdiction.	willfully to mak	e to any department	or agency of the Unite	ed	

(Instructions on page 2)
** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **



OXY USA Inc. - Current Cedar Canyon 21 Federal #1 API No. 30-015-28354

11" hole @ 580' < 8-5/8" csg @ 580' ---w/ 450sx-TOC-Surf-Circ / est. Tops Anhy. 400 T/Solt 680 B/Sol4 3030 2743 Del 3108 2947 BS 6842 4M9 3491 Perfs @ 5212-5242' ~ 5446 7-7/8" hole @ 6766' -4-1/2" csg @ 6766' w/ 1790sx-TOC-Surf-Circ / DVT @ 5446', 3491' PB-6708'

TD-6766'

OXY USA Inc. - Proposed Cedar Canyon 21 Federal #1 API No. 30-015-28354


55sx @ 630'-Surface

11" hole @ 580' 8-5/8" csg @ 580' w/ 450sx-TOC-Surf-Circ

25sx @ 2950-2695' WOC-Tag

25sx @ 3616-3366' WOC-Tag

CIBP @ 5162' w/ 25sx to 4915'

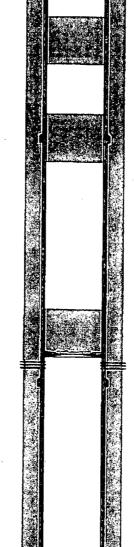

TD-6766

Perfs @ 5212-5242'

7-7/8" hole @ 6766' 4-1/2" csg @ 6766' w/ 1790sx-TOC-Surf-Circ DVT @ 5446', 3491'

PB-6708'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.