	Form 3160-5 (June 2015)	UNITED STATES	5		APPROVED	
î.	DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT OCD Artesia			OMB NO. 1004-0137 Expires: January 31, 2018		
	SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.			NMNM83037	•	
				6. If Indian, Allottee	or Tribe Name	
:	SUBMIT IN TRIPLICATE - Other instructions on page 2			7. If Unit or CA/Agr	eement, Name and/or No	
	1. Type of Well Gas Well Other				8. Well Name and No. JONES CANYON 4 FED 5	
	2. Name of Operator Contact: DAVID STEWART OXY USA WTP LIMITED PTNRSHIP E-Mail: david_stewart@oxy.com			9. API Well No. 30-015-30933-	00-S1	
	3a. Address HOUSTON, TX 77210		3b. Phone No. (include area code) Ph: 432-685-5717		.10. Field and Pool or Exploratory Area INDIAN BASIN-STRAWN	
	4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			11. County or Parish	. State	
	Sec 4 T22S R24E SWNE 169		· · ·	EDDY COUNT		
	12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA					
	TYPE OF SUBMISSION	· · · · · · · · · · · · · · · · · · ·	TYPE OF .	CTION		
	Notice of Intent	Acidize Alter Casing	Deepen Hydraulic Fracturing	 Production (Start/Resume) Reclamation 	□ Water Shut-Of □ Well Integrity	
	Subsequent Report	Casing Repair	□ New Construction	☐ Recomplete	Other	
	Final Abandonment Notice	☐ Change Plans ☐ Convert to Injection	Plug and Abandon Plug Back	 Temporarily Abandon Water Disposal 	-	
	determined that the site is ready for final inspection. TD-8540' PBTD-8467' Perfs-7859-8227' 13-3/8" 54.5# csg @ 1600' w/ 4025sx, 17-1/2" hole, TOC-Surf-Circ-1" 0.5/8" 40# csg @ 2540' DVT 5000' w/ 2850sx 12 1/4" hole, TOC-Surf-Circ-1" 0.5/8" 40# csg @ 2540' DVT 5000' w/ 2850sx 12 1/4" hole, TOC-Surf-Circ-1" 0.5/8" 40# csg @ 2540' DVT 5000' w/ 2850sx 12 1/4" hole, TOC-Surf-Circ-1"					
	13-3/8" 54.5# csg @ 1600' w/ 4025sx, 17-1/2" hole, TOC-Surf-Circ-1" 9-5/8" 40# csg @ 8540', DVT 5990' w/ 2850sx, 12-1/4" hole, TOC-290'-CBL				MOCD	
	1. RIH & set CIBP @ 7809' w/ 70sx cmt to 7629' 2. M&P 70sx cmt @ 7410-7235' WOC-Tag 3. M&P 65sx cmt @ 6070-5910' WOC-Tag 3. M&P 65sx cmt @ 6070-5910' WOC-Tag				מר	
	 4. M&P 60sx cmt @ 4710-45 	60' WOC-Tag	CONDITIONS OF APPROVAL			
	5. M&P 55sx cmt @ 3360-32 6. M&P 65sx cmt @ 2890-27 7. M&P 50sx cmt @ 1660-15	30' WOC-Tag				
				ARTESIA	DISTRICT 2 1 2019	
	Electronic Submission #477377 verified by the BLM Well Information System					
	For OXY USA WTP LIMITED PTNRSHIP, sent to the Carlsbad Committed to AFMSS for processing by PRISCILLA PEREZ on 08/09/2019 (19PP2958SE) RECEIVED Name (Printed/Typed) DAVID STEWART Title SR. REGULATORY ADVISOR					
		· · · · · · · · · · · · · · · · · · ·	······································			
	Signature (Electronic S	in the state of the second	Date 08/09/20			
					8-11-1 Date	
		$\mathcal{O}\mathcal{O}$	CAL			
	Approved By Conditions of approval, if any, are attache				Date	
		uitable title to those rights in th uct operations thereon.	s not warrant or e subject lease Office CA	>		


Additional data for EC transaction #477377 that would not fit on the form

1


32. Additional remarks, continued

M&P 45sx cmt @ 1255-1140' WOC-Tag
 Perf @ 290' sqz 210sx cmt to surface
 10# MLF between plugs - Above ground steel tanks will be utilized

OXY USA WTP LP - Current Jones Canyon 4 Federal #5 API No. 30-015-30933

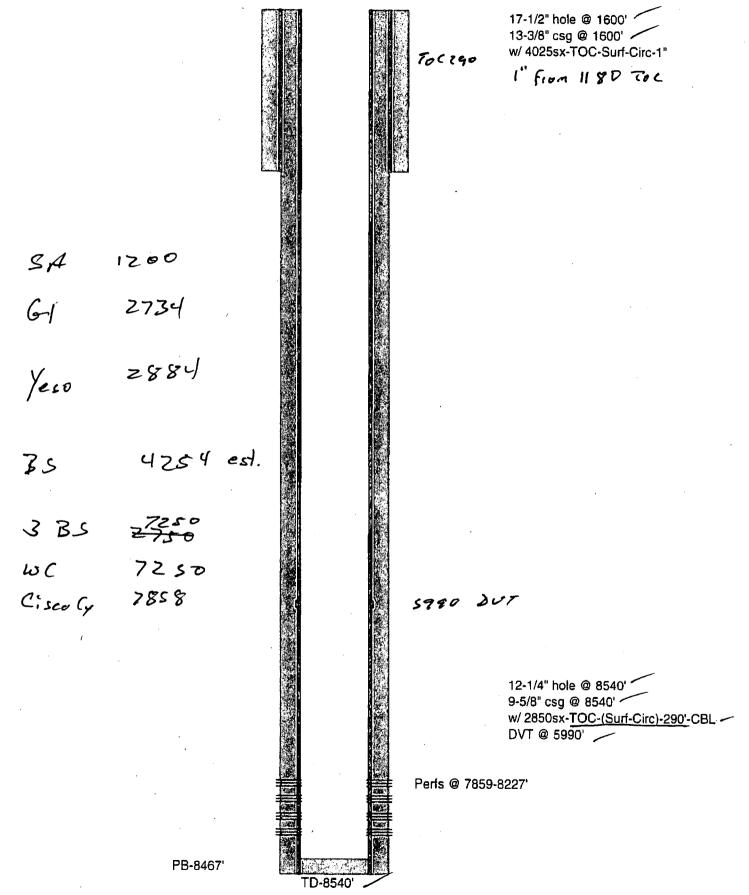

OXY USA WTP LP - Proposed Jones Canyon 4 Federal #5 API No. 30-015-30933

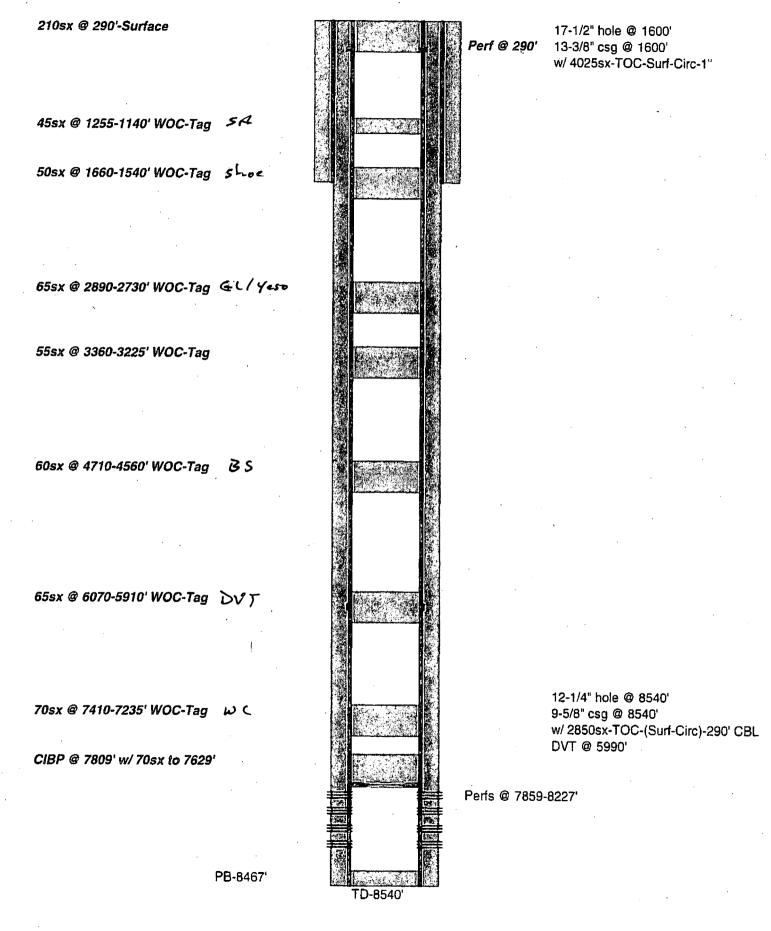

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.