Form 3160-5 (June 2015)

UNITED STATES

FORM APPROVED

	PARTMENT OF THE IN UREAU OF LAND MANAC		2019 [J. 1004-0137 inuary 31, 2018	
SUNDRY NOTICES AND REPORTS ON-WELLS				Lease Serial No. NMLC065421		
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to be the what is abandoned well. Use form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name		
abandoned Well. Ose form 5100-5 (At D) for Sacir proposals.						
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agreement, Name and/or No. NMNM111029		
1. Type of Well ☐ Other ☐ Oil Well ☐ Other				8. Well Name and No. BRADLEY 14 FEDERAL COM 1		
2. Name of Operator Contact: DAVID A EYLER CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@MILAGRO-RES.COM				9. API Well No. 30-015-32672-00-C1		
3a. Address 600 N MARIENFELD STE 600 MIDLAND, TX 79701		Bb. Phone No. (include area code) Ph: 432-687-3033		10. Field and Pool or Exploratory Area BLACK RIVER		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)				11. County or Parish, State		
Sec 14 T24S R26E SWNW 1650FNL 990FWL				EDDY COUNTY, NM		
12. CHECK THE AI	PPROPRIATE BOX(ES) T	O INDICATE NATURE O	F NOTICE,	REPORT, OR OTH	HER DATA	
TYPE OF SUBMISSION		TYPE OF	ACTION	ACTION		
⊠ Notice of Intent	☐ Acidize	☐ Deepen	☐ Producti	on (Start/Resume)	☐ Water Shut-Off	
	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation		■ Well Integrity	
☐ Subsequent Report	□ Casing Repair	■ New Construction	☐ Recomplete		Other	
☐ Final Abandonment Notice	Change Plans	☑ Plug and Abandon	☐ Temporarily Abandon			
	Convert to Injection	□ Plug Back	☐ Water Disposal			
13. Describe Proposed or Completed Op If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f	ally or recomplete horizontally, good with the provide to operations. If the operation result andomment Notices must be file in all inspection.	ive subsurface locations and measu- he Bond No. on file with BLM/BIA ults in a multiple completion or reco it only after all requirements, includ	ared and true vertice. Required subsemble tion in a nation in a reclamation of a large and	rtical depths of all perting sequent reports must be lew interval, a Form 316, have been completed and Bar.	nent markers and zones. filed within 30 days 0-4 must be filed once and the operator has	
1) DUMP BAIL 4 SXS.CMT. @ 2) SET 5-1/2" CIBP @ 9,100'; 3) PUMP 25 SXS.CMT. @ 7,1 4) PUMP 25 SXS.CMT. @ 5,5 5) PUMP 25 SXS.CMT. @ 3,2 6) PUMP 25 SXS.CMT. @ 2,0 7) PERF. X ATTEMPT TO SC	270'-3,140'(9-5/8" CSG.SH	OE); WOC X TAG CMT. PLU	ug. CON	VDITIONS (OF APPROVAL	
7) PERF. X ATTEMPT TO SC 8) PERF. X ATTEMPT TO SC 9) PERF. X CIRC. TO SURF., 10)DIG OUT X CUT OFF WE CSGS. X INSTALL DRY HOL DURING THIS PROCEDURE	- FILLING ALL ANNULI, 25 LLHEAD 3' B.G.L.; VERIF` E MARKER.	6 SXS.CMT. @ 63'-3'. Y CMT. TO SURF. ON ALL A	ANNULI; WE	LD ON STEEL PLA		

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #491278 verified by the BLM Well Information System

For CIMAREX ENERGY COMPANY OF CO, sent to the Carlsbad

Committed to AFMSS for processing by PRISCILLA PEREZ on 11/06/2019 (20PP0348SE) Name (Printed/Typed) DAVID A EYLER Title AGENT Signature (Electronic Submission) Date 11/06/2019 THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By

SAET Title

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

CFO Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.


(Instructions on page 2) ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **





Additional data for EC transaction #491278 that would not fit on the form

32. Additional remarks, continued

THE REQUIRED DISPOSAL, PER OCD RULE 19.15.17.

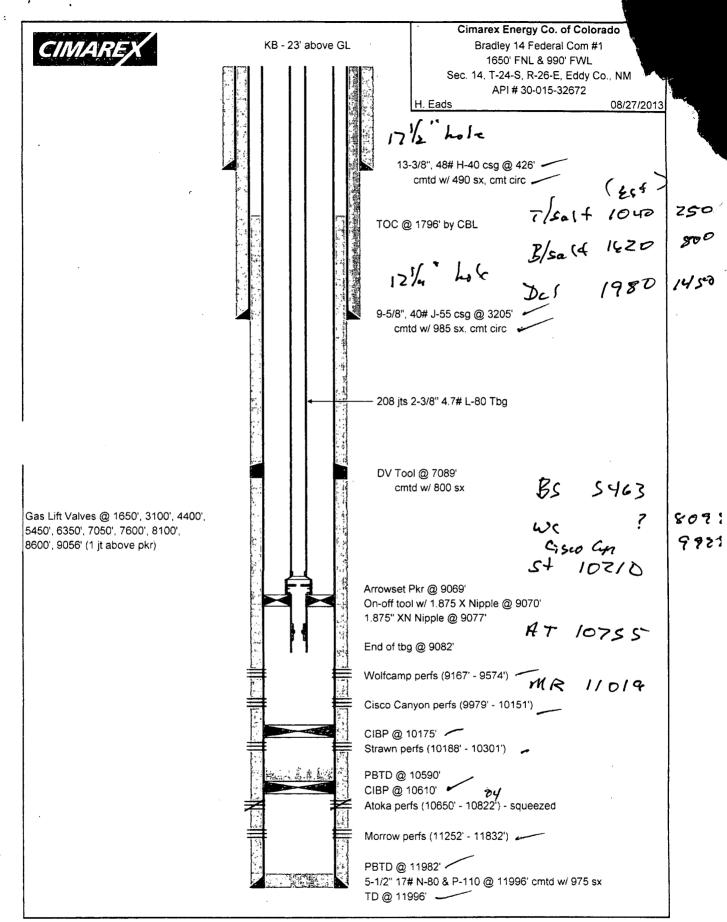

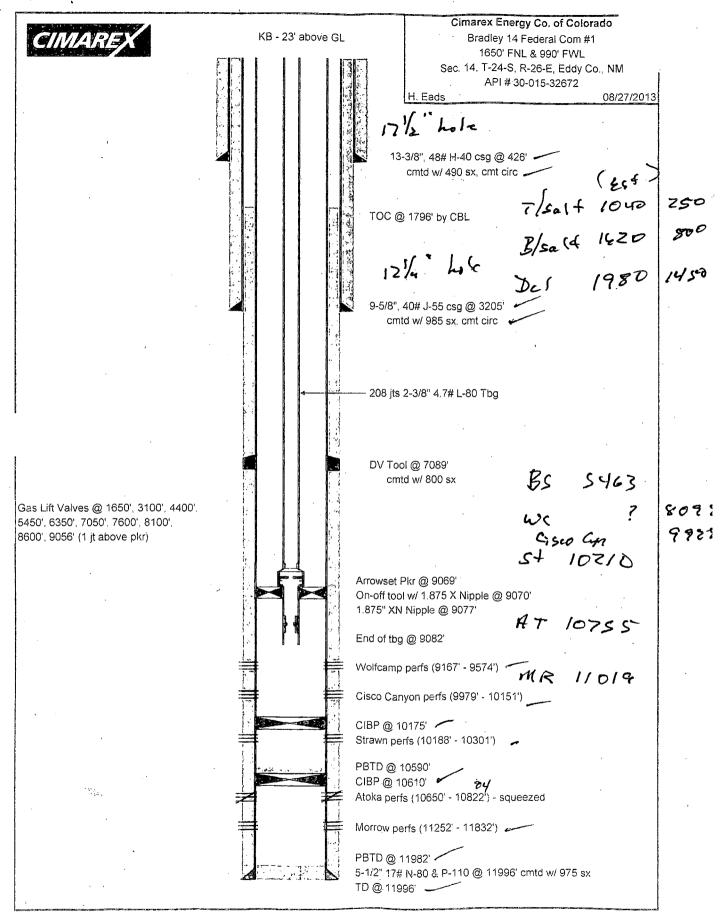

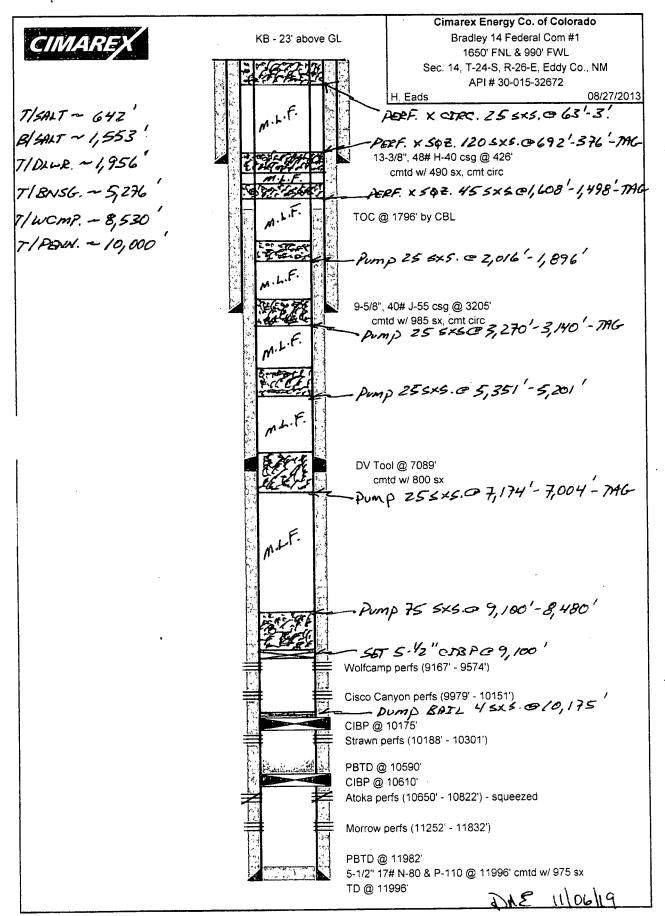

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of get per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5 <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In heu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

 The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and
- The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.
- 8 <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.