Form 3160-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

1	FORM APPROVED
	OMB NO. 1004-0135
OCD-ARTESL	Δ Expires: November 30, 2000

SUNDRY	NOTICES	AND	REPORTS	ON	WELL	

5. Lease Serial No. NM048344

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on reverse side				7. If Unit or CA/Agreement, Name and/or No.	
Oil Well X Gas Well Other Name of Operator OXY USA WTP Limited Partnership a. Address P.O. Box 50250, Midland, TX 79710- Location of Well (Footage, Sec., T., R., M., or Survey I	0250 Description)	OCT 27 2008 OCD-ARTES[62] b. Phone No. (include area c 432-685-5717 ACCEPTED FOR	0XY Fede 9. A 30-0	Vell Name and No. Speed Bump 1 Aral Pl Well No. D15-30967 Field and Pool, or Exploratory Area re Penn	
660 FNL 810 FEL NENE(A) Sec 21 T1 12. CHECK APPROPRIATE		CATE NATURE OF NO	Eddy		
TYPE OF SUBMISSION		Gerry Guye, Deput Ex	and Anosphoenor		
X Notice of Intent Subsequent Report Final Abandonment Notice	Acidize Alter Casing Casing Repair Change Plans Convert to Injection	NMOCD-District II Deepen Fracture Treat New Construction X Plug and Abandon Plug Back	Reclamation Recomplete Temporarily Abanc	Well Integrity Other	
3. Describe Proposed or Completed Operation (clearly If the proposal is to deepen directionally or recomp Attach the Bond under which the work will be per following completion of the involved operations. I testing has been completed. Final Abandonment N determined that the final site is ready for final insper TD-10350' PBTD-10325' Perfs-1 13-3/8" 48# csg @ 433' w/ 380sx 8-5/8" 32# csg @ 2103' w/ 735sx 5-1/2" 17-20# csg @ 10335' w/ 8 1. RIH & Set CIBP @ 10000' w/ 25 2. M&P 40sx cmt @ 9350-9150' 3. M&P 35sx @ 7010-6840' 4. Cut & Pull 5-1/2" csg @ +/-59 5. M&P 55sx cmt @ 6010-5850' WOC 6. M&P 60sx @ 5400-5245' 56 6. M&P 55sx cmt @ 2165-2040' WOC 9. M&P 40sx cmt @ 483-383' 60 M&P 40sx cmt @ 483-383' 60 M&P 40sx cmt @ surface 60 M&P 40sx cmt @ surface 60 M&P 60sx cmt @ surface 60 M&P 40sx cmt @ surface 60 M&P 40 Sx	lete horizontally, give substormed or provide the Bor for the operation results in a Notices shall be filed only extion.) 0042-10070' 17-1/2" hole, T 11" hole, TOC-S 65sx, 7-7/8" hole sx cmt 30' -Tag -Jag -Jag -Jag -Jag -Jag -Jag	surface locations and measure and No. on file with BLM/BIA multiple completion or recon after all requirements, include OC-Surf-Circ urf-Circ, TOC-5980'-CBL	d and true vertical de Required subseque appletion in a new inte ing reclamation, have	opths of all pertinent markers and zones, ent reports shall be filed within 30 days erval, a Form 3160-4 shall be filed once	
14. I hereby certify that the foregoing is true and correct Name (Printed/Typed) David Stewart		Title Sr. Regul	atory Analyst	25.22.57	
Vaist		· ·	4(08		
THIS	SPACE FOR FEDER	RAL OR STATE OFFICE			
Approved by		Title		Date	
Conditions of approval, if any, are attached. Approval of certify that the applicant holds legal or equitable title to which would entitle the applicant to conduct operations the	those rights in the subject	ant or Office lease			

OXY USA WTP LP - Proposed OXY Speed Bump Federal #1 API No. 30-015-30967

40sx @ Surface

40sx @ 483-383'

55sx @ 2165-2040' WOC-Tag

17-1/2" hole @ 433' 13-3/8" csg @ 433' w/ 380sx-TOC-Surf-Circ

11" hole @ 2103' 8-5/8" csg @ 2103' w/ 735sx-TOC-Surf-Circ

55sx @ 3600-3460' WOC-Tag


60sx @ 5400-5245' WOC-Tag

55sx @ 6010-5850' WOC-Tag

35sx @ 7010-6840'

40sx @ 9350-9150'

CIBP @ 10000' w/ 25sx cmt

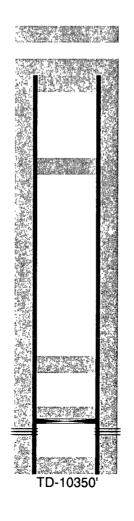

Cut & Pull 5-1/2" csg @ +/- 5930'

7-7/8" hole @ 10350' 5-1/2" csg @ 10350' w/ 865sx-TOC-5980'-CBL

Perfs @ 10042-10070'

OXY USA WTP LP OXY Speed Bump Federal #1 API No. 30-015-30967

