


UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE

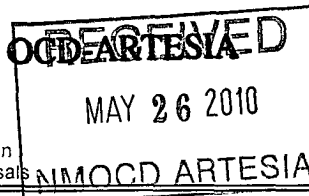

FORM APPROVED  
OMB NO. 1004-0135  
EXPIRES: March 31, 2007

RM

1a. Type of Well ☒ Oil Well ☐ Gas Well ☐ Other \_\_\_\_\_

2 Name of Operator  
**DEVON ENERGY PRODUCTION COMPANY, LP**

3 Address and Telephone No.  
20 North Broadway, Oklahoma City, OK 73102-8260 405-552-8198

4 Location of Well (Report location clearly and in accordance with Federal requirements)\*  
**1575 FSL 330 FWL**  
**C 3 18S 27E**

5. Lease Serial No.  
**LC-061783-B**

6. If Indian, Allottee or Tribe Name

7. Unit or CA Agreement Name and No.

8 Well Name and No.  
**Mann 3 Federal 2**

9. API Well No  
**30-015-35772**

10. Field and Pool, or Exploratory  
**Red Lake; Q-GB San Andres**

11. County or Parish State  
**Eddy NM**

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other _____
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input checked="" type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work and approximate duration thereof. If the proposal deepen directionally or recompleat horizontally, give subsurface location and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirement, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection)

1/05/2010 MIRU POOH with rods and pump. NU BOP and POOH with tubing.  
1/06/2010 Perforate San Andres from 1868'-2206'; 1 spf, 50 total holes. RIH with RBP and set at 2999'. RIH with packer and set at 2950'. Test RBP to 1500# - ok. Pull packer to 1766' and set.  
1/07/2010 Acidize perms with 3000 gallons 15% HCl. POOH with packer. NU frac valve  
1/08/2010 Frac down 5 1/2" casing with 5256 bbls Aqua Frac 1000 and 128,000 # 20/40 and 8000# Siberprop 16/30.  
1/11/2010 Flow well back. ND frac valve and NU BOP.  
1/12/2010 RIH with tubing. ND BOP and NU wellhead. RIH with pump and rods Hang well on RDMO.

14. I hereby certify that the foregoing is true and correct


Signed Name Norvella Adams  
Title Senior Staff Engineering Technician Date 5/10/2010

(This space for Federal or State Office use)

Approved by \_\_\_\_\_ Title \_\_\_\_\_ Date \_\_\_\_\_  
Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious, or fraudulent statements or representations to any matter within its jurisdiction

\*See Instruction on Reverse Side

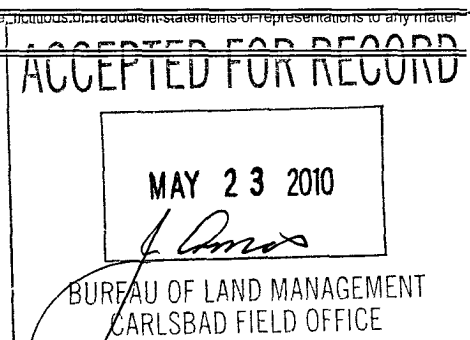

MR