

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Oil Cons.
N.M. DIV-Dist. 2
1301 W. Grand Avenue
Artesia, NM 88210

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Ocean Energy, Inc.

3. Address and Telephone No.
1001 Fannin, Suite 1600, Houston TX 77002 (713) 265-6831

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
1980' FSL & 660' FWL NSW Sec. 1 T-16-S R27E

5. Lease Designation and Serial No.
NM-8436-A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.
Diamond Mound Fed #1

9. API Well No.
30-015-22419

10. Field and Pool, or Exploratory Area
Atoka

11. County or Parish, State
Eddy County, NM

12. **CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

TYPE OF SUBMISSION

- ☐ Notice of Intent
☐ Subsequent Report
☒ Final Abandonment Notice


TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1/28/03 Drill out 4-1/2" CIBP set @ 4000', push down hole to 6366'.
1/28/03 Spot 25 sx C cmt. from 6368' to 6000', WOC & tag TOC @ 6087'.
1/29/03 Circulate hole w/ 9.5# mud w/ 25 # gel per bbl.
1/29/03 Spot 30 sx C cmt. from 4500' to 4060'.
1/29/03 Spot 30 sx C cmt. from 2974' to 2534'.
1/29/03 Spot 30 sx C cmt. from 1650' to 1210'.
1/29/03 Spot 35 sx C cmt. from 412' to surface, TOC @ surface.
1/31/03 Cut off wellhead and install dry hole marker Clean location.

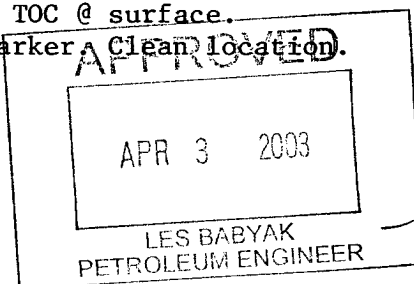

14. I hereby certify that the foregoing is true and correct.

Signed

Title Agent

Date 2/8/03

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Date

Accepted for record - NMOCD