

District I

1625 N French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S St Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103

June 19, 2008

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-21544
1. Type of Well: <input checked="" type="checkbox"/> Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator APACHE CORPORATION ✓		6. State Oil & Gas Lease No.
3. Address of Operator 303 VETERANS AIRPARK LANE, STE 3000; MIDLAND, TX 79705		7. Lease Name or Unit Agreement Name EMPIRE ABO UNIT X ✓
4. Well Location Unit Letter O : 1110 feet from the SOUTH line and 1322 feet from the E line Section 2 Township 18S Range 273 NMPM County EDDY		8. Well Number 151 ✓
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3554.4 GR		9. OGRID Number 873 ✓
		10. Pool name or Wildcat EMPIRE ABO

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐

OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☐  
CASING/CEMENT JOB ☐

OTHER: SET CIBP PREP TO PLUG ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

6-9-2011 RIH W/ CIBP & SET @ 6070'. POH W/ SETTING TOOL. RIH W/ 3 1/8" SLICK GUNS & PERF UPPER ABO F/ 5846-50', 5862-5870', 5876-80', 5892-96', 5904-08', 5924-30', 5940-44', 5948-52', 5964-70', 5988-94', 6004-12', 6016-20' W/ 2 JSPF. ACIDIZE UPPER ABO W/4000 GALS 15% ANTISLUDGE ACID.  
8-5-2011 RIH TO CIBP SET @ 6070' BREAK CIRC DO CIBP CIRC CLEAN RIH TO CIBP SET @ 6140' BREAK CIRC DO CIBP RIH TO 6155' TAG UP ON CMT DO CMT TO PBTD @ 6222' CIRC CLEAN POH.  
8-8-2011 RIH W 3-1/8" PERF GUNS PERF UPPER ABO 1 RUN 6190'-6205' W/2-JSPF .ACIDIZE WELL W/1000 GAL 15% ANTI-SLUDGE ACID.  
8-10-2011 RIH W/ CIBP AND SET @ 5790' W/ 35' CMT CAP. PERP TO PA.

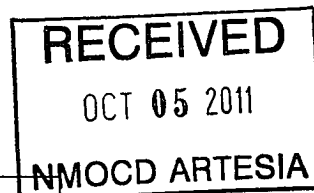

Spud Date: 09/22/1975

Rig Release Date: 10/27/1975

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Beverly Hatfield TITLE SR. STAFF ENGR TECH DATE 09/13/2011

Type or print name BEV HATEFIELD E-mail address: beverly.hatfield@apachecorp.com PHONE: 432-818-1906  
**For State Use Only**

APPROVED BY: T.L. Shapard TITLE Geologist DATE 110261 100  
Conditions of Approval (if any):