

		UNITED STATES	NTERIOR		FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010	
	BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS				5. Lease Serial No. NMNM27909	
Hanna Wast	Do not use th	is form for proposals to II. Use form 3160-3 (AP	drill or to re-enter an		Allottee or Tribe Name	
	SUBMIT IN TRIPLICATE - Other instructions on reverse side.				CA/Agreement, Name and/or N 1977	
1. Type c	1. Type of Well				and No.	
	Oil Well Gas Well Other Contact: TINA HUERTA				HE PG FEDERAL 2Y	
YATE	YATES PETROLEUM CORPORATIONE-Mail: tinah@yatespetroleum.com				2312-00-S1	
. 105 S	3a. Address 105 SOUTH 4TH STREET ARTESIA, NM 88210		3b. Phone No. (include area c Ph: 575-748-4168 Fx: 575-748-4585		10. Field and Pool, or Exploratory PECOS SLOPE-ABO	
4. Location	on of Well (Footage, Sec., 7	., R., M., or Survey Description		11. County o	Parish, and State	
Sec 2	Sec 26 T10S R25E NWNW 990FNL			CHAVES	CHAVES COUNTY, NM	
				u.	· ,	
L.	12. CHECK APPI	ROPRIĄ TE ^J BOX(ES) TO) INDICATE NATURE (OF NOTICE, REPORT, OR	OTHER DATA	
ТҮР	E OF SUBMISSION	· · · · · · · · · · · · · · · · · · ·		E OF ACTION	·	
	tice of Intent	Acidize	Deepen	□ Production (Start/Res	ume) 🔲 Water Shut-C	
		Alter Casing	Fracture Treat	Reclamation	Well Integrity	
🗖 Sut	bsequent Report	Casing Repair	New Construction	Recomplete	□ Other	
🗖 Fin	al Abandonment Notice			☑ Plug and Abandon □ Temporarily Abandon		
· · ·		Convert to Injection	Plug Back	Water Disposal	,	
2. Se 3. Pe 100 ft 4. Pe ft plug 5. Pe	et a CIBP at 4297 ft and e erforate at 1935 ft and sp t plug across the top of G erforate at 824 ft and spo g across surface casing s erforate at 60 ft and spot	ot a 30 sx Class C cemer Borieta, inside and outside a 30 sx Class C cement shoe, inside and outside c a 15 sx Class C cement	covery will be attempted. Fhis puts a plug over Abo. It plug from 1835 ft - 1935 e casing WOC & Too Pl plug from 724 ft - 824 ft. asing. WOC and tag plug plug from 60 ft up to surfac r and clean location as pe	UQ. This puts a 100 e.	NH 19CD	
Wellb	oore schematics attached	1				
14. I here	by certify that the foregoing is Co (Printed/Typed) TINA HUE	# Electronic Submission For YATES PETR Immitted to AFMSS for pro-	-, -	Well Information System ent to the Roswell n 02/12/2015 (15DRG0043SE) REPORTING SUPERVISC	PR	
. Name (2/2015	•	
Name (Signati	ure (Electronic S	Submission)	Date 02/1	2/2013		
	ure (Electronic S		Date 02/1		· · · · · · · · · · · · · · · · · · ·	
Signati			DR FEDERAL OR STAT			
Signatt 	ByDAVID_R_GLASS of approval, if any, are attache	THIS SPACE FC	DR FEDERAL OR STAT	DLEUM ENGINEER	Date 02/20	
Approved Conditions of certify that to which would Title 18 U.S.	_By_DAVID R GLASS of approval, if any, are attache the applicant holds legal or eq d entitle the applicant to condu S.C. Section 1001 and Title 43	THIS SPACE FC d. Approval of this notice does uitable title to those rights in the ict operations thereon. U.S.C. Section 1212, make it a	DR FEDERAL OR STAT	TE OFFICE USE	Date 02/20	
Approved Conditions of certify that to which would Title 18 U.S.	_By_DAVID R GLASS of approval, if any, are attache the applicant holds legal or eq d entitle the applicant to condu S.C. Section 1001 and Title 43 v false, fictitious or fraudulent	THIS SPACE FC d. Approval of this notice does uitable title to those rights in the act operations thereon. U.S.C. Section 1212, make it a statements or representations as	DR FEDERAL OR STAT	TE OFFICE USE	tment or agency of the United	

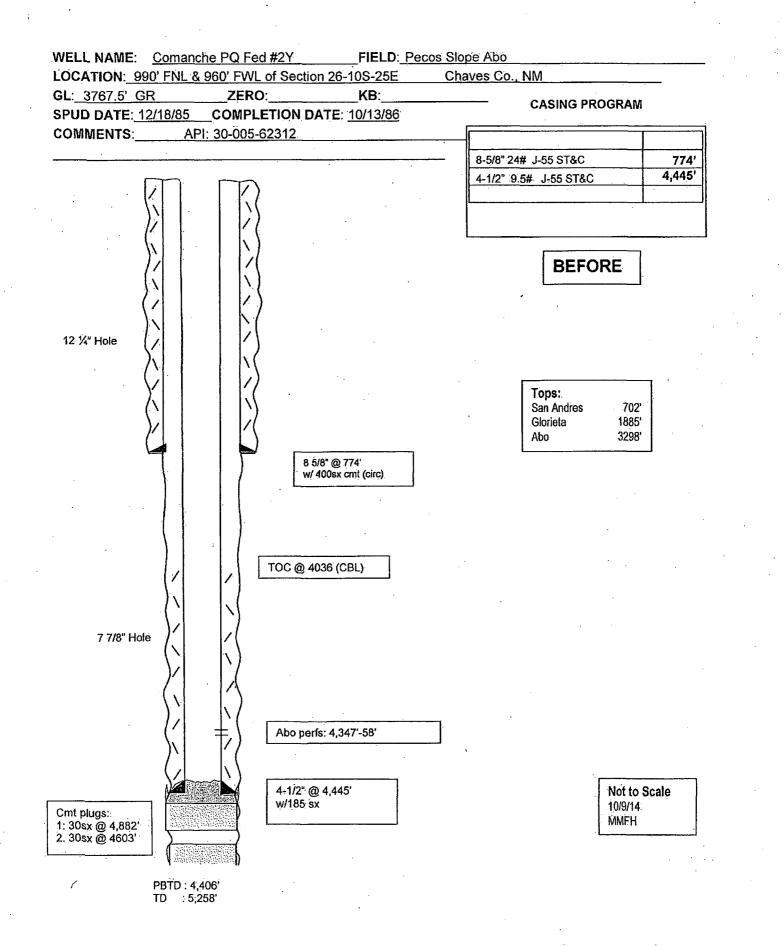

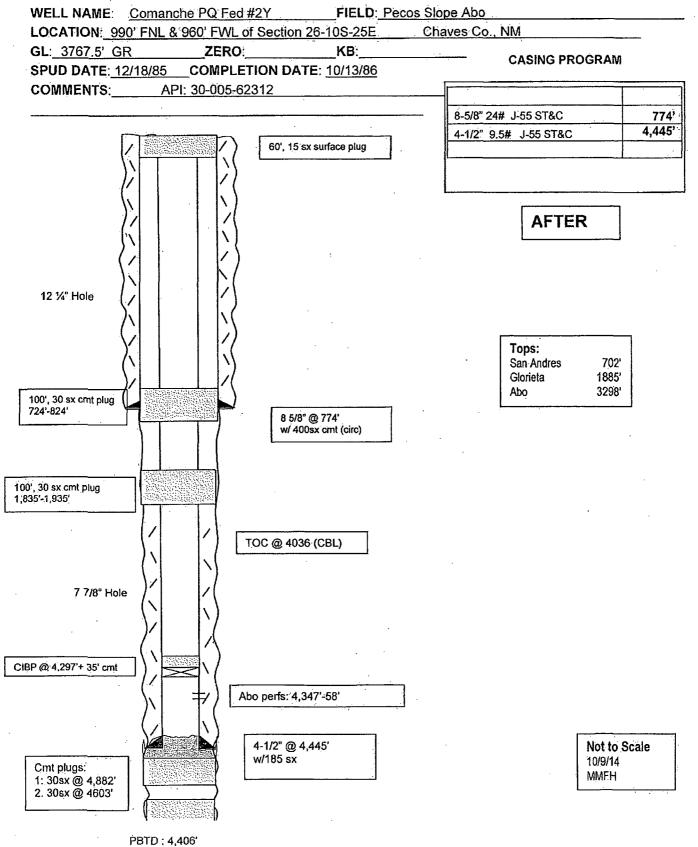

TD : 5,258'

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office (RFO), prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action.' Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.

2. <u>Notification:</u> Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement:</u> Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.