Form 3160-5		NMO	CD	I FORM				
	UNITED STATES EPARTMENT OF THE INTI		FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018					
SUNDRY	UREAU OF LAND MANAGE	S ON WELLS		5. Lease Serial No. NMLC060999				
Do not use th abandoned we		6. If Indian, Allottee o	r Tribe Name					
SUBMIT IN		7. If Unit or CA/Agree	ement, Name and/or No.					
1. Type of Well Soli Well Gas Well Ot	har			8. Well Name and No. MCINTYRE B 7				
2. Name of Operator COG OPERATING LLC			· · · · · · · · · · · · · · · · · · ·	9. API Wcll No. 30-015-31561				
3a. Address 600 W ILLINOIS AVE MIDLAND, TX 79701	3a. Address 3b. Phone No. (include area code) 600 W ILLINOIS AVE Ph: 432-685-4332							
4. Location of Well <i>(Footage, Sec., 7</i>	., R., M., or Survey Description)		· .	Gray hung JACKson SCOVa St 11. County or Parish, State				
Sec 20 T17S R30E Mer NMP	330FSL 330FWL			EDDY COUNTY, NM				
12. CHECK THE A	PPROPRIATE BOX(ES) TO	INDICATE NATURE O	F NOTICE,	REPORT, OR OTH	IER DATA			
TYPE OF SUBMISSION		TYPE OI	FACTION		<u> </u>			
Notice of Intent	🗖 Acidize	Deepen		ion (Start/Resume)	□ Water Shut-Off			
Subsequent Report	□ Alter Casing		🖸 Reclam		U Well Integrity			
Final Abandonment Notice	Casing Repair Change Plans	New Construction Plug and Abandon	Recomp		Other			
	Convert to Injection	Plug Back	-	 Temporarily Abandon Water Disposal 				
COG Operating LLC, respect MCINTYRE B #7 We are going to set a CIBP at have our PBTD @ 4,374?. We 3,610?-3,985?. Ideally, we like bottom hole assembly room a desired rathole space, this giv later time. Equipment Pull Procedure ? MIRU WSU, NU BOP ? Unset pump and POOH with	4,414? (50? above the YES) e plan to have our top perfs fr e to have 200?-300? of rathol nd prevent tubing from getting res COG the option to re-ente $\mathcal{M} \subset \mathcal{M} \to \mathcal{M}$ Accepted for record	O perfs) w/ 40? of CMT or rom 3,185? ? 3,570? and the le below our bottom perfs g stuck with sand. In addi r the Glorietta/Yeso forma 6 –/ 8 NMOCOSEE ATT	top of the p pottom perfs to give our tion to havin tion at a ACHEI	from APR	2 6 2018 ARTESIA O.C.D			
14. I hereby certify that the foregoing is	true and correct. Electronic Submission #4112 For COG OPER	203 verified by the BLM Wel	I Information	n System				
Namc (Printed/Typed) KANICIA	Committed to AFMSS for pro-	CESSING LLC, sent to the Ca cessing by JENNIFER SANG Title PREPA	CHEZ on 04/1	12/2018 ()				
Signature (Electronic S	Submission)	Date 04/1 /2		PENIER				
		FEDERAL OR STATE			Yh			
Approved By Conditions of approval, if any, are attache certify that the applicant holds legal or equ which would entitle the applicant to condu Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s (Instructions on page 2)	uitable title to those rights in the subjuct operations thereon. U.S.C. Section 1212, make it a crim	ject lease Office	AP EVREAU OF		Price I Andrew Price Agence of Anter Printed			
** OPERA1	TOR-SUBMITTED ** OPE		* OPERAT \$6-4	1. /				

•

÷

.

Additional data for EC transaction #411203 that would not fit on the form

32. Additional remarks, continued

 ? PU scraper and scrape down to 4,464? ? RU Wireline ? Make gauge ring/ junk basket run ? Set CIBP @ 4,414? ? Wireline truck dump 40? Class C cement of top of CIBP ? Tag cement plug to verify depth of 4,374? ? Pull up 4? to circulate hole clean with fresh water, and displace w/ 2% KCL and 1% packer corrosion inhibitor. ? Test Casing to 4,300 psi and report back to engineering if the pressure holds. ? Dump bail acid in the perf interval ? RIH w/ perforating guns and perforate San Andres Zone from 3,610?-3,985?, w/ 3 spf, 120? phasing, 54 holes ? NU 5K frac valve ? Secure wellbore ? RDMO WSU
Tentative Recompletion Procedure ? RU Elite Well Services Frac Crew ? Acidize w/ 3,000 gals of 15% HCI. ? SW Frac zone w/ 375,000 # of sand ? Record ISIP and FG, Get 5, 10, 15 min SIP ? Rig up Wireline ? RiJH w/ WL and set Composite Plug @ 3,590? ? Perforate San Andres Zone from 3,185?-3,570?, w/ 3 spf, 120? phasing, 54 holes ? Acidize w/ 3,000 gals of 15% HCI ? SW Frac zone w/ 375,000 # of sand ? Record ISIP and FG, Get 5, 10, 15 min SIP ? RDMO Elite
Please see attachment for full procedure.

attachment for full procedure.

MCINTYRE B #7

We are going to set a CIBP at 4,414' (50' above the YESO perfs) w/ 40' of CMT on top of the plug to have our PBTD @ 4,374'. We plan to have our top perfs from 3,185' – 3,570' and bottom perfs from 3,610'-3,985'. Ideally, we like to have 200'-300' of rathole below our bottom perfs to give our bottom hole assembly room and prevent tubing from getting stuck with sand. In addition to having desired rathole space, this gives COG the option to re-enter the Glorietta/Yeso formation at a later time.

Equipment Pull Procedure

- MIRU WSU, NU BOP
- Unset pump and POOH with rod and tbg
- PU scraper and scrape down to 4,464'
- RU Wireline
- Make gauge ring/ junk basket run

– Cet 13. april 444

• Wireline truck dump 40' Class C cement of top of CIBP

suger the upsight an efgicepth of 4,874/

- Pull up 4' to circulate hole clean with fresh water, and displace w/ 2% KCL and 1% packer corrosion inhibitor.
- Test Casing to 4,300 psi and report back to engineering if the pressure holds.
- Dump bail acid in the perf interval
- RIH w/ perforating guns and perforate San Andres Zone from phasing, 54 holes
- NU 5K frac valve
- Secure wellbore
- RDMO WSU

Tentative Recompletion Procedure

- RU Elite Well Services Frac Crew
- Acidize w/ 3,000 gals of 15% HCl.
- SW Frac zone w/ 375,000 # of sand
- Record ISIP and FG, Get 5, 10, 15 min SIP
- Rig up Wireline

when we we character as proved of Rhup, (we have 90)

- Perforate San Andres Zone from 1,339 1,270⁴, w/ 3 spf, 120° phasing, 54 holes
- Acidize w/ 3,000 gals of 15% HCl
- SW Frac zone w/ 375,000 # of sand
- Record ISIP and FG, Get 5, 10, 15 min SIP
- RDMO Elite


Return to Production Procedure

- MIRU WSU
- RIH with bit and bailer to drill out composite plug
- Clean out fill to new State (0.14)
- RIH with production tubing as follows:
 - o (95) jts 2-7/8" J55 6.5# tbg
 - o (1) 2' marker joint

- o (2) jts 2-7/8" J55 6.5# tbg
- o TAC @3,153'
- o (26) jts 2-7/8" J55 6.5# tbg
- o SN @ 4,000'
- o (1) 20' MSMA
- o EOT @ 4,020'
- ND BOP, set TAC, flange up WH
- RIH w/ rod design as follows:
 - o (1) 26' x 1-1/2" SMPR
 - o (153) 3/4" D rods
 - o (7) 1-5/8" K bars
 - o (1) 25-150 RHBC-20' Pump
- Means and have as many rods as possible and pull the rest from investigary
- 角印派明示加。如何认为新作用() 多名作的
- Hang on, load tubing and note pump action and alignment
- Clean location
- Update rod and tubing detail in Well View
- All charges will hit recompletion AFE (800/500) code
- PWOP and contact Robby Miller before turning on
- RDMO, TOTP

Cumon

COG Operating LLC

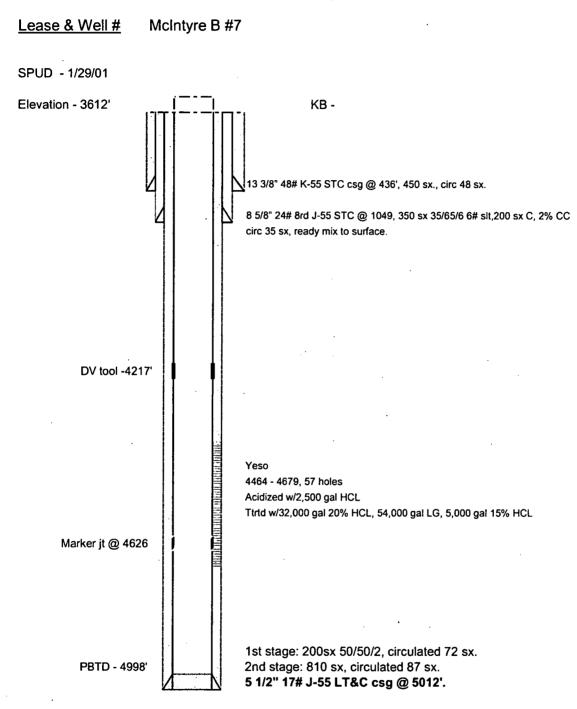


McIntyre B #7 Wellbore diagram

SH

Propos

COG Operating LLC

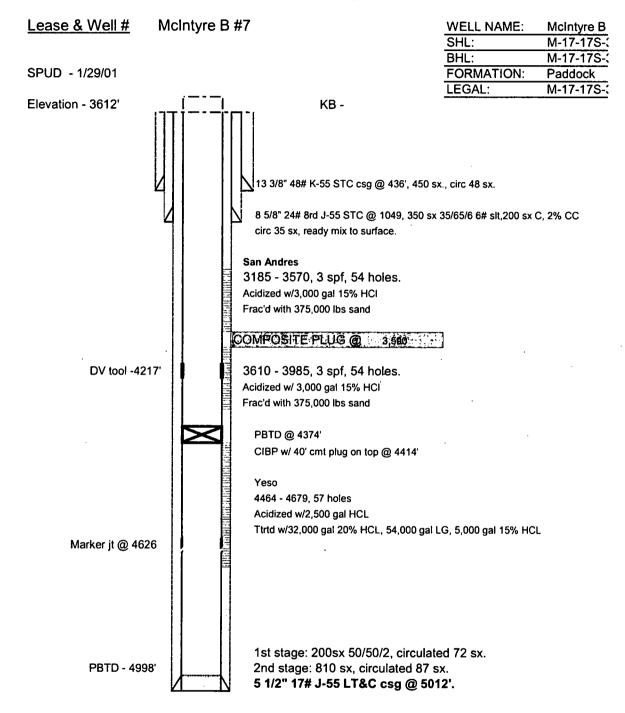

<u>District 1</u> 1625 N. French Dr <u>District 11</u> 1301 W. Grand Av <u>District 111</u> 1000 Rio Brazos R <u>District IV</u> 1220 S. St. Francis	venue, Artesi d., Aztec, NN	a, NM 88210 21 87410 5e, NM 87505 W		OIL C	ONSERVAT 220 South St Santa Fe, N N AND ACF	w Mexico 1 Resources Depa 11ON DIVISIO 1 Francis Dr. M 87505 REAGE DEDIC		2018 ubmit to ATESIA T	Revis State Fee Ame	Form C-102 ed June 10, 2003 te District Office Lease - 4 Copies Lease - 3 Copies NDED REPORT	
	-015-315	61		96718	96718 Loco Hills; Glorieta Yeso						
⁴ Property 302575	ł				⁵ Property McInty			⁶ Well Number 7			
⁷ OGRID 22913	1	•			³ Operator COG OPERAT	Name			9	Elevation 3612	
		<u> </u>				Location		······································	L		
UL or lot no.	Section	Township	Range	Lot Ida		North/South line	Feet from the	East/We		County	
M	20	17S	30E	ttom Uo	330	South f Different From	330	We	st	Eddy	
UL or lot no.	Section	Township	Range	Lot Idn	-	North/South line	Feet from the	East	t/West line	County	
¹² Dedicated Acre 40	s ¹³ Joint o	r Infill ¹⁴ Co	onsolidation C	Code ¹⁵ O	L	<u></u>	II				
NO ALLOWA	ABLE WI	LL BE ASS				JNTIL ALL INTEI APPROVED BY	THE DIVISION	ERATO ertify that th complete to	R CER the information the best of	ATED OR A NON TIFICATION on contained herein (my knowledge and	
								Regulat	ory Analy 06/02/08 R CERT		

Date of Survey
Signature and Seal of Professional Surveyor.
Certificate Number

330'

•

330'

0

		-					RECEIVED			
<u>District 1</u> 1625 N. French Dr., Hobbs, NM 88240 <u>District 11</u> 1301 W. Grand Avenue, Artesia, NM 88210 <u>District 111</u> 1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> 1220 S. St. Francis Dr., Santa Fe, NM 87505			Er		State of New erals & Natura ONSERVAT 20 South St. Santa Fe, N	v Mexico I Resources Depa TON DIVISIO Francis Dr. M 87505	rtmertAPR 26 N S DISTRICT II-AF	Fe	Form C-102 sed June 10, 2003 ate District Office e Lease - 4 Copies e Lease - 3 Copies ENDED REPORT	
		•	ELL LO	CATIO	N AND ACR	EAGE DEDIC	CATION PLA	_		
· · · · ·	API Numbe	r		² Pool Code ³ Pool Name						
30	-015-315	61		28509 Grayburg Jackson; SR-Q-G-SA						
⁴ Property 30257		·	- 4		⁵ Property 1 McIntyr		6,	⁶ Well Number 7		
'OGRID	No.				⁸ Operator 1	Name		⁹ Elevation		
22913	7				COG OPERAT	ING LLC		3612		
	ı				¹⁰ Surface	Location				
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County	
М	20	17S	30E		330	South	330	West	Eddy	
.	.		^{II} Bo	ttom Ho	le Location I	f Different From	m Surface	• • • •	•	
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County	
12 Dedicated Acro	es ¹³ Joint o	r Infill " C	onsolidation	Code ¹⁵ Or	der No.				l;	

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

40

		· .		¹⁷ OPERATOR CERTIFICATION I hereby certify that the information contained herein
	-			is true and complete to the best of my knowledge and
				belief.
		ŕ		Signature
				Kanicia Carrillo
				Printed Name
				Regulatory Analyst
				Title and E-mail Address
			-	06/02/08
				¹⁸ SURVEYOR CERTIFICATION
				I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys
				made by me or under my supervision, and that the
			· · ·	same is true and correct to the best of my belief.
				Date of Survey
				Signature and Seal of Professional Surveyor:
330,				
3				
330'				Certificate Number

Rw 5-4-18,

Mcintyre B 7 30-015-31561 COG Operating LLC April 12, 2018 Conditions of Approval

Work to be completed by July 12, 2018.

1. Operator shall place a CIBP at 4,414' and place 40' Class C Cement on top of the CIBP. WOC and TAG.

Note: At a later date, operator will need to add 110' of cement to the CIBP to properly seal the Glorietta Formation.

- 2. Must conduct a casing integrity test before perforating and fracturing. Submit results to BLM. The CIT is to be performed on the production casing to max treating pressure. Notify BLM if test fails.
- 3. Before casing or a liner is added or replaced, prior BLM approval of the design is required. Use notice of intent Form 3160-5.
- 4. Surface disturbance beyond the originally approved pad must have prior approval.
- 5. Closed loop system required.
- 6. All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of work over operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.
- 7. Operator to have H2S monitoring equipment on location.
- 8. A minimum of a 2000 (2M) BOP to be used. All blowout preventer (BOP) and related equipment (BOPE) shall comply with reasonable well control requirements. A two ram system with a blind ram and a pipe ram designed for the size of the work string shall be adequate. Tapered work strings will require an additional pipe ram. The manifold shall comply with Onshore Oil and Gas Order #2 Attachment I (2M Diagrams of Choke Manifold Equipment). The accumulator system shall have an immediately available power source to close the rams and retain 200 psi above pre-charge. The pre-charge test shall follow requirements in Onshore Order #2.

9. Subsequent sundry required detailing work done and completion report for the formation. Operator to include new well plat and well bore schematic of current well condition when work is complete.

10. See attached for general requirements.

JAM 041218

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Production Zone Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from this approval.

If you are unable to plug back the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. For wells in Eddy County, call 575-361-2822. For wells in Lea County, call 575-393-3612

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Subsequent Plug back Reporting</u>: Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date work was completed</u>.

7. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.