

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OPERATOR'S COPY

FORM APPROVED
OMB NO. 1004-0135
Expires: November 30, 2000

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other

Dry Hole

2. Name of Operator

OXY USA WTP Limited Partnership

3a. Address

P.O. Box 50250, Midland, TX 79710-0250

3b. Phone No. (include area code)

432-685-5717

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660 FNL 660 FWL NWNW(D) SEC 21 T17S R27E

5. Lease Serial No.

NM15429

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No

8. Well Name and No.

OXY Excalibur 1
Federal

9. API Well No.

30-015-30771

10. Field and Pool, or Exploratory Area

Logan Draw Morrow

11. County or Parish, State

Eddy NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent☐ Subsequent Report☐ Final Abandonment Notice

TYPE OF ACTION

☐ Acidize☐ Deepen☐ Production (Start/Resume)☐ Water Shut-Off☐ Alter Casing☐ Fracture Treat☐ Reclamation☐ Well Integrity☐ Casing Repair☐ New Construction☐ Recomplete☐ Other☐ Change Plans☒ Plug and Abandon☐ Temporarily Abandon☐ Convert to Injection☐ Plug Back☐ Water Disposal

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

TD - 9340' PBDT - 8945' PERFS - 9004-9014' CIBP-8980'

13-3/8" 48# @ 436' w/ 400sx, 17-1/2" hole, TOC-Surf-Circ

8-5/8" 32# @ 1535' w/ 735sx, 11" hole, TOC-Surf-Circ

4-1/2" 17# @ 9339' w/ 895sx, 7-7/8" hole, TOC-5570'-CBL

1. RIH & Tag Cement & CIBP @ 8945'

2. M&P 25sx cmt @ 8335-8235' 45sx C1H @ 8942'-

3. M&P 25sx cmt @ 7675-7575' 40sx C1C @ 6054'

4. Cut & pull 4-1/2" csg at approximately 5550'

5. M&P 30sx cmt @ 5600-5500', WOC-TAG

6. M&P 40sx cmt @ 3600-3500'

7. M&P 40sx cmt @ 1585-1485' WOC-Tag

8. M&P 35sx cmt @ 486-386' WOC-Tag

9. M&P 25sx cmt Surface Plug

10# MLF BETWEEN PLUGS

Accepted for record
NMOCSEE ATTACHED FOR
CONDITIONS OF APPROVAL

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

David Stewart

Title

Sr. Regulatory Analyst

Date

2/22/07

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Office

APPROVED

FEB 27 2007

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

SUNDRY NOTICE SPECIAL STIPULATIONS

1. Approval is granted to P/A this well with the following modifications to the program:
2. A 45 sack plug; using class H cement, will be set @ 8912' to cover the top of the Morrow formation.
3. The top of the Wolfcamp will be covered by a 40 sack plug @ 6054'. This plug and all other plugs can use class C cement.
4. All of the plugs in the submitted procedure below 5800' can be eliminated.
5. The surface plug must be circulated to the surface from 100 feet.

*** All plugs, including the surface plug, should leave at least 25 sacks of cement inside the casing and be at least 100 feet, plus an additional 10% for each 1000 feet of depth.**

Plugging procedures must conform to 43 CFR 3162.6.d and Onshore Order No. 2.III.G or NMOCD orders if they are more stringent.

All of the work approved here must be completed within 90 days

Engineering
can be reached at 505-706-2779 for any variances that might be necessary.

F Wright 2/27/07


**Accepted for record
NMOCD**

OXY USA WTP LP - Proposed
OXY Excalibur Federal #1
API No. 30-015-30771

25sx Surface

35sx @ 486-386' WOC-Tag

40sx @ 1585-1485' WOC-Tag

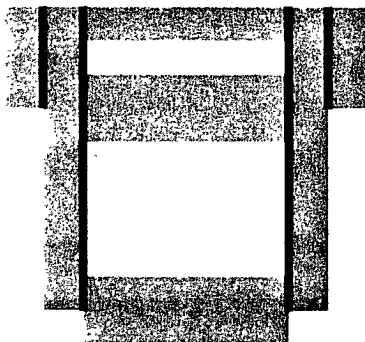

17-1/2" hole @ 436'
13-3/8" csg @ 436'
w/400sx-TOC-Surf-Circ

11" hole @ 1535'
8-5/8" csg @ 1535'
w/735sx-TOC-Surf-Circ

40sx @ 3600-3500'




30sx @ 5600-5500' WOC-Tag

40
25sx @ 7675-7575' 6054-5954'

45
25sx @ 8335-8235' 8912-8812'

8/02-CIBP @ 8980' w/ 35' cmt

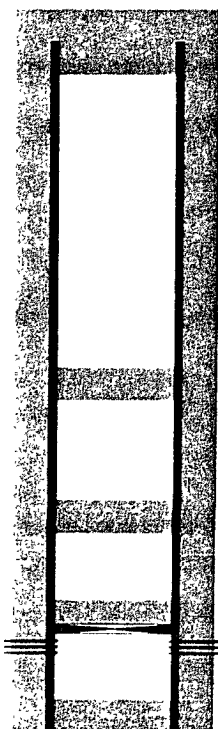

TD-9340'


Cut & Pull 4-1/2" csg @ +/-5550'

Accepted for record
NMOCD

7-7/8" hole @ 9340'
4-1/2" csg @ 9339'
w/895sx-TOC-5570'-CBL

Perfs @ 9004-9014'

OXY USA WTP LP - Current
OXY Excalibur Federal #1
API No. 30-015-30771

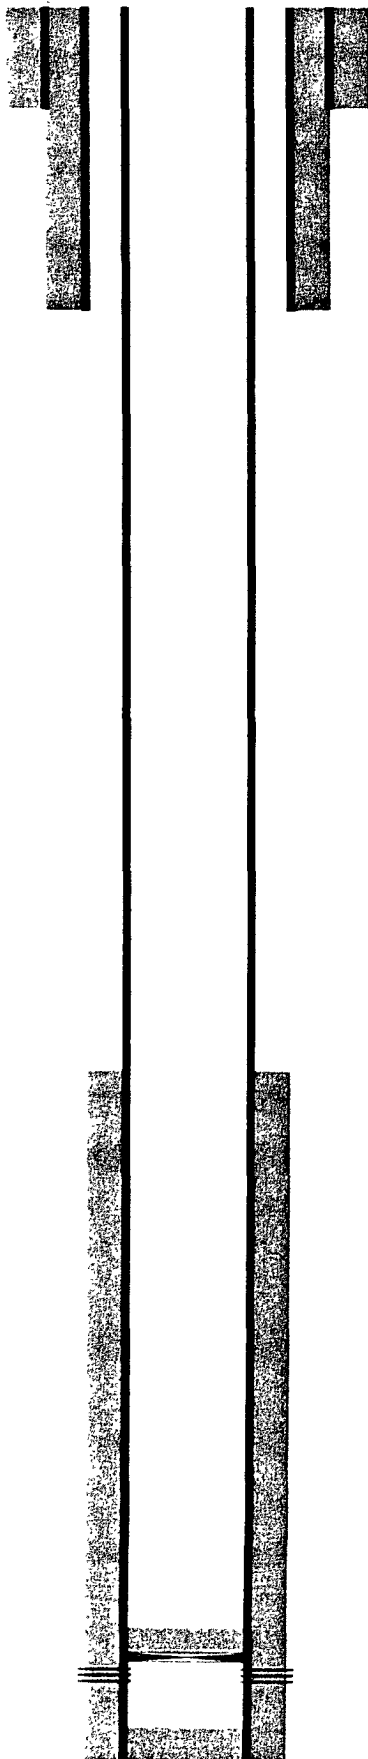

Accepted for record
NMOCD

7-7/8" hole @ 9340'
4-1/2" csg @ 9339'
w/895sx-TOC-5570'-CBL

Perfs @ 9004-9014'