

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD-ARTESIA

FORM APPROVED
OMB No. 1004-0137
Expires March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS
*Do not use this form for proposals to drill or to re-enter an
abandoned well. Use Form 3160-3 (APD) for such proposals.*

S

5. Lease Serial No.
NM-77046
6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE – Other instructions on page 2.

7. If Unit of CA/Agreement, Name and/or No.

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

DEC 20 2007

8. Well Name and No.
North Pure Gold 9 Federal 2

2. Name of Operator
Devon Energy Productin Company, L.P.

OCD-ARTESIA

9. API Well No.
30-015-27479

3a. Address
20 North Broadway
Oklahoma City, OK 73102

3b. Phone No. (include area code)
405-235-3611

10. Field and Pool or Exploratory Area
Delaware

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FSL & 660' FWL SEC9 T23S R31E

11. Country or Parish, State
Eddy NM


12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other Add Pay
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	Delaware
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation. Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

11/30/07 - MIRU PU.

12/01 - 12/07/07 - POOH w/ rods & tbg. Perf 7748-7824' @ 1 spf: total 76 shots. Tag btm @ 7905' PBTD should be 8076'. RIH w/ RBP & pkr and set RBP @ 7872'. Test to 500#, good. Set pkr @ 7692'. Acidize w/ 7K gals 7 1/2% HCL w/ 120 BS. Flush w/ 2% KCL. RD BJ. Rlse pkr. Latch on to RBP & rlse. CO to 7954'. Set TAC. ND BOP. RIH w/ pump and rods. RD PU. Left well pumping to tank. POP.

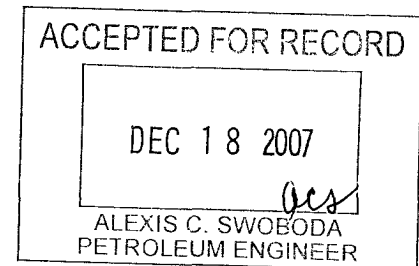

14. I hereby certify that the foregoing is true and correct.

Name (Printed/Typed)
Judy A. Barnett

Title Regulatory Analyst

Signature

Date 12/13/2007

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)