

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

2040 South Pacheco
Santa Fe, NM 87505

C13F
Op

Form C-103
Revised March 25, 1999

WELL API NO. 30005-61033
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Twin Lakes San Andres Unit
7. Well No. 90
8. Pool name or Wildcat Twin Lakes; San Andres (Assoc)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input checked="" type="checkbox"/> Injection	7. Lease Name or Unit Agreement Name: Twin Lakes San Andres Unit
2. Name of Operator Concho Oil & Gas Corp.	7. Well No. 90
3. Address of Operator 110 W. Louisiana Ste 410; Midland, Tx 79701	8. Pool name or Wildcat Twin Lakes; San Andres (Assoc)
4. Well Location Unit Letter <u>M</u> : <u>990</u> Feet from the <u>South</u> line and <u>330</u> feet from the <u>West</u> line Section <u>5</u> Township <u>9S</u> Range <u>29E</u> NMPM Chaves County	
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3920.9 GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Concho Oil & Gas Corp. respectfully requests approval to plug and abandon the TLSAU #90 well according to the following procedure:

1. Notify NMOCD Artesia 24 hrs prior to commencement of procedure.
2. Previously (03/01) pump 25 sx plug & tagged @ 2105'.
3. Circ hole w/ mud.
4. Set 100' cmt plug @ 2005-2105'. 1400' to 1500'
5. Perf csg @ 1690' & set 100' plug @ 1640-1740'. WOC. Tag. Inside & Outside
6. Perf csg @ 940' & set 100' plug @ 890-990'. WOC. Tag. Inside & Outside
7. Pull parted csg from 170'.
8. Circ cmt from 220' to surface.
9. Cut off wellhead & install dry hole marker.

RECEIVED
OCD - ARTESIA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Terri Statton TITLE Production Analyst DATE 9-28-01

Type or print name Terri Statton Telephone No. 915/683-7443

(This space for State use)
APPROVED BY Wild Sep ID TITLE Wild Sep ID DATE 10-10-01

Conditions of approval, if any:


TLSAU #90

Formerly - O'Brien FF #6

Lease No.: 24988 Dist. No.: County: Chaves Field: Twin Lakes San Andres
 Section: 5 Twsp: 9S Range: 29E Unit Ltr: M Location: 990' FSL & 330' FWL

API No. 30-005-61033

Spud Date: 08/03/81
 TD Date: 08/08/81
 Comp Date: 08/11/81

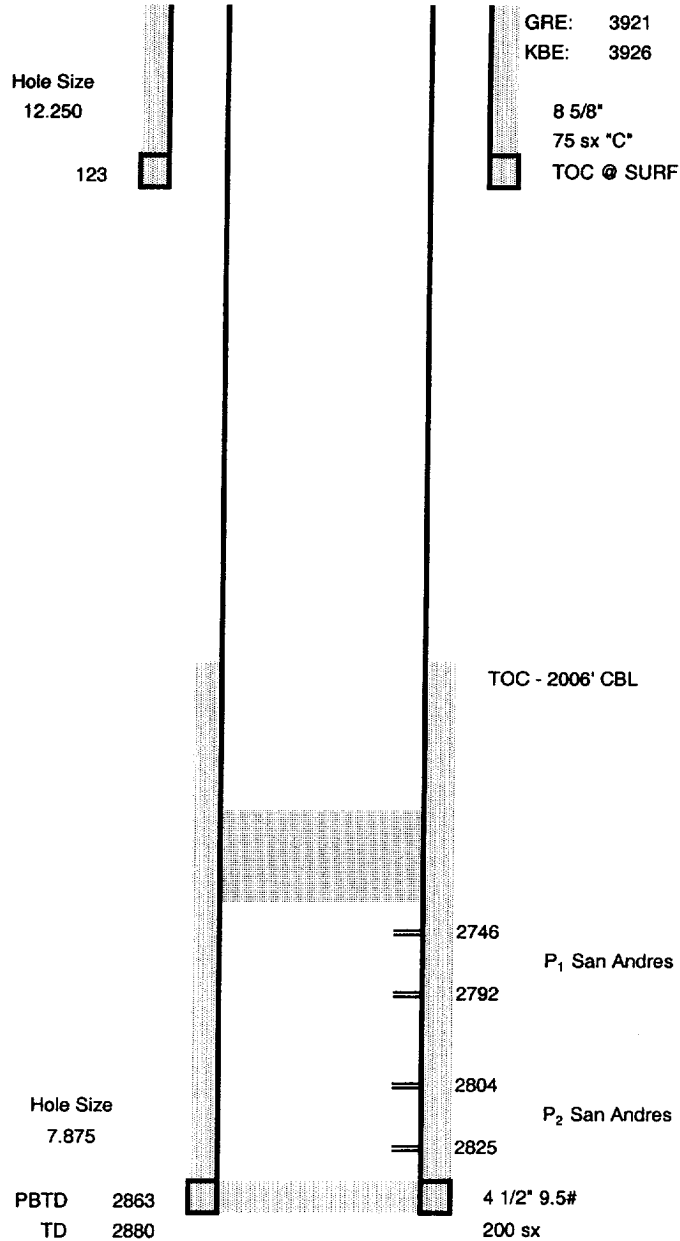

Original Perf Details: P1: 2756, 57, 58, 60, 60.5, 61, 70, 71, 73.5, 74, 74.5, 75.5, 76, 76.5, 77.5, 78, 83.5, 84, 84.5, 91, 91.5, 92
 9000 gals 28% acid

Apr-85 Add P1: 2746, 47, 48, 51, 52, 68, 69, 81, 82, 88, 89, 90
 Add P2: 2804, 05, 08, 09, 10, 13, 16, 17, 19, 20, 22, 23, 24, 25
 Isolated P2 and acid'd w/ 2200 gals 20% nitrified acid

Jan-88 Put on injection

Mar-01 Csg parted @ 170'. Ran tbg and set 25 sx cmt plug @ 2685'. Tagged @ 2105'

Operator Concho Oil Co.
Well Twin Lakes SA Unit 90
Unit M Section 5 Township 4 Range 29
API # 30-005-61033

- Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug
- Install Dry Hole Marker

* Notify OCD 24 hrs. prior to any work done

