

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO.
30005-61452

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

Twin Lakes San Andres Unit

7. Well No.

101

8. Pool name or Wildcat

Twin Lakes; San Andres (Assoc)

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐ Injection ☐

2. Name of Operator

Concho Oil & Gas Corp.

3. Address of Operator

110 W. Louisiana Ste 410; Midland, Tx 79701

4. Well Location

Unit Letter D : 990 Feet from the North line and 990 feet from the West line

Section 7 Township 9S Range 29E NMPM Chaves County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3918GR

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Concho Oil & Gas Corp. respectfully request approval to plug and abandon the above well according to the following procedure:

1. Notify the NMOCD Artesia District 24 hours prior to commencement.
2. Set 120' cmt plug @ 2590-2710'. WOC & tag.
3. Circ hole w/ mud.
4. ~~2534~~ Set ~~120~~' cmt plug @ ~~1990~~-2040'.
5. ~~2534~~ Set ~~140~~' cmt plug @ ~~1590~~-1630'.
6. ~~2534~~ Set ~~180~~' cmt plug @ ~~790~~-850'.
7. ~~232~~' Perf csg @ ~~142~~'. Circ cmt from 232' to surface.
8. Cut off wellhead & install P&A marker.

RECEIVED
OCD - ARTESIA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Production Analyst DATE 1-11-02

Type or print name Terri Stathem Telephone No. 915/683-7443

(This space for State use)

APPROVED BY [Signature] TITLE Wild Dept DATE JAN 11 2002

Conditions of approval, if any:


TLSAU #101

Formerly - Moonshine 7 #1

Lease No.: 24988 Dist. No. : County: Chaves Field: Twin Lakes San Andres
 Section: 7 Twsp: 9S Range: 29E Unit Ltr: D Location: 990' FNL & 990' FWL

API No. 30-005-61452

Spud Date: 03/10/82
 TD Date: 03/19/82
 Comp Date: 04/01/82

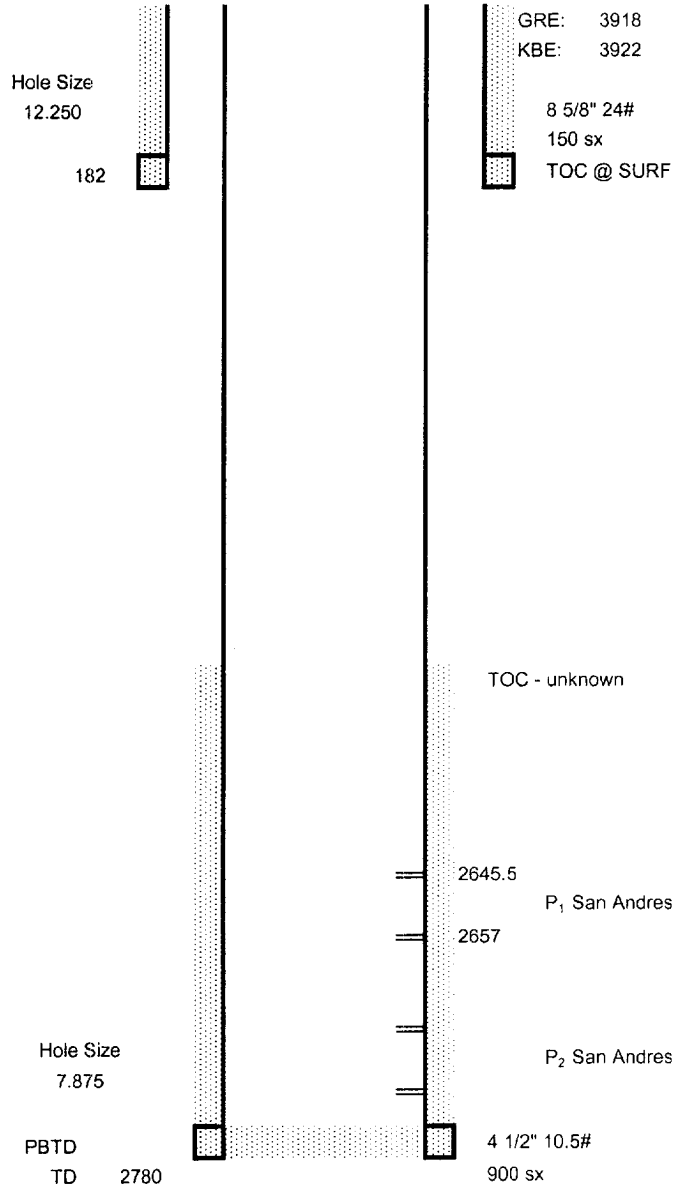

Formation Tops:
 Yates 800
 Base of Salt 1580
 San Andres 1990

Original Perf Details: P1: 2645.5, 46, 47, 51, 52, 53, 54, 55, 56, 57
 5000 gals 20% acid