

COMPANY <i>Rault Petroleum</i>		PROPERTY NAME <i>Union State</i>	WELL NO. <i>1</i>
DATE	LOCATION ULSTR) <i>F 15-2-28</i>	FOOTAGE <i>1980 N/W</i>	
API NO. <i>30-002-61711</i>		POOL <i>Wildcat</i>	


Set 30 sx cmt @ 566' & tag
 Spot 25 sx cmt @ 6195'
 Spot 25 sx cmt @ 5630'
 Spot 25 sx cmt @ 4450' to cement
 TOC @ 4430' & cement plug
 Perforate 4 1/2" csg @ 1486' & circulate
 cement to surface leaving 150' plug
 above 8 5/8" csg shoe. TAG
 Spot 10 sx surface plug
 Set 25 ft. surface
 Plug & level location
 4 1/2" perforator plugs @ 25/B per
 bbl/brine

CASING RECORD:

Contractor will need to check
 condition at road & location
 before pulling string line.

- * 10 sx surface plug.
- * Perf. 4 1/2" csg @ 1486'. Circ. cement to surface
leaving 150' above 8 5/8" csg shoe. TAG
- * 25 sx cement Plug @ 4450'.
- * 25 sx cement Plug @ 5630'.
- * 25 sx cement Plug @ 6195'. < Circ. Brine gel.
- * 30 sx cement Plug @ 566'. TAG

After

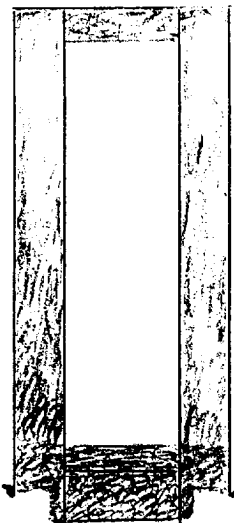

8 5/8" @ 1426'

4450'

TOC 4430'

5630'

6195'

4 1/2" @ 1486'
 4 1/2" @ 1810'