

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

RECEIVED

JAN 31 1992

O. C. D.

ARTESIA OFFICE

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
2. NAME OF OPERATOR McKay Oil Corporation		7. UNIT AGREEMENT NAME	
3. ADDRESS OF OPERATOR Post Office Box 2014, Roswell, NM		8. FARM OR LEASE NAME Macho Federal	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 990' FNL & 990' FWL		9. WELL NO. #1	
14. PERMIT NO.		10. FIELD AND POOL, OR WILDCAT W. Pecos Slope Abo	
15. ELEVATIONS (Show whether DP, RT, GR, etc.)		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 28-6S-23E	
		12. COUNTY OR PARISH Chaves	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Plug and abandon

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

XX

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Operator plugged and abandoned well as follows:

TIH w/DP to 2980', pump 1st plug w/20 sxs. Class "C", 2% CaCl from 2980' -2880'
Pulled 6 sxs., WOC. Tag w/Wireline @ 2844'. LD 32 sxs. DP.

2nd plug - Pump 20 sxs. Class "C", 2% CaCl from 2180' - 2080', Pulled 6 sxs.,
WOC, tag w/wireline @ 2052', LD 46 jts. DP.

3rd plug - Pump 20 sxs. Class "C", 2% CaCl from 1030' - 930', pulled 6 sxs., WOC
Tag w/wireline @ 947'. Job completed @ 12:39 a.m. 12-24-91.

Well turned over to surface owner for water well. Surface owner now lives in
Houston, Texas, will send agreement upon our receipt.

Post ID-2
4-17-92
P & A

(Turn to rancher
for water well)

18. I hereby certify that the foregoing is true and correct

SIGNED Theresa Rodriguez TITLE Production Analyst


DATE 1-3-92

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

*See Instructions on Reverse Side

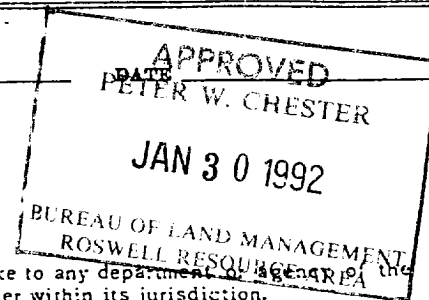

2000-01-01

2000-01-01

2000-01-01

RECEIVED

JAN 6 9 43 AM '92

RECEIVED
ROSEN
JAN 6 1992