

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30 - 005 - 63389
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator EXCO Resources, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 6500 Greenville Ave., Suite 600, Dallas, TX 75206		7. Lease Name or Unit Agreement Name: Rose Federal
4. Well Location Unit Letter E : 1980 feet from the North line and 660 feet from the West line Section 21 Township 05S Range 25E NMPM NM County Chaves		8. Well No. 18
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3803'		9. Pool name or Wildcat Pecos Slope EIA 547405

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

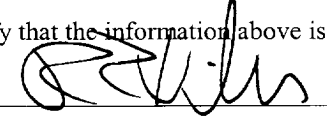
SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation. Plugging procedure verbally given from Van Bart NMOCD at 1400 hrs, 8-5-01.

8-6-01
2130--0100 RU BJ, Circ pipe clear, pump Plug #1 from 3650--3459 w.65 sx. Class C.
0100--0245 Lay down Drill Pipe to 1509'.
0245--0300 Clear DP, Pump Cement Plug #2 from 1509--1409' w/35 sx. Class C.
0330--0400 Lay down Drill Pipe to 967'.
0400--0430 Clear DP, Pump Cement Plug #3 from 967--867' w/ 35 sx. Class C.
0430--0600 WOC to tag Plug #3.
8-7-01
0600--0630 TIH, Tag cmt plug at 858'.
0630--0700 LD Drill pipe to 569'.
0700--0730 Clear DP, Pump cement plug #4 from 569-469' w/35 sx.
0730--0800 LD Drill pipe to 50'.
0800--0830 Clear DP, Pump cement plug #5 from 50'--0' w/10 sx.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Consulting Engineer DATE August 30, 2001

Type or print name R. L. Hilbun Telephone No. (405) 232-8338

(This space for State use)

APPROVED BY _____ TITLE _____ DATE _____

Conditions of approval, if any: