

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0135
Expires November 30, 2000

1517

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

Oil Cons.
N.M. DIV-Dist. 2
301 W. Grand Avenue
Artesia, NM 88210

5. Lease Serial No.

6. Indian Allottee or Tribe Name

7. If Unit or C/A Agreement, Name and/or No.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Yates Petroleum Corporation

3a. Address

105 S. 4th Street - Artesia, NM 88210

3b. Phone No. (include area code)

505-748-1471

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1000' FSL and 1000' FWL

Section 34, T6S-R25E

8. Well Name and No.

Five Mile Draw LX
Federal Com #2

9. API Well No.

30-005-63401

10. Field and Pool, or Exploratory Area

Pecos Slope Abo

11. County or Parish, State

Chaves County, NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

☐ Notice of Intent

☐ Acidize

☐ Deepen

☐ Production (Start/Resume)

☐ Water Shut-Off

☒ Subsequent Report

☐ Alter Casing

☐ Fracture Treat

☐ Reclamation

☐ Well Integrity

☐ Final Abandonment Notice

☐ Casing Repair

☐ New Construction

☐ Recomplete

☒ Other

☐ Change Plans

☐ Plug and Abandon

☐ Temporarily Abandon

Set and cement

production casing

☐ Convert to Injection

☐ Plug Back

☐ Water Disposal

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operations results in a multiple completion or recompleation in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

8/16/01 - Reached TD of 5300' at 12:00 Noon.

Log well and sidewall cores. Logger's TD 5300'.

8/18/01 - Ran 124 joints (5303.77') casing set at 5300' as follows:

57 joints 4-1/2" 11.6# N-80 SB (4218.02')


67 joints 4-1/2" 11.6# N-80 MV (2885.75')

Regular guide shoe set at 5300'. Float collar set at 5257.93'. Bottom marker set at 4243.6'.

Cemented with 730 sxs Pecos Valley Lite + 4 pps D42 + 1 pps D44 + .2% D65 + .3% D167 + .2% D46 (yld 4.42 wt 13)

Plug down at 7:45 AM. Bumped plug to 1800 psi for 4 mins. Held OK.

Rig released at 12:00 Noon 8/18/01.

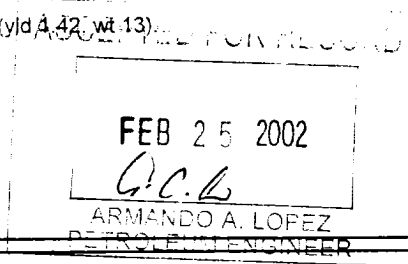

I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

Susan Herpin

Signature

Title

Engineering Technician

Date

12/2/01

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

RECEIVED
2002 FEB 14 AM 8:41
BUREAU OF LAND MGMT
POSTWELL OFFICE