

Drawer 33
Artesia, NMUNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

MAR - 1 1985

O. C. D.

ARTESIA, NM

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☐ other ☒ Dry Hole

2. NAME OF OPERATOR

Marshall R. Young Oil Co.

3. ADDRESS OF OPERATOR

P. O. Box 145, Midland, Texas 79702

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 660' FNL & 1980' FEL Sec. 11, T26S,
AT TOP PROD. INTERVAL: R-11W
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐☐
☐
☐
☐
☐
☐
☐
☐
☒

R/A (*See Reverse Side)

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

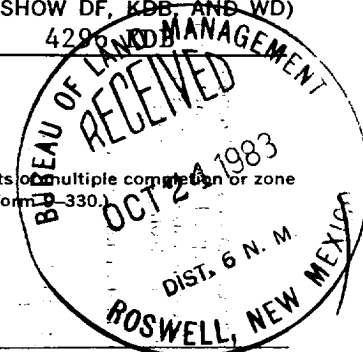

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Spudded well-17½" hole 7-16-83. Set 13 3/8" csg. 7-18-83 plug down @11:10 P.M. Cement circulated to surface. WOC 24 hrs., press. test csg. to 500#-OK, drilled out w/12¼" bit. Drill 12¼" hole to 4947'. Reached TD 12¼" hole 8-12-83. Ran open hole logs, ran 9 5/8" csg. with multi-stage tool @2450'. Circ. cement from 4947 csg. depth to 2450', circ. cement from 2450 to surface. Cement in place on 8-15-83. WOC 24 hrs. Install BOP's, chokes and manifold. Test to 3000#-OK. Drilled out w/8 3/4" bit, and drilled to Total Depth and ran open hole logs. Spotted 50 sxs open hole cement plug from 5210-5310. Plug in place 9-10-83. Spotted 100 sx cement plug from 4750-5030. Plug in place 9-10-83. Tagged cement plug top @4750'. Tested plug to 1000#-OK. Perforated 9 5/8" csg., 10 holes from 4270-80. Swab well dry. Acidized perms 4270-4280 w/1000 gals. 15% Ne. Swabbed dry-did not recover load water. Spotted 50 sxs "H" cement plug 4220-4330. Tagged top cement plug @4215'. Tested plug to 1000#-OK. Spotted 25 sxs "H" cement plug 0-50'. Plug in place 9-15-83. Cut off wellhead and welded ½" steel plate on top. Placed steel pipe marker on top of well. Well plugged and abandoned - no casing pulled.

18. I hereby certify that the foregoing is true and correct

SIGNED W. E. Montgomery TITLE District Mgr. DATE 10-14-83APPROVED BY PETER W. CHESTER (This space for Federal or State office use)
CONDITIONS OF APPROVAL

FEB 27 1985

BUREAU OF LAND MANAGEMENT
ROSWELL RESOURCE AREA

Instructions on Reverse Side

ACCEPTED FOR RECORD

OCT 31 1983

ROSWELL, NEW MEXICO

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

GPO : 1981 O - 347-166

- * 16. - Abandon Well - After reserve pits have dried out they will be leveled and road and location will be reseeded with required seed mixture. Notification to the BLM will be made when above work is commenced and completed.

Marshall R. Young Oil Co.
Bisbee Hills #1
Sec. 11, T-26-S, R-11-W
Luna County, New Mexico

Pertinent dates and details for work done on the above well:

- 7-11-83 - 10:00 A.M. Notified Mr. William Tipton of BLM @ Las Cruces, plans to Spud and Set 90' of 20".
- 7-15-83 - Notified Mr. Tipton of BLM that road and pits were completed and would spud 17½" hole.
- 7-19-83 - Notified Mr. Tipton of BLM - would be running 13 3/8" and gave him the depth and cementing program.
- 7-27-83 - Notified Mr. Tipton of BLM - preparing to run DST @2750'. Mr. Tipton was on location @6:00 A.M. 7-28-83.
- 7-31-83 - Notified Mr. Tipton of BLM @8:00 P.M. prior to running DST #2. Mr. Tipton was on location the morning of August 1, 1983.
- 8-15-83 - Notified Mr. Tipton of BLM and Mr. John Wade @Artesia, N.M., preparing to run 9 5/8" casing , gave the cement program and amount of pipe to them, was okayed by both and no one would be there to witness job.
- 8-17-83 - Notified Mr. Wade @Artesia that Yellow Jacket would test BOP's and he would receive a copy of the test from them.
- 8-19-83 - Notified Mr. Wade @Artesia and Mr. Tipton @Las Cruces that we would core @5020' - Mr. Tipton came out to location.
- 8-30-83 - Mr. Wade @ Artesia was notified @10:00 A.M. that Core #2 would be run @9:30 P.M.
- 9-8-83 - Notified Mr. John Wade about logging procedure and about running DST #3 (mis-run) and #4.
Notified Mr. Gildiman and Mr. Lopez @Roswell to check about plugging water wells, also notified Mr. Tipton about plugging water wells.
- 9-10-83 - Notified Mr. Wade's Department at Artesia, talked to Jimmy Ward about plug 5210-5310. Mr. Ward Witnessed testing plug after WOC 6 hrs.
- 9-15-83 - Telephoned Oil and Gas Division at Roswell to get plugging procedures @top - talked to Mr. Chester, no one came to witness plugs.
- 9-17-83 - Notified Mr. William Tipton of Las Cruces @2:00 P.M. - all plugs set, P & A, and rig released. He came to location @5:00 P.M. and checked all three water wells.