

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other P&A

2. Name of Operator

Harvey E. Yates Company

3. Address and Telephone No.

P.O. Box 1933, Roswell, N.M. 88202 505/623-6601

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit B, 990' FNL & 1980' FEL
Sec. 14, T26S, R12E

5. Lease Designation and Serial No.

NM-71526

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

19008

Bennett Ranch Unit

8. Well Name and No.

Bennett Ranch Unit #1

9. API Well No.

30-035-20027

10. Field and Pool, or Exploratory Area

Wildcat

11. County or Parish, State

Otero, N.M.

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*


6/18/97 Prepare to P&A
6/19/97 Shot 1/2" squeeze hole @ 953', FL @ 1400', SDFN
6/20/97 Pmp 100 sks Cl "C" w/4%/sk gel, 1/4#/sk celloflake + 4% CaCl w/LCM,
WOC 2 hrs, Tag @ 2220', Pmp 90 bbls 9# gel wtr, Circ hole
Spot 50 sk plug @ 960', Did not tag
Spot 50 sk plug @ 960', WOC 2 hrs
Tag @ 828', Circ 9# gel wtr
Spot 11 sk plug @ surface, cut off WH
Install dry hole marker

Part 50-2
7-11-97
Y4H

RECEIVED

JUN 24 97

BLM
ROSWELL, NM

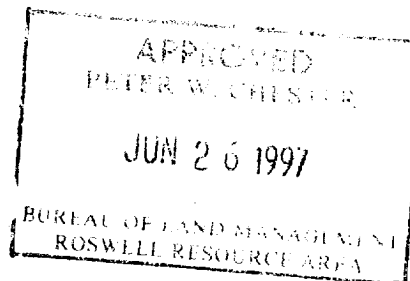

14. I hereby certify that the foregoing is true and correct

Signed Vickie Teel Vickie Teel

Title Production Analyst

Date 6/23/97

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

Date _____