

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC-055830

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

W.L.H.U. GRB #4 SD UT

8. FARM OR LEASE NAME

TRACT 7

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

LOCO HILLS (Q.G.SA)

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

SEC. 13-18-29 NMPM

12. COUNTY OR PARISH

EDDY

13. STATE

N.M.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back a well.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ WIW- TA

2. NAME OF OPERATOR

NEWMONT OIL COMPANY Yates Ref. Corp. O. C. D.

3. ADDRESS OF OPERATOR

207 S. 4th
P.O. BOX 1305.....ARTESIA, NEW MEXICO 88210

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

660' FNL 660' FEL Sec. 13-18-29

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3505'

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

The above well was plugged and abandon as follows:


12/18/82...Set bridge plug at 2490'. Spotted 25 sacks on plug, mudded up, perf base of salt at 1840'. Squeezed w/50 sacks cement. WOC.

12/21/82...Tagged plug at 1025'. Spotted 20 sacks on plug. Mudded up and perf top of salt @ 343' and squeezed 50 sacks cement @ 200# pressure. WOC

12/22/82...Tagged plug at 270'. Pressure tested casing, leaked. Squeezed w/70 sacks cement WOC.

12/23/82...Tagged plug at 80'. Pressured up to 1000#, okay. Set 15 sack cement plug and dry hole marker at surface.

Location ready for inspection

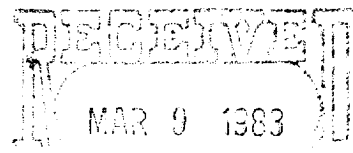

18. I hereby certify that the foregoing is true and correct.

SIGNED

TITLE

Area Manager

DATE 3/8/83

(This space for Regional or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

Post #0-2
4-1-83
YFA

