

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised March 25, 1999

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-03817
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. E-2359

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator  
Apache Corporation

3. Address of Operator  
2000 Post Oak Blvd., Ste 100, Houston, Texas 77056-4400

4. Well Location  
Unit Letter B : 660 feet from the North line and 1880 feet from the East line  
Section 1 Township 17S Range 36E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3,830' DF

7. Lease Name or Unit Agreement Name:  
State L "A"  
8. Well No.  
9  
9. Pool name or Wildcat  
Lovington Abo

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐  
OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

**See attached plugging activity report**

Approved as to plugging of the Well Bore.  
Liability under bond is retained until  
surface restoration is completed.

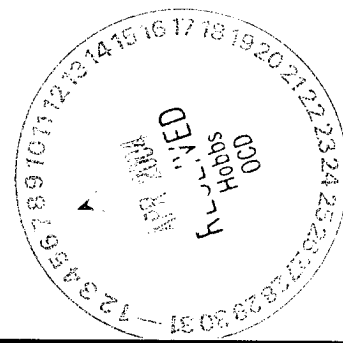

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE James F. Newman TITLE Engineer DATE APR 15 2004

Type or print name James F. Newman, P.E. Triple N Services, Inc.

Telephone No. 432-687-1994

(This space for State use)

APPROVED BY Hay W. Wink DATE APR 15 2004

Conditions of approval, if any

FIELD REPRESENTATIVE II/STAFF MANAGER

## Daily Activity Report

Apache Corporation  
State LA #9  
Lea County, New Mexico

Job #4387

**03/17/04** Notified OCD, Sylvia Dickey. MIRU Triple N rig #25 and plugging equipment. Killed well. ND wellhead. SDFN.

**03/18/04** ND wellhead, NU BOP. POOH w/ production tubing. RIH w/ gauge ring to 8,100', POOH. RIH w/ tbg-set CIBP to 8,050'. RU cementer, set CIBP @ 8,050', circulated hole w/ mud. SDFN.

**03/19/04** Notified OCD, Sylvia Dickey. Pumped 25 sx C cmt 8,050 – 7,803'. Pumped 25 sx C cmt 6,737 – 6,490'. Pumped 25 sx C cmt 4,565 - 4,348'. POOH w/ tbg. ND wellhead. Cut casing @ 3,791'. SD.

**03/22/04** Notified OCD, Sylvia Dickey. POOH w/ 5½" casing. RIH w/ tubing, loaded hole w/ mud, and pumped 50 sx C cmt w/ 2% CaCl<sub>2</sub> @ 3,850'. WOC 2 hrs and tagged cmt @ 3,758'. Pumped 50 sx C cmt 3,758 – 3,573'. SDFN.

**03/23/04** RIH w/ tubing, no tag. Pumped 35 sx C cmt 3,758 – 3,628'. WOC 2 hrs and tagged plug @ 3,758'. Pumped 25 sx C cmt 3,758 – 3,665'. Tagged cmt @ 3,672'. Pumped 35 sx C cmt 3,011 – 2,881'. Pumped 35 sx C cmt 2,049 – 1919'. Cut casing & pulled 8½" casing from 368'. SDFN.

**03/24/04** Pumped 115 sx C cmt w/ 2% CaCl<sub>2</sub> @ 403'. WOC 2 and tagged cmt @ 237'. Pumped 40 sx C cmt 60' to surface. RDMO.

**04/02/04** Cut off wellhead and anchors, capped well, installed marker, cleaned location.

Triple N Services, Inc.  
Jim Newman  
432.687.1994  
[jim@triplenservices.com](mailto:jim@triplenservices.com)