

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised June 10, 2003

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 3002511084
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name S. J. CARR
8. Well Number 5
9. OGRID Number 000962
10. Pool name or Wildcat Wildcat Tubb & Fowler Upper Yeso

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
Oil Well ☒ Gas Well ☐ Other

2. Name of Operator  
Arch Petroleum Inc.

3. Address of Operator  
P O Box 10340; Midland, Tx 79702-7340

4. Well Location

Unit Letter N : 555 feet from the South line and 2085 feet from the West line

Section 10 Township 24S Range 37E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3252

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: Add Tubb Perfs/Commingle w/ Yeso ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

08/01/03 POH w/ rods & pump  
08/04/03 POH w/ tbg. RIH & Set CIBP @ 6500' w/ 20' cmt - abandoning Abo pool. Test CIBP to 3000#.  
08/05/03 Perf Tubb @ 6006-23 w/ 2 spf. Acdz w/ 1000 gals 7.5% acid. Begin swabbing.  
08/08/03 Frac w/ 3100# 100 mesh + 52680# 20//40 Ottawa Followed by 27040# 20/40 SLC. Begin Swabbing.  
08/12/03 RIH w/ pkr & set @ 5901. RU swab & test Tubb.  
08/17/03 Begin producing/testing Tubb.  
08/20/03 Tubb Production: 13 BO, 2 BW, 18 MCF.  
08/21/03 POOH w/ pkr & LD. RIH w/ rods & pump.  
08/29/03 Test DHC Tubb & Yeso - 17 BO, 13 BW, 27 MCF.

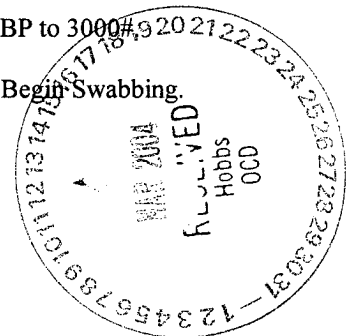

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Terri Stathem TITLE Sr. Production Analyst DATE 3-12-04

Type or print name Terri Stathem E-mail address: Telephone No. 432-685-8100  
(This space for State use)

APPROVED BY Robert E. Smith TITLE PETROLEUM ENGINEER DATE MAY 13 2004  
Conditions of approval, if any:

2A Fowler Abo N. <96574>