

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-25111
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	H. T. MATTERN NCT-C
8. Well No.	7
9. Pool Name or Wildcat	PENROSE SKELLY GRAYBURG
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3502' GL

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMITS" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH ROAD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>J</u> : <u>2130'</u> Feet From The <u>SOUTH</u> Line and <u>1980'</u> Feet From The <u>EAST</u> Line Section <u>18</u> Township <u>21-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3502' GL

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ADD PERFS, FRAC STIM & INSTL PMP ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-10-04: MIRU KEY #176. TIH TO 2508'.
5-11-04: TIH TO 4410'. PERF 3660-67, 3676-80, 3683-86, 3696-3702, 3710-13, 3720-24, 3728-32, 3737-40, 3748-53, 3758-62, 3766-68, 3778-82, 3786-90, 3796-98, 3803-09, 3824-27 (64' & 256 HOLES) TIH W/PKR.
5-12-04: ACIDIZE GRAYBURG PERFS 3660-3973 W/5600 GALS 15% ANTI-SLUDGE HCL. SET PKR @ 3653'. RU SWAB. 4 HR TEST.
5-13-04: SWABBING.
5-17-04: REL PKR. TIH W/FRAC PKR & SET @ 3539.
5-18-04: FRAC GRAYBURG PERFS 3660-3973 W/66,000 GALS YF130 & 138,000# 16/30 JORDAN SAND.
5-19-04: REL PKR @ 3539. TAG SAND BRIDGE @ 3950. TIH TO 4212.
5-20-04: RUN AFTER FRAC LOG. PU SUB PUMP & RIH TO 3660. RIG DOWN. TURN WELL OVER TO PRODUCTION.

FINAL REPORT

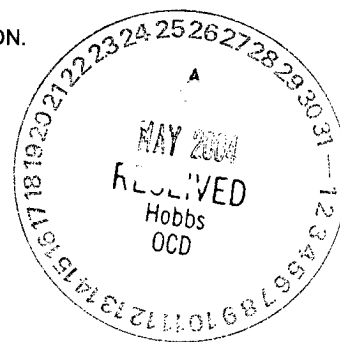

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Leake TITLE Regulatory Specialist DATE 5/24/2004
TYPE OR PRINT NAME Denise Leake Telephone No. 915-687-7375

(This space for State Use)

APPROVED: Ray W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER
CONDITIONS OF APPROVAL, IF ANY: DATE JUN 09 2004