

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
March 4, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-04593
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/> Injector		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Chevron USA Inc		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd, Midland, TX 79705		7. Lease Name or Unit Agreement Name Eunice Monument South Unit
4. Well Location Unit Letter <u>D</u> : <u>660</u> feet from the <u>North</u> line and <u>660</u> feet from the <u>West</u> line Section <u>10</u> Township <u>21-S</u> Range <u>36-E</u> NMPM <u>Lea</u> County		8. Well Number 277
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number
		10. Pool name or Wildcat Eunice Monument Grayburg San Andres

Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)

Pit Location: UL D Sect 10 Twp 21S Rng 36E Pit type Steel Depth to Groundwater 200 Distance from nearest fresh water well Over 1000'
Distance from nearest surface water 660 feet from the North line and 660 feet from the West line (Steel Tank)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Unable to set 4" CIBP, spot 25sx, plug from 3728-3400 (Grayburg San Andres) Tag at 3328.
2. Perf 4 hole at 2600, sqz 50sx from 2600-2400 (Yates, B-Salt) Tag at 2364.
3. Perf 4 hole at 1350, sqz 50sx from 1350-1150 (7 5/8 Shoe, T-Salt) Tag at 1170, re-spot 25sx from 1170-770.
4. Perf 4 holes at 320, Circ cmt from 320-Surf w/175sx 4 1/2 x 7 5/8 x 10 3/4 csg (10 3/4 Shoe) Tag at Surf.
5. Install dry hole marker 5-27-04.

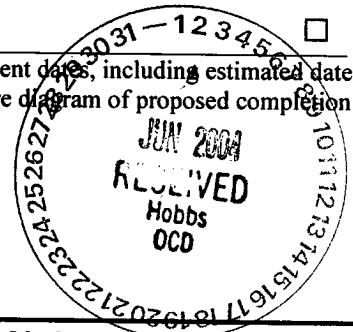

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Jimmy Bagley TITLE Field Supervisor DATE 5-27-04

Type or print name Jimmy Bagley E-mail address: _____ Telephone No. 432-561-8600

(This space for State use)

APPROVED BY Larry W. Wink TITLE _____ DATE JUN 08 2004

Conditions of approval, if any:

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.