

New Mexico Oil Conservation Division, District I
1625 N. French Drive
Hobbs, NM 88240

Form 3160-5
(September 2001)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0135
Expires January 31, 2004

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.	NMNM90900
6. If Indian, Allottee or Tribe Name	
7. If Unit or CA/Agreement, Name and/or No.	
8. Well Name and No.	LUCKY LIZARD FED #1
9. API Well No.	30-025-35886
10. Field and Pool, or Exploratory Area	NORTH YOUNG; WOLFCAMP
11. County or Parish, State	LEA COUNTY, NM

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well ☒ Oil Well ☐ Gas Well ☐ Other	3b. Phone No. (include area code) 505-748-3303
2. Name of Operator MARBOB ENERGY CORPORATION	
3a. Address PO BOX 227, ARTESIA, NM 88211	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 1650 FNL 990FEL SEC.6-T18S-R32E, UNIT H	

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


TYPE OF SUBMISSION	TYPE OF ACTION			
☒ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☐ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other
	☐ Change Plans	☒ Plug and Abandon	☐ Temporarily Abandon	
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

WELL NON-PRODUCTIVE. PLAN TO PLUG AS FOLLOWS:

1. CIBP @3600' (QUEEN SAND PERFS 3654-65')
2. 60 SX CLASS "C" +2% CaCl₂ (14.8 ppg, 1.32 cfps) 3600' to 3000'±
3. 50 SX CLASS "C: +2% CaCl₂ (14.8 ppg, 1.32 cfps) 450' to surface.
4. Cut off wellhead 3' below surface and install DH marker.
5. Remove equipment and relcaim road and location.

See attached before and after wellbore sketches for full wellbore description.

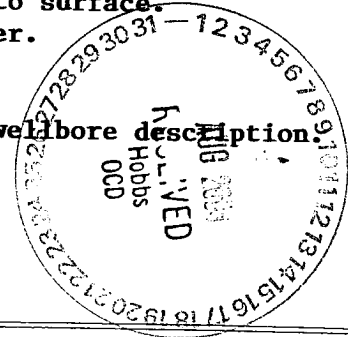

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

Caitrene Smith

Title **Production Analyst**

Signature

Date **8/5/04**

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by **(ORIG. SGD.) DAVID R. GLASS**

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on reverse)

BWW

**SEE ATTACHED FOR
CONDITIONS OF APPROVAL**

ell: Lucky Lizard Fed. 1

Zero: 17' AGL

KB : 3865'

GL : 3848'

Location: 1650'N, 990'E
H- 6-185-320
Leg NM

Casing Program:

Size	Wt.	Grade	Conn.	Depth
13 3/8"	48	H4D	SK	396'
8 5/8"	32	J55	BR	3200'
5 1/2"	17	M95-110	LTC	12858'
2 3/8	4.7	L80/N80	EVE	

Tops: Rustler 1010'
Yates 2452'
Queen 3623'
San Andres 4122'
Bone Spring 5370'
Wolfcamp 9483'
Strawn 11396'
Atoka 11686'
Morrow 12395'

AFTER

Wolfcamp

Mrow "A"

Morrow "A/B"

Morrow "C"

1st: 400 Super H (did not circulate...)

2nd: 1500 HLC + 200 Super H (circ 355x)

- Sketch Not To Scale -

KBCollins/22Aug02

13-782	500 SHEETS, FILLER	5 SQUARE
42-381	50 SHEETS EYE-EASE	5 SQUARE
42-382	100 SHEETS EYE-EASE	5 SQUARE
42-389	200 SHEETS EYE-EASE	5 SQUARE
42-392	200 RECYCLED WHITE	5 SQUARE
42-390	200 RECYCLED WHITE	5 SQUARE

12 1/4"

CIBP @ 3600'

CIBP + 35/amt 4400'

CIBP + C_{int} = 5300'

7718 11

CIBP + cont 5750'

CIBP + cont 7232'

C16P+35'cont 8750'

$$CIBP + 35'_{\text{amt}} + 9820'$$

C18P+35' out 212300'

C13P012473'

Marker J+ 11342'
(28')

CIBP+ cmt @ 12625

FC 12809'

17880

Zero: 11 TGL

Location: 1650'N, 990'E
H- 6-185-320
Leg NM

KB : 3865'

GL : 3848'

Casing Program:

Size	Wt.	Grade	Conn.	Depth
13 3/8"	48	H4D	SK	396'
8 9/8"	32	J95	BR	3200'
5 1/2"	17	M95-110	LK	12858'
2 3/8	4.7	L80/N80	EVE	

Tops: Rustler 1010'

Yates 2452'

Queen 3623'

San Andres 4122'


Bore Spring 5.370'

Wolfcamp 9483'

Strawn 11396'

Ataŋa 11686'

Movie 12395

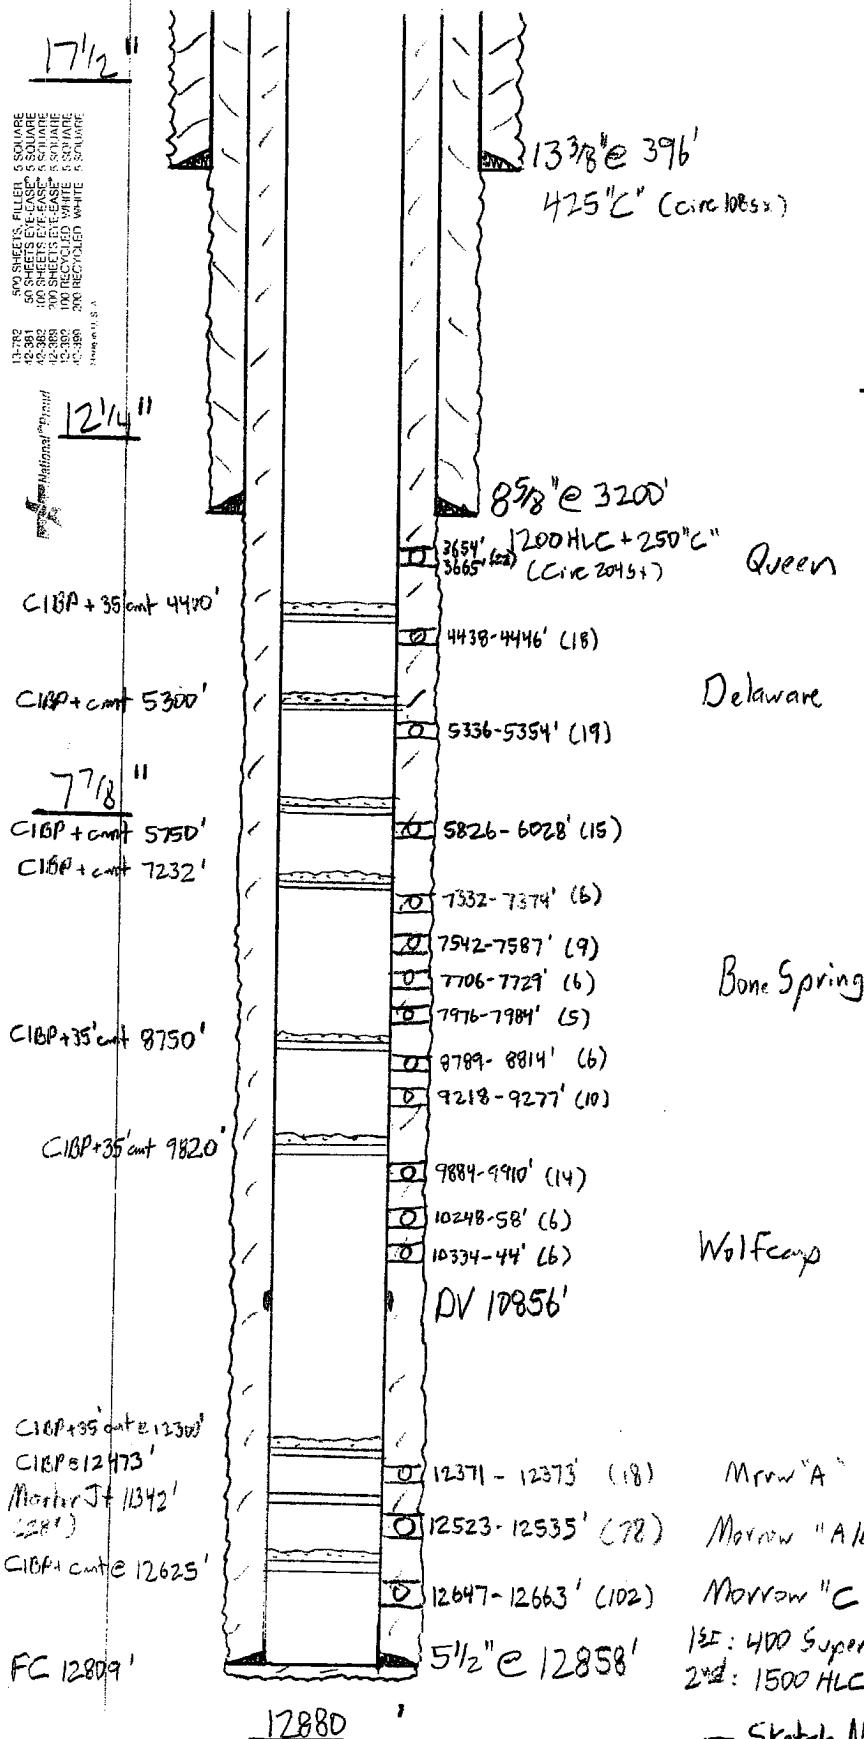

Wolfcamp

Mrw "A"

Monday "A/B"

Morrow "C"

15E: 400 Super H (did not circulate...)

2nd: 1500 HLC + 200 Super H (circ 355x)

— Sketch Not To Scale —

BEFORE

KBCollins / 22 Aug 12