

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-06838
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	EUNICE KING
8. Well No.	2
9. Pool Name or Wildcat	PENROSE SKELLY GRAYBURG
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3466' GL

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH RD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>D</u> : <u>660'</u> Feet From The <u>NORTH</u> Line and <u>660'</u> Feet From The <u>WEST</u> Line Section <u>28</u> Township <u>21-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3466' GL

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: FRAC GRAYBURG ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-18-05: MIRU. REL TAC. TIH W/2 7/8" PROD TBG. TAG CICR @ 3900. PUH TO 2626.  
2-22-05: SET PKR @ 3589. NU FRAC STACK.  
2-23-05: FRAC 3652-3876 W/66,000 GALS YF130 & SAND.  
2-24-05: RU SWAB.  
2-28-05: FLOW WELL TO TANK. TIH W/2.25 F PLUG. REL PKR. TIH W/2 7/8" PROD TBG.  
3-01-05: TIH W/PROD ROD STRING. CIRC PKR FLUID. LATCH ONTO PKR. PULL PRONG & PLUG FROM PROFILE NIPPLE.  
3-02-05: SWAB WELL. CONNECT WH TO FLOW LINE. FLOW WELL TO BATT ON 26/64 CHOKE. 120 PSI. REC 6 OIL, 30 WTR, & 384 MCF.  
RIG DOWN. TURN WELL OVER TO PRODUCTION.  
FINAL REPORT

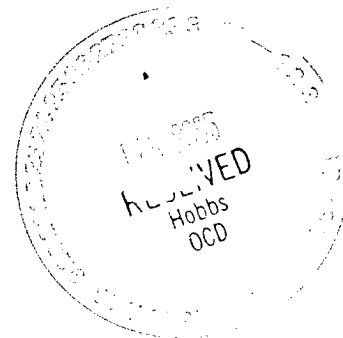

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist

DATE 3/22/2005

TYPE OR PRINT NAME Denise Pinkerton

Telephone No. 432-687-7375

(This space for State Use)

APPROVED Gary W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER  
CONDITIONS OF APPROVAL, IF ANY:

DATE

MAR 28 2005

DeSoto/Nichols 12-93 ver 1.0