

OCT 13 2011

RECEIVED

5. Lease Serial No.

NM 0175774

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.
PLAINS UNIT FEDERAL

8. Well Name and No
PLAINS UNIT #002

FEDERAL.

9 API Well No.

30-025-20040

10 Field and Pool, or Exploratory Area
LUSK; STRAWN

11. County or Parish, State

LEA COUNTY / NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION				
☒ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off	
☐ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity	
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other _____	
	☐ Change Plans	☒ Plug and Abandon	☐ Temporarily Abandon		
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal		

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomple horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recomple in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

PROPOSED PLUG AND ABANDONMENT PROCEDURE:

RECLAMATION PROCEDURE
ATTACHED

PROPOSED PLUG AND ABANDONMENT PROCEDURE:
All plugs 100' plus 10% per 1000' depth

- 1) TAG EXISTING CIBP @ +/-11,675'; MIX X PUMP A 25 SX. OMT. PLUG @ 11,675'-11,575'; CIRC. WELL W/ PXA MOD. 210'
- 2) SET 7" CIBP @ 11,350'; MIX X PUMP A 40 SX. OMT. PLUG @ 11,350'-11,190' (T/STRAWN). 210'
- 3) MIX X PUMP A 45 SX. OMT. PLUG @ 10,475'-10,295' (T/WC); ~~WOC X TAG TOP OF OMT. PLUG.~~ 210'
- 4) PERF. X ATTEMPT TO SQZ. A 70 SX. OMT. PLUG @ 7,990'-7,830' (7"CSG.LEAK). 180' WOC Tag
- 5) PERF. X ATTEMPT TO SQZ. A 70 SX. OMT. PLUG @ 7,290'-7,130' (T/BONE SPRINGS); WOC X TAG TOP OF OMT. PLUG.
- 6) CUT X PULL 7" CSG. @ +/-4,597'. 4672'
- 7) MIX X PUMP A 90 SX. OMT. PLUG @ 4,720'-4,540' (T/DILWR., 7"CSG. CUT X 9-5/8"CSG. SHOE); WOC X TAG OMT. PLUG @
- 8) MIX X PUMP A 50 SX. OMT. PLUG @ 2,985'-2,865' (9-5/8" DV TOOL). 130' WOC Tag 4522
- 9) MIX X PUMP A 130 SX. OMT. PLUG @ 970'-660' (T/SALT, T/ANHY & 13-3/8"CSG. SHOE); WOC X TAG OMT. PLUG.
- 10) MIX X CIRC. TO SURF. A 25 SX. OMT. PLUG @ 63'-3'.
- 11) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD ON STEEL PLATE TO CASINGS X INSTALL DRY HOLE MARKER.

* Add 120' plug 2660-2540' (Base Salt / Top / total) WOC Tang.

* Ground Level D.H.M

14 I hereby certify that the foregoing is true and correct
Name (Printed/Typed) _____

DAVID A. EYLER

Title

AGENT

Date 08/23/11

SEE ATTACHED FOR
CONDITIONS OF APPROVAL

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by _____

Title

Date _____

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations, or to any matter within its jurisdiction.

WELLSBORE SCHEMATIC AND HISTORY

COMPLETION SCHEMATIC		LEASE NAME: Plains Federal Unit		Well # 2		API # 30-025-20040		LEASE # 309563-016																																																										
		TYPE COMPLETION: ☒ SINGLE ☐ DUAL ☐																																																																
		LOCATION: Unit E, 1980' FNL & 660' FWL, Sec 28, T19S R32E, Lea County, NM																																																																
		TD 12,996'		PBD 11,500'		KB																																																												
		COD		DOD		GL																																																												
		NO. PROD. WELLS ON LEASE				FLOWING		PUMPING																																																										
		ZONE TO BE WORKED ON:						CURRENT COMPLETION ZONE:																																																										
		CSG. PERFS: 11381-400' 11432-38' 11440-48' 11456-66' 11492-96'						Strawn																																																										
		11501-09' 11522-28' 12403-12' 12480-91' 12494-500' 12504-16' 12519-30'						OPEN HOLE:																																																										
		CURRENT TEST (SHOW DATE)																																																																
						GAS		OIL																																																										
				GAS		OIL																																																												
CASING BREAKDOWN																																																																		
SURF. 17 1/2" hole		SIZE: 13 3/8" 48#		w/750 sx, TOC surf		DEPTH		749' - 773'																																																										
INTER. 12 1/4" hole		SIZE: 9 5/8" 40#		w/4400sx, TOC surf		DEPTH		4597'																																																										
PROD. 8 3/4" hole		SIZE: 7" 23-26#		w/750 sx, TOC ?		DEPTH		12765'																																																										
Tbg & rod detail from 3/19/10 report <table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th>Tbg Detail</th> <th>Length</th> <th>Depth</th> </tr> </thead> <tbody> <tr><td>KB</td><td>19</td><td>19</td></tr> <tr><td>383 Jts Tbg 2-3/8" L80</td><td>11220.32</td><td>11239.32</td></tr> <tr><td>2-3/8" x 7" TAC</td><td>3 83</td><td>11243 15</td></tr> <tr><td>10 Jts Tbg 2-3/8"</td><td>294 47</td><td>11537 62</td></tr> <tr><td>Mechanical SN</td><td>0 8</td><td>11538 42</td></tr> <tr><td>4" Perf Sub 2-3/8"</td><td>4 1</td><td>11542 52</td></tr> <tr><td>MJBP 2-3/8"</td><td>29 63</td><td>11572.15</td></tr> <tr><td>Total</td><td>11572</td><td></td></tr> </tbody> </table> <table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th>Rod Detail</th> <th>Count</th> <th>Length</th> </tr> </thead> <tbody> <tr><td>1 1/4" PRL</td><td>1</td><td>16</td></tr> <tr><td>1 1/2" PR</td><td>1</td><td>22</td></tr> <tr><td>7/8" x 4', 6', 8' Pony Rods</td><td>3</td><td>16</td></tr> <tr><td>7/8" Rods</td><td>218</td><td>5450</td></tr> <tr><td>3/4" Rods</td><td>232</td><td>5800</td></tr> <tr><td>1 1/2" K-Bars</td><td>10</td><td>250</td></tr> <tr><td>RH release</td><td>1</td><td>1</td></tr> <tr><td>1" x 1' guided lift sub</td><td>1</td><td>1</td></tr> <tr><td>20x125x20" RHBC</td><td>1</td><td>20</td></tr> </tbody> </table>										Tbg Detail	Length	Depth	KB	19	19	383 Jts Tbg 2-3/8" L80	11220.32	11239.32	2-3/8" x 7" TAC	3 83	11243 15	10 Jts Tbg 2-3/8"	294 47	11537 62	Mechanical SN	0 8	11538 42	4" Perf Sub 2-3/8"	4 1	11542 52	MJBP 2-3/8"	29 63	11572.15	Total	11572		Rod Detail	Count	Length	1 1/4" PRL	1	16	1 1/2" PR	1	22	7/8" x 4', 6', 8' Pony Rods	3	16	7/8" Rods	218	5450	3/4" Rods	232	5800	1 1/2" K-Bars	10	250	RH release	1	1	1" x 1' guided lift sub	1	1	20x125x20" RHBC	1	20
Tbg Detail	Length	Depth																																																																
KB	19	19																																																																
383 Jts Tbg 2-3/8" L80	11220.32	11239.32																																																																
2-3/8" x 7" TAC	3 83	11243 15																																																																
10 Jts Tbg 2-3/8"	294 47	11537 62																																																																
Mechanical SN	0 8	11538 42																																																																
4" Perf Sub 2-3/8"	4 1	11542 52																																																																
MJBP 2-3/8"	29 63	11572.15																																																																
Total	11572																																																																	
Rod Detail	Count	Length																																																																
1 1/4" PRL	1	16																																																																
1 1/2" PR	1	22																																																																
7/8" x 4', 6', 8' Pony Rods	3	16																																																																
7/8" Rods	218	5450																																																																
3/4" Rods	232	5800																																																																
1 1/2" K-Bars	10	250																																																																
RH release	1	1																																																																
1" x 1' guided lift sub	1	1																																																																
20x125x20" RHBC	1	20																																																																
Casing Leak SQZ'D 100 Sxs Class H 7893-7924' TOC >9950' "no cmt @ 9950" STRAWN PERFS: <table border="0" style="width:100%;"> <tr> <td>11381-400'</td> <td>1 SPF</td> </tr> <tr> <td>11432-38'</td> <td></td> </tr> <tr> <td>11440-48'</td> <td>2 SPF</td> </tr> <tr> <td>11456-66'</td> <td></td> </tr> <tr> <td>11492-96'</td> <td>4 SPF</td> </tr> <tr> <td>11501-09'</td> <td></td> </tr> <tr> <td>11522-28'</td> <td>4 SPF</td> </tr> </table> CIBP 11675' MODEL D PKR W/ 2 JTS MORROW PERFS: <table border="0" style="width:100%;"> <tr> <td>12403-12'</td> <td></td> </tr> <tr> <td>12480-91'</td> <td></td> </tr> <tr> <td>12494-500'</td> <td>2 PSF</td> </tr> <tr> <td>12504-16'</td> <td></td> </tr> <tr> <td>12519-30'</td> <td></td> </tr> </table> 7" 23-26# w/750 sx, TOC ? 12,996' TD										11381-400'	1 SPF	11432-38'		11440-48'	2 SPF	11456-66'		11492-96'	4 SPF	11501-09'		11522-28'	4 SPF	12403-12'		12480-91'		12494-500'	2 PSF	12504-16'		12519-30'																																		
11381-400'	1 SPF																																																																	
11432-38'																																																																		
11440-48'	2 SPF																																																																	
11456-66'																																																																		
11492-96'	4 SPF																																																																	
11501-09'																																																																		
11522-28'	4 SPF																																																																	
12403-12'																																																																		
12480-91'																																																																		
12494-500'	2 PSF																																																																	
12504-16'																																																																		
12519-30'																																																																		
PREPARED BY: Laci Luig				CREATED: 11/8/2007		UPDATED: JDP 6/15/2010																																																												

PLUGGING & ABANDONMENT WORKSHEET

(3 STRING CSNG)

30-025-20040

OPERATOR CIMAREX ENERGY Co. of Co.
LEASENAME PLAINS UNIT FEDERAL

SECT 28 TWN 19S RNG 32E
FROM 1980 (N)SL 660 EWL
TD: 12,996 FORMATION @ TD MORROW
PBDT: 11,675 FORMATION @ PBDT

WELL # 002

RNG 32E

EWL 660

FORMATION @ TD MORROW


FORMATION @ PBDT

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	13 3/8	713'	SURF.	CIRC. 773
INTMED 1	9 5/8	4597'	SURF.	CIRC.
INTMED 2				
PROD	7"	12765'	9,950'	CAC.
	SIZE	TOP	BOT	TOC DETERMINED BY
LINER 1				
LINER 2				
	CUT & PULL @		TOP - BOTTOM	
INTMED 1		PERFS	11381' - 11528'	
INTMED 2		OPENHOLE	-	
PROD				

* REQUIRED PLUGS DISTRICT I

RUSTLER (ANHYD)	930'	*
YATES		
QUEEN		
GRAYBURG		
SAN ANDRES		
SALT	920'	*
CAPITAN REEF		
DELAWARE	4655'	
BELL CANYON		
CHERRY CANYON		
BRUSHY CANYON		
BONE SPRING	7210'	
GLORIETA		*
BLINEBRY		
TUBB		
DRINKARD		
ABO		
WC	10385'	
PENN		
STRAWN	11307'	
ATOKA		
MORROW	12026'	
BOSS		
DEVONIAN		

PLUG	TYPE	SACKS	DEPTH
PLUG	PLUG	CMNT	
EXAMPLES			
PLUG #1	OH	25 SXS	9850'
PLUG #2	SHOE	50 SXS	8700'-8800'
PLUG #3	CIBP/35'		5300'
PLUG #3	CIBP	25 SXS	5300'
PLUG #4	STUB	50 SXS	4600'-4700'
PLUG #6	RETNR SQZ	200 SXS	400
PLUG #7	SURF	10 SXS	0-10'
PLUG #1			
PLUG #2			
PLUG #3			
PLUG #4			
PLUG #5			
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			

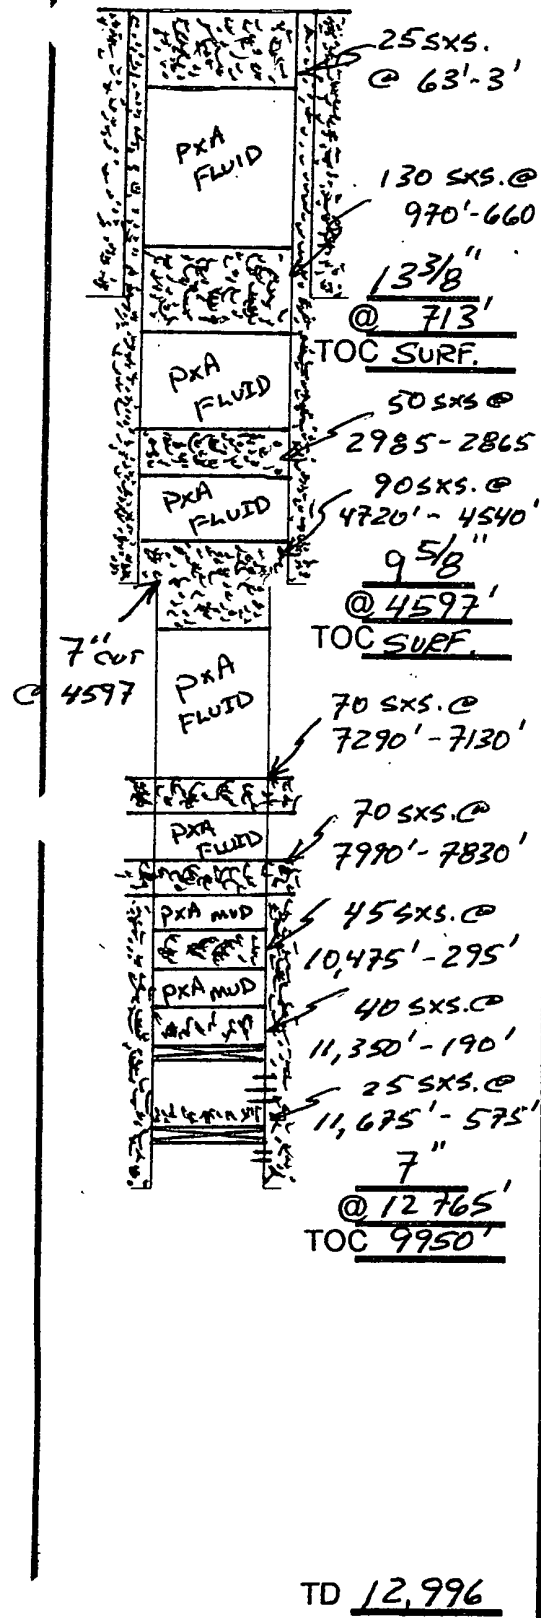

DAS 08/24/11

BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972

HOBBS OCD

OCT 13 2011

Permanent Abandonment of Federal Wells
Conditions of Approval

RECEIVED

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

J. Amos 3/6/11

Requirements for ground level dry hole markers
Well Identification Markers
Conditions of Approval (COA)

The BLM Carlsbad Field Office (CFO) Conditions of Approval (COA) Requires that ground level dry hole markers be placed on well within the Lesser Prairie Chicken habitat area. The dry hole markers will be to the following specifications. The operator will construct the markers as follows:

1. An 8 inch X 8 inch steel plate 1/8 to 3/16 of an inch thick is to be placed on the old dry hole marker stand pipe 2 inches from ground level, in the Lesser Prairie Chicken habitat area.
2. Steel plate may be welded or bolted approximately 2 inches from ground level on the stand pipes. If plates are bolted to the stand pipe, the person installing the plate will be required to weld a pipe collar on the plate and place a minimum of two set screws/bolt on each collar. Aluminum data plates may be bolted with minimum 1/4 inch bolt and locking nuts or self tapping fine threaded screws. A minimum of one in each corner is to be installed on each plate.
3. An 8 inch x 8 inch aluminum plate, which is 12 gauge or .080 sign material (1/8 inch aluminum plate may be used in place of the .080 plate) with the required information for that well stamped or engraved in a minimum 3/8 inch tall letter or number.
4. The following information will be stamped or engraved on the 8 inch X 8 inch aluminum plate in the following order.
 - a. First row: Operators name
 - b. Second row: Well name and number
 - c. Third row: Legal location to include 1/4 1/4, Section, Township, and range. If the legal location cannot be placed on one row it can be split into two rows with the 1/4 1/4 (example: 1980 FNL 1980 FWL) being on the top row.
 - d. Fourth row: Lease Number and API number.
 - i. Example marker plate: (attached)

NMOCD Order No. R-12965 also required the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a ground level dry hole marker was installed as required in the COA's from the BLM.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office
620 E. Greene St
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Environmental Protection Specialist
575-234-5909, 575-361-2648 (Cell)

Cody Layton
Natural Resource Specialist
575-234-5959

Terry Gregston
Environmental Protection Specialist
575-234-5958

Trishia Bad Bear
Natural Resource Specialist
575-393-3612

Bobby Ballard
Environmental Protection Specialist
575-234-2230

Todd Suter
Surface Protection Specialist
575-234-5987

Randy Rust
Environmental Protection Specialist
575-234-5943

Doug Hoag
Civil Engineering Technician
575-234-5979

Linda Denniston
Environmental Protection Specialist
575-234-5974

Jennifer Van Curen
Environmental Protection Specialist
575-234-5905

Justin Frye
Environmental Protection Specialist
575-234-5922