

Submit 1 Copy To Appropriate District
Office
District I - (575) 393-6161
1625 N French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87401
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-01294
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. E-1388
7. Lease Name or Unit Agreement Name Vickers State
8. Well Number 1
9. OGRID Number 16696
10. Pool name or Wildcat Maljamar GBSH
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4203' GR

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator OXY USA Inc.	
3. Address of Operator P.O. Box 50250 Midland, TX 79710	
4. Well Location Unit Letter <u>M</u> : <u>330</u> feet from the <u>south</u> line and <u>330</u> feet from the <u>west</u> line Section <u>4</u> Township <u>17S</u> Range <u>33E</u> NMPM County <u>Lea</u>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4203' GR	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

TD-4550' PBDT-4300' Perfs-4348-4400' CIBP-4300'

13-3/8" 48# csg @ 329' w/ 325sx, 17" hole, TOC-Surf-Circ

5-1/2" 14-15.5# csg @ 4550' w/ 150sx, 6-1/4" hole, TOC-2753'-Calc

1. RIH & tag CIBP @ 4300' M&P 25sx cmt to 4125'

2. Perf @ 2715', sqz 45sx cmt to 2585' WOC-Tag

3. Perf @ 1480', sqz 40sx cmt to 1365' WOC-Tag

4. Perf @ 379', sqz 300sx cmt to surface

10# MLF between plugs

Spud Date:

Rig:

The Oil Conservation Division Must be notified
24 hours prior to the beginning of plugging operations.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE David Stewart TITLE Regulatory Advisor DATE 10/12/11

Type or print name David Stewart E-mail address: david_stewart@oxy.com PHONE: 432-685-5717

For State Use Only

APPROVED BY [Signature] TITLE State Reg DATE 10-14-2011

Conditions of Approval (if any):

OCT 18 2011

OXY USA Inc. - Current
Vickers State #1
API No. 30-025-01294

17" hole @ 329'
13-3/8" csg @ 329'
w/ 325sx-TOC-Surf-Circ

3/04-CIBP @ 4300'

6-1/4" hole @ 4550'
5-1/2" csg @ 4550'
w/ 150sx-TOC-2753'-Calc

Perfs @ 4348-4400'

TD-4550'

OXY USA Inc. - Proposed
Vickers State #1
API No. 30-025-01294


300sx @ 379'-Surface

40sx @ 1480-1365' WOC-Tag

45sx @ 2715-2585' WOC-Tag

25sx @ 4300-4125'

3/04-CIBP @ 4300'

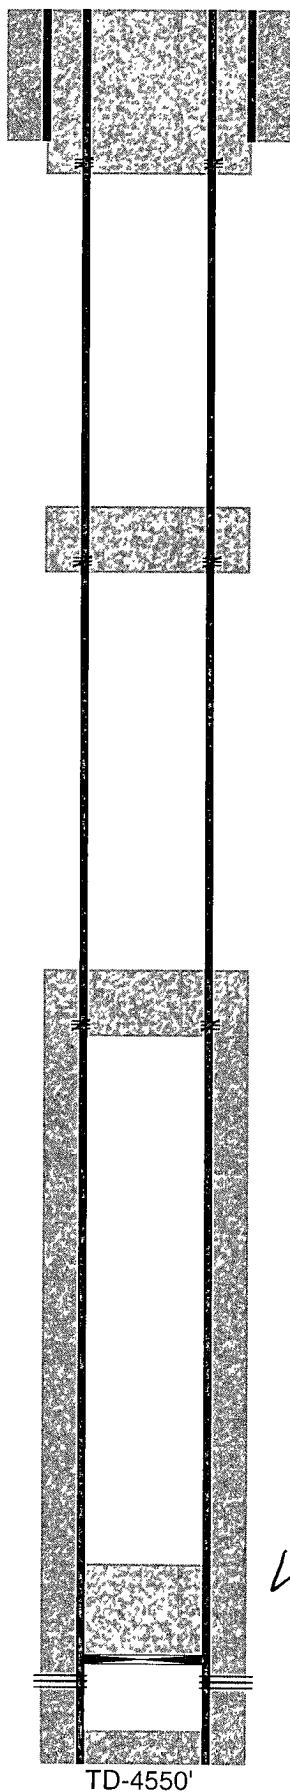

17" hole @ 329'
13-3/8" csg @ 329'
w/ 325sx-TOC-Surf-Circ

Perf @ 379'

Perf @ 1480'

Perf @ 2715'

Perfs @ 4348-4400'

6-1/4" hole @ 4550'
5-1/2" csg @ 4550'
w/ 150sx-TOC-2753'-Calc

TD-4550'