Form 3160-5 (April 2004)

## **UNITED STATES** DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

HOBBS OCD

FORM APPROVED OMB NO. 1004-0137 Expires March 31, 2007

6. If Indian, Allottee or Tribe Name

5. Lease Serial No.

LC 032099B


SUNDRY NOTICES AND REPORTS ON WELLS		
SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an	21	201

abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side EVED		7. If Unit or C	A/Agreement, Name and/or No		
1. Type of Well  X Oil Well Gas Well Other				8. Well Name	and No.
2. Name of Operator XTO Energy Inc.	1	, , , , , , , , , , , , , , , , , , , ,		South Unit	: #429
3a. Address 200 N. Loraine, Ste. 800 Midland,		3b. Phone No. ( <i>include at</i> 432-620-6741	rea code)	30-025-04634  10. Field and Pool, or Exploratory Area	
4. Location of Well (Footage, Sec., T., R., M., or Survey I Unit M 660' FSL & 660' FWL Sec. 14, T21S, R36E  12. CHECK APPROPRIATE		NCATE MATURE OF	NOTICE DED	11. County or Lea	NM
TYPE OF SUBMISSION	DON(EG) TO INE		PE OF ACTION	OK1, OK OTI	HER DATA
X Notice of Intent  Subsequent Report  Final Abandonment Notice	Acidize  Alter Casing  Casing Repair  Change Plans  Convert to Injection		Reclamatic Recomplet Temporanl Water Disp	e y Abandon oosal	Water Shut-Off Well Integrity Other
13. Describe Proposed or Completed Operation (clearly If the proposal is to deepen directionally or recomp	y state all pertinent detai	ls, including estimated starti	ing date of any pro	posed work and	approximate duration thereof.

- Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)
  - MIRU PU. POOH & LD equipment. ND WH. NU BOP.
  - PU & RIH w/CIBP on 2 7/8" tbg. to 3650'. Set CIBP @ 3650'. PUH to 3645'. L&T 5 1/2" prod. csg. w/brine test CIBP. 2.
  - 3. MIRU cmt. Co. Circ. 5 1/2", prod. csg. w/9ppg mud (min. 90 bbls).
  - Spot balance cmt. Plug (25 sx) f/CIBP (3650') to 3500'. PUH to 2800' & rev. circ. tbg. clean w/plug mud. WOC for 4 hrs. RIH & tag TOC. PUH to 1490'.
  - Spot balance cmt. Plug (25 sx) f/1490' to 1340'. PUH to 700' & rev. circ. tbg clean with plug mud. WOC for 4 hrs. RIH 5. & tag TOC. PUH to 370'
  - Circ. cmt. plug (min. 70 sx) f/370' to surface.
  - RD cmt. Co. RDMO PU. Cut off WH & anchors, install dry hole marker, reseed and reclaim location.

<ol> <li>I hereby certify that the foregoing is true and correct Name (Printed/Typed)</li> </ol>	Title				
Sharon Hindman	Regulatory Ana	Regulatory Analyst			
Sharon Vindma	Date 10/20/2011	_			
THIS SPACE FOR FE	EDERAL OR STATE OFFICE USE				
Approved by	Title	Date			
Conditions of approval, if any, are attached. Approval of this notice does not certify that the applicant holds legal or equitable title to those rights in the swhich would entitle the applicant to conduct operations the	warrant or Office ubject lease				
Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a cri	ime for any parcer leading to 1 15.11				

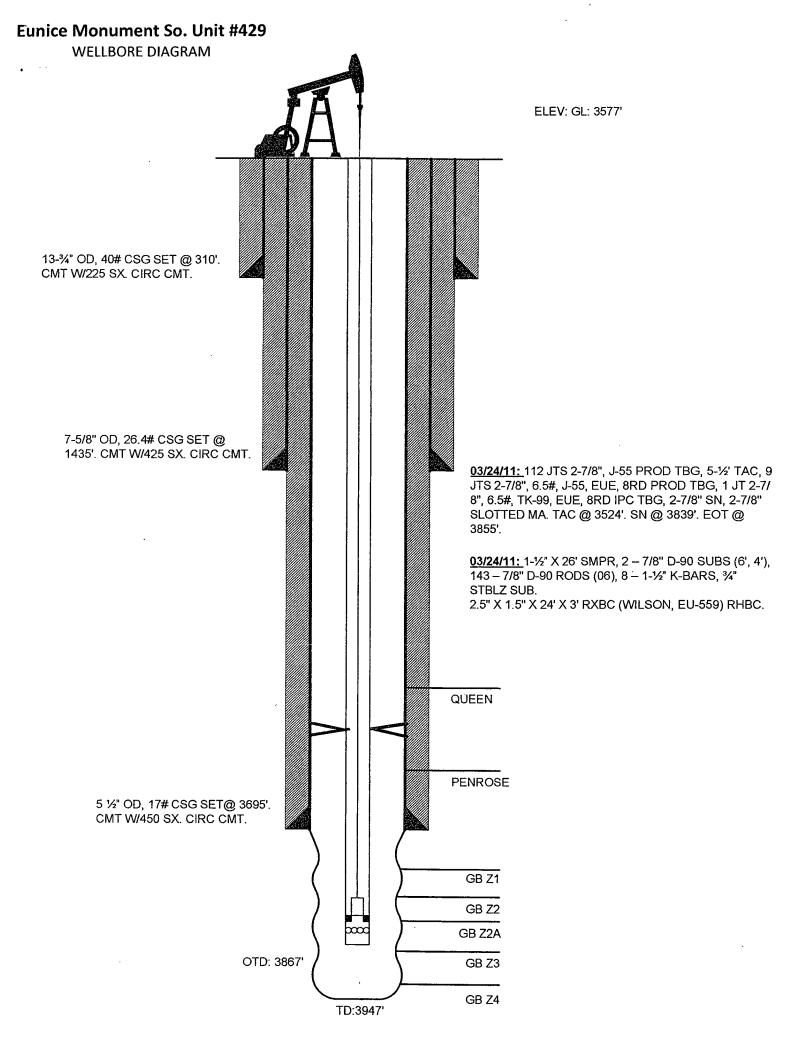

## **Eunice Monument So. Unit #429**

WELLBORE DIAGRAM

ELEV: GL: 3577'

