

Submit 3 Copies To Appropriate District
Office
District I
1625 N French Dr, Hobbs, NM 87240
District II
1301 W Grand Ave, Artesia, NM 88210
District III
1000 Rio Brazos Rd, Aztec, NM 87410
District IV
1220 S. St. Francis Dr, Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
June 19, 2008

HOBBS OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

NOV 18 2011

WELL API NO. 30-025-29601
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
8. Well Number 338 WIW
9. OGRID Number 005380
10. Pool name or Wildcat Eunice Monument; Grayburg-San Andres
11. Elevation (Show whether DR, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injection	7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
2. Name of Operator XTO Energy, Inc.	8. Well Number 338 WIW
3. Address of Operator 200 N. Loraine, Ste. 800 Midland, TX 79701	9. OGRID Number 005380
4. Well Location Unit Letter P ; 560' feet from the South line and 560' feet from the East line Section 8 Township 21S Range 36E NMPM County Lea	10. Pool name or Wildcat Eunice Monument; Grayburg-San Andres
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- MIRU PU, RIH w/2 3/8" notched collar on WS to CIBP @ 3722', circ w/9ppg mud (min 90 bbls).
- Spot balanced cmt plug (25 sx) from 3722 - 3570', WOC 4 hrs, tag TOC @ 3570'. **@ 2850' WOC TAG**
- Spot balanced cmt plug (25 sx) from ~~2730 - 2580'~~ WOC 4 hrs, tag TOC @ 2580'. **3B.) SPOT 25 SX**
- ND BOP. NU WH spot balanced cmt plug (60 sx) from 410 - Surface, WOC 4 hrs. **@ 1500'**
- RDMO PU, cut off WH & anchors, install dry hole marker, reseed and reclaim location. **(T. SALT)**

Spud Date:

The Oil Conservation Division Must be notified
24 hours prior to the beginning of plugging operations.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Sharon Hindman TITLE Regulatory Analyst DATE 11/17/2011


Type or print name Sharon Hindman E-mail address: sharon_hindman@xtoenergy.com PHONE 432-620-6741

For State Use Only
APPROVED BY Mark Whitaker TITLE Compliance Officer DATE 11-18-2011

Conditions of Approval (if any):

EUNICE MONUMENT SO. UNIT #338

WELLBORE DIAGRAM

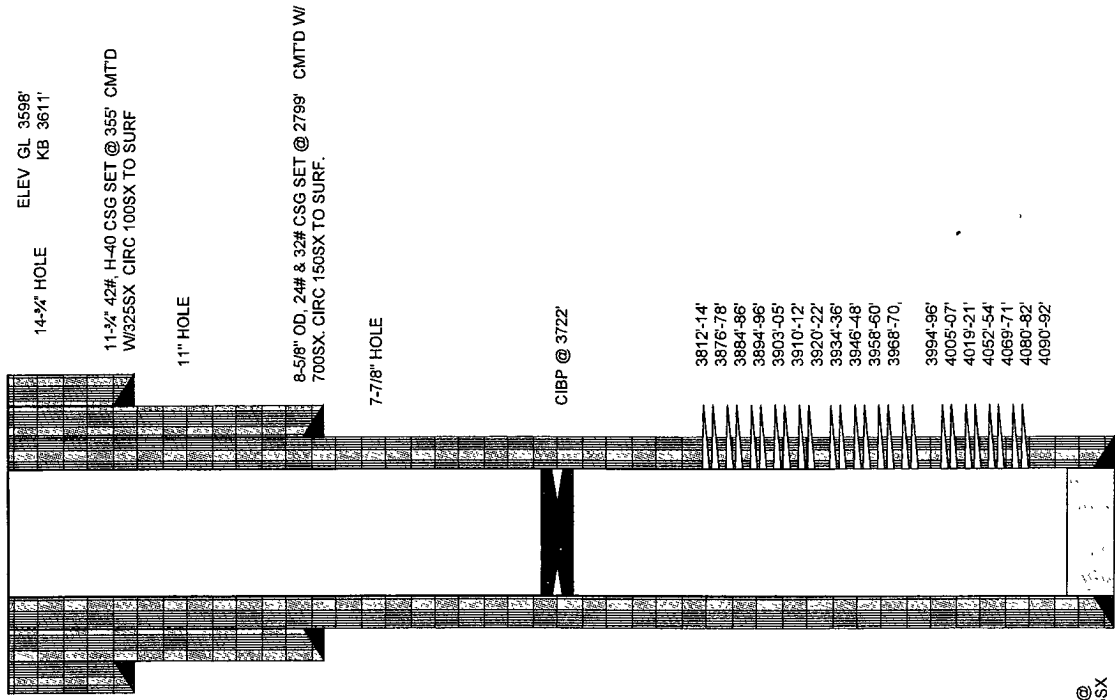

PBTD 4240'
TD. 4250'

EUNICE MONUMENT SO. UNIT #338

WELLBORE DIAGRAM

