

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised August 1, 2011

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)		WELL API NO. 30-025-03784
1. Type of Well: Oil Well ☐ Gas Well ☒ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Vanguard Permian, LLC		6. State Oil & Gas Lease No. 685368
3. Address of Operator 5847 San Felipe, Ste 3000 Houston Tx 77057		7. Lease Name or Unit Agreement Name Skelly State
4. Well Location Unit Letter 0 : 330 feet from the South line and 1,650 feet from the East line Section 36 Township 16S Range 36E NMPM County		8. Well Number 4
11. Elevation (Show whether DR, RKB, RT, GR, etc) 3,825' GR		9. OGRID Number 258350
		10. Pool name or Wildcat Lovington Abo

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1) MIRU Plugging Contractor. TOH w/ prod equipment. Fill casing w/ mud.
2) RWL Co. Add 35' of cmt on CIBP @ 4370'. Set CIBP @ 3,830' and cap w/ 35' of cmt. Cut 5 1/2" casing at ± 3,000'.
3) TOH & lay down 5 1/2" casing. TOH w/ workstring to 3,393' & spot 130x plug fr/ 3,393' to 2900'. WOC & tag plug.
4) Spot plug fr/ 2000' - 2200', 60x. Spot plug fr/ 215' - 315', 30x. WOC & tag plug. Spot plug fr/ 0 - 100', 30x.
5) Cutoff well heads, install P & A marker. Restore location.

Spud Date:

The Oil Conservation Division Must be notified
24 hours prior to the beginning of plugging operations.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *C.M. Bloodworth* TITLE Consulting Engineer DATE 02/13/12


Type or print name C.M. Bloodworth P.E. E-mail address: mbloodworth@VNRILC.com PHONE: 932-362-2209
For State Use Only

APPROVED BY: *[Signature]* TITLE Staff MGR DATE 2-15-2012
Conditions of Approval (if any)

LEASE/WELL: SKELLY Q STATE No. 4
 LOCATION 330' FSL & 1,650' FEL
 UL O, SEC 36, T16S, R36E
 CO/ST: LEA CO., NM
 API NO. 30-025-03784
 FIELD: LOVINGTON (QUEEN)

DF 3,838'
 GR 3,825'
 CORR 10'

SPUDDED 2/27/1952
 COMPLETED 4/23/1952

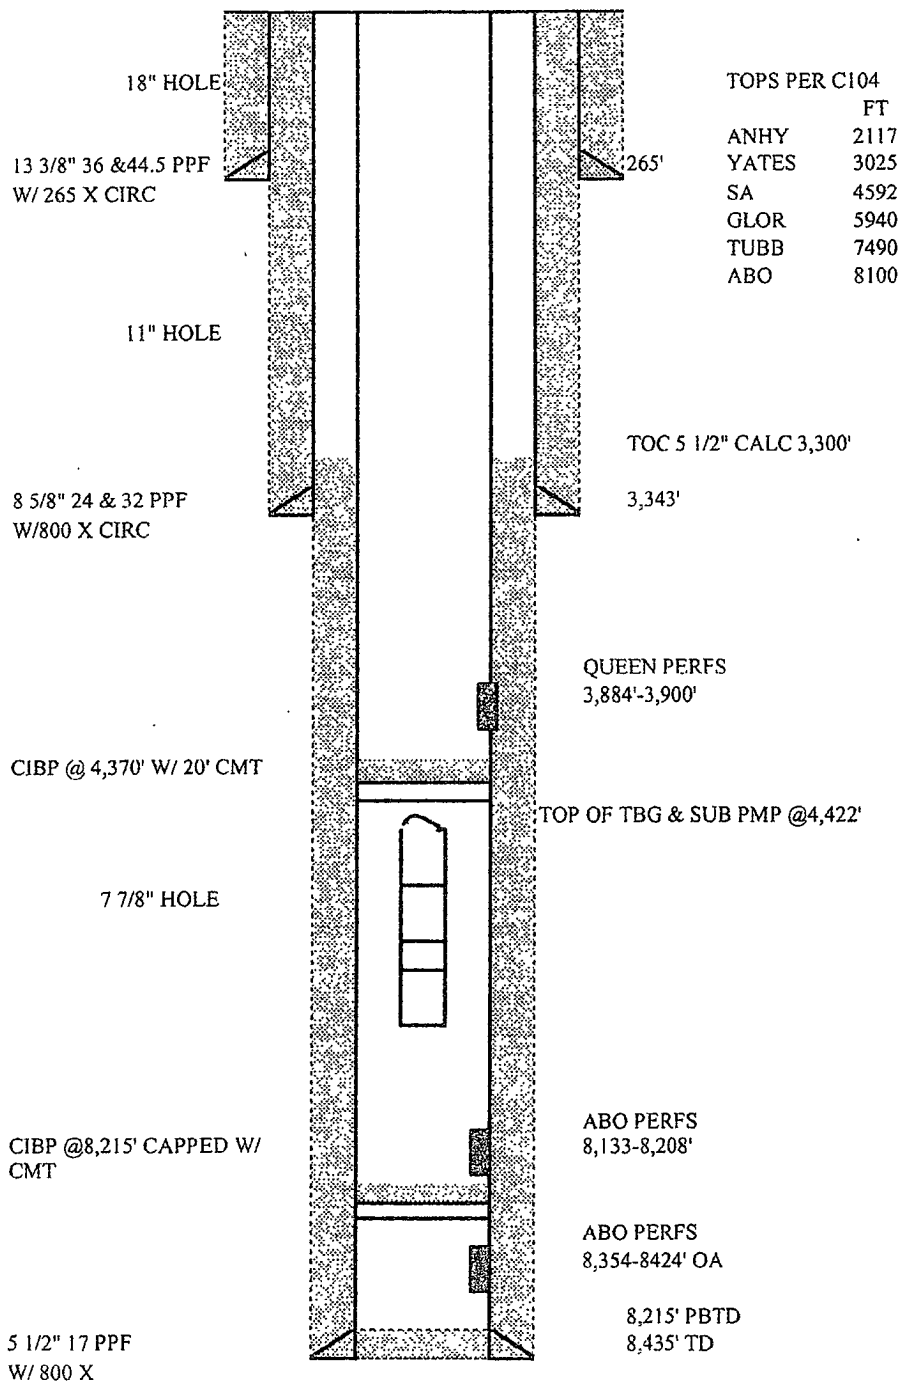


CURRENT

CMB 02/01/12

LEASE/WELL: SKELLY Q STATE No. 4
 LOCATION 330' FSL & 1,650' FEL
 UL O, SEC 36, T16S, R36E
 CO/ST: LEA CO, NM
 API NO. 30-025-03784
 FIELD: LOVINGTON (QUEEN)

DF 3,838'
 GR 3,825'
 CORR 10'

SPUDDED 2/27/1952
 COMPLETED 4/23/1952

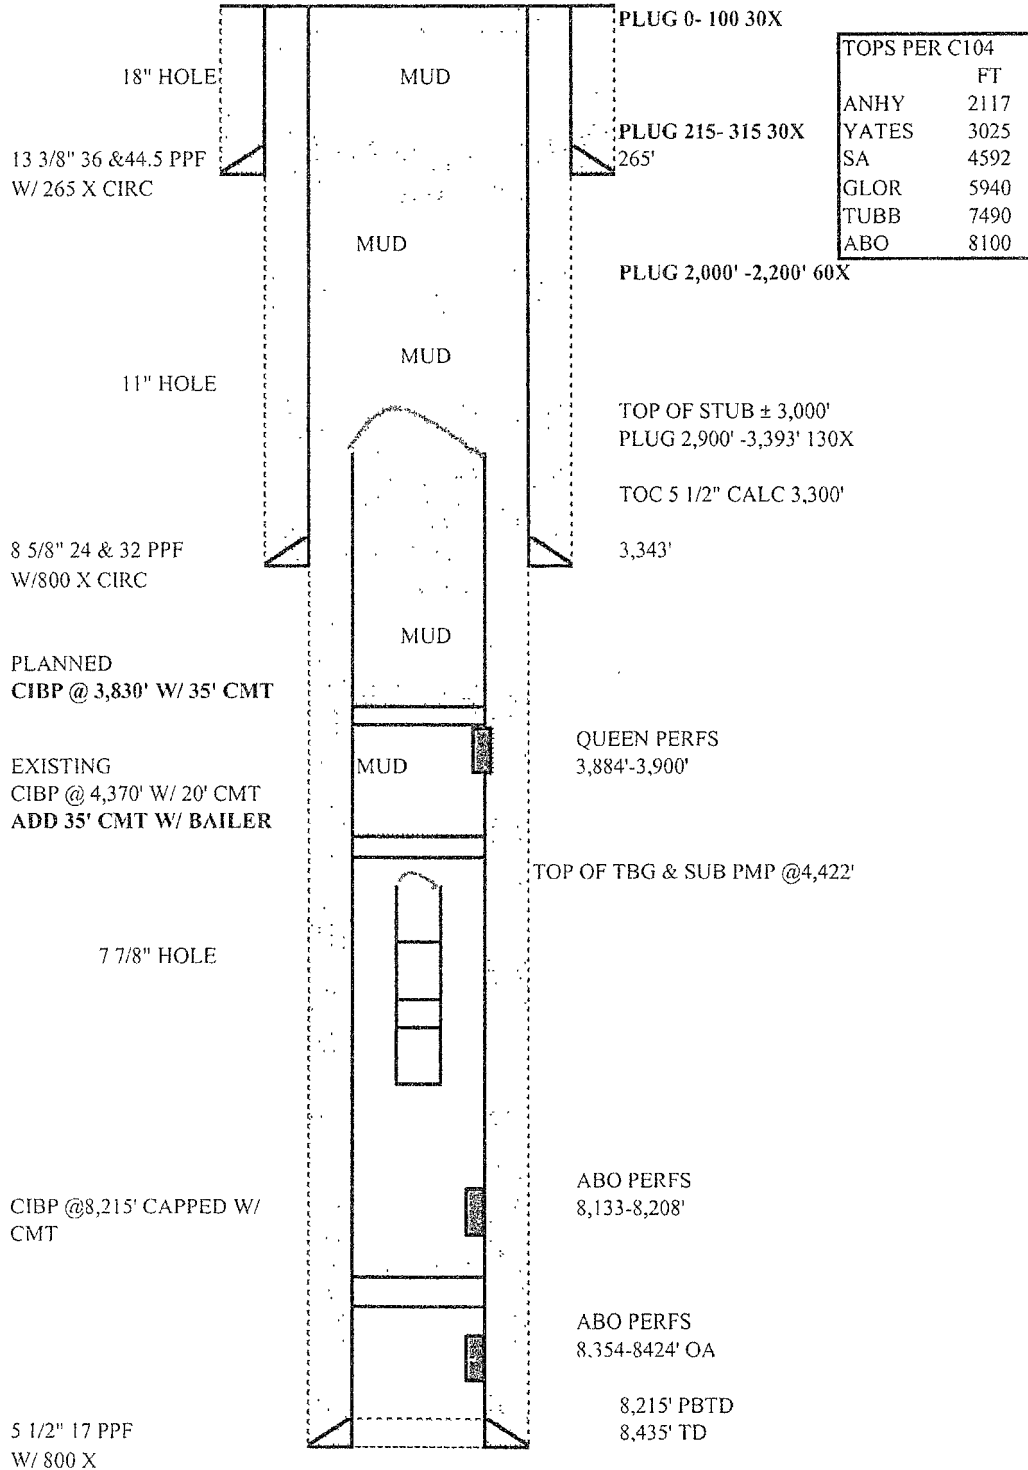

PROPOSED P&A

CMB 02/01/12