Form 3160-5 (April 2004)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs HOBBS OCI

FORM APPROVED OM B No 1004-0137 Expires: March 31, 2007

CHAIDDY NOTICES AND E	PEROPTS ON WELLSON O A AA	NMNM 17238
Do not use this form for proposal	REPORTS ON WELLSAR 2 0 20	6. If Indian, Allottee or Tribe Name
abandoned well. Use Form 3160 - 3		
	RECEIVED	TANK CAME AND
SUBMIT IN TRIPLICATE- Other in	nstructions on reverse side.	-7. If Unit or CA/Agreement, Name and/or No
1. Type of Well Oil Well Gas Well Oth	-	O WHAT IN.
	8. Well Name and No. Python 3 Fed. # 1	
2. Name of Operator Nearburg Producing Company		9. API Well No.
3a. Address	3b Phone No (include area code)	30-025-34872
3300 N. A. St. Bldg. 2 Ste. 120 Midland TX. 79705	10 Field and Pool, or Exploratory Area East Gem Marrow Teas Delay	
4 Location of Well (Footage, Sec., T., R., M., or Survey Description	on)	11. County or Parish, State
1900 FSL & 1650 FEL SEC 3 T20S & R33E		LEA NM
12. CHECK APPROPRIATE BOX(ES)	TO INDICATE NATURE OF NOTICE, I	REPORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION	
Acidize .	Deepen Production (S	
Notice of Intent Alter Casing	Fracture Treat Reclamation	Well Integrity
Subsequent Report Casing Repair	New Construction Recomplete	Other
Change Plans	Plug and Abandon Temporarily A	
Final Abandonment Notice Convert to Injection	Plug Back Water Disposa	<u> </u>
2. Tbg. at 3,895+8 pot 25 sx. cmt. 3976-3. 3. Tbg. at 3,720' Spot 45 sx. cmt. WOC & Tag. 4. Tbg. at 1600' Spot 25 sx. cmt. WOC & Tag. 5. Tbg. at 1345 Spot 45 sx. cmt. WOC & Tag. 6. Tbg. at 300' Spot 25 sx. cmt. 7. Tbg. at 60' Spot 15 sx. cmt. 60' to 3' 8. Clean location install dry hole marker.	CLAMATION PROCEDURE S	EE ATTACHED FOR ONDITIONS OF APPROVAL
,		OUDITIONS OF APPROVAL
Ground Level Day	tole Marker	
R-111-P (Astash) So		H Section
14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)		
Gary Eggleston	Title Agent	
Signature Jun Land	Date 2-25	12
TAIS SPACE FO	R FEDERAL OR STATE OFFICE	USE
11 00	0 -1	C 2 2 12 12
Approved by framer Land	Title SEW	Date 3-12-12
Condutions of approval, if any, are attached 'Approval of this no certify that the applicant holds legal or equitable title to those right.	hts in the subject lease Office	•
which would entitle the applicant to perations the con-		to make to any department of a control of the United
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, mak States any false, fictitious or fraudulent statements or representa	e it a crime for any person knowingly and willfully thous as to any matter within its jurisdiction.	y to make to any department or agency of the Onited

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this

form and the number of copies to be submitted, particularly with regard to local area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13 - Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or

present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well and date well site conditioned for final inspection looking to approval of the abandonment.

NOTICE

The Privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c) and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

This information is being collected to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT


Public reporting burden for this form is estimated to average 25 minutes per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer, (WO-630), Mail Stop 401 LS, 1849 C St., N.W., Washington D.C. 20240

CURRENT WELLBORE DIAGRAM

LEASE:	Python 3 Fede	ral	WELL:	1	FIELD:	Teas		API:	30-025-34872
LOC:	1900 FSL & 10	50 FEL	SEC:	3	BLK:			Reservoir	Delaware
SVY:	T20S R33E		GL:	3580	CTY/ST	Lea Co., N	١M	SPUD:	1/18/2000
CURREN	T STATUS:	Shut-In	KB:	3596	DF:			TD DATE:	2/12/2000
			terent televeriste		•			COMP. DATE:	3/14/2000
FRESH V	VATER					S S C	HOLE SIZE: SURF CSG & SIZE: SET @: SXS CMT: CIRC: FOC AT: FOC BY:	17-1/2 13-3/8 - 61&68# K5: 1295 1000 180 sx. Surf Circ	COMMENTS:
TBG: JTS: SN: TAC: ROD SIZ PKR: TYPE:	Œ:			2	DV tool (1 S S @ 3210 C T	HOLE SIZE: NT. CSG & SIZE: ET @: EXS CMT: CIRC: COC AT: COC BY: between 3895 & 3926	12-1/4 8-5/8 - 24&32# J55 3230 909 145 sx. Surf Circ	CURRENT PERFS: (MARIANTE SECTION ASS. DE PRESENTATION ASSESSABLE
OH ID: COTD: PBTD: TD:	6653 9720				Cmt. Plu 8100-825	P S S C	ET @: XS CMT: CIRC: COC AT:	7-7/8 5-1/2 - 17# J55 & N 6698 1st stg: 910 sx, 2nd s 40 sx on 2nd stg. Surf Circ	
	OPEN HOLE:	·				LINER:			2/21/2012

CURRENT WELLBORE DIAGRAM

	Dough 2 17-4-	· ·	WELL:	1	FIELD:	Teas		API:	30-025-34872
	Python 3 Fede			3	BLK:		Y	Reservoir	Delaware
LOC:	1900 FSL & 1	USV FEL		3580		Lea Co., I	ΝM	SPUD:	1/18/2000
SVY:	T20S R33E	Chut In		3596	DF:			TD DATE:	2/12/2000
CURREN	IT STATUS:	Shut-In			•	1000 To 1000 T		COMP. DATE:	3/14/2000
FRESH V	WATER					- 5867	TIS SKELME		COMMENTS:
DEPTH:			h <u>e jaculuma</u> nan den estero mangkalan			_	07255x36		******GEOLOGY*****
				Marine and Marine and Marine and Marine			POT HISKS CONT 15 TE 1200' K	-	TOPS OF ALL ZONES PRODUCTIVE OF HYDRO- CARBONS:
ŧ	į		Annual Province of the State of			570i	LISXI LMT.	pao Tols	CURRENT PERFS:
TBG: JTS:		11							
SN:		~			 	SPOT A	45 SKEMT 32	20 TA 30%	Diese + They
TAC:		靐		5	DV tool	@ 3210		. 8 8.	J
ROD SE	7.TC+	Î		-	T		-		
KOD 3D	5.5.				5	POTZ	5 5x5 CmT 3895.	To 3795	SQUEEZE JOBS:
PKR: TYPE:					~ 	ole in casin	g between 3895 & 3926		
							SENT GALLOT	54 547	
			**************************************			KARF.	B 100	the distribution	
OH ID:		7			- - - - - - - - - - - - - - - - - - -	IAP 6.)-6522	<i>YF6</i> HOLE SIZE:	7-7/8	
COTD:					F 0310	7-0322	PROD. CSG & SIZE:	5-1/2 - 17# J55 &	N80
PBTD:	6653				N		SET @:	6698	
TD:	9720	4					SXS CMT:	1st stg: 910 sx, 2nd	l stg: 370 sx
	;	(}		CIRC:	40 sx on 2nd stg.	
	•	(****) 			Cmt. P	lnσ	TOC AT:	Surf	
, 1	;	F.F.	CONTRACTOR CONTRACTOR	a come nea ha più	8100-82		TOC BY:	Circ	
	· · ·	}) 0100-87	<i>υ</i> υ	10021.		BY:
		1			1	A APINOD			2/21/2012
ļ	OPEN HOL	E:				LINER:			
į									

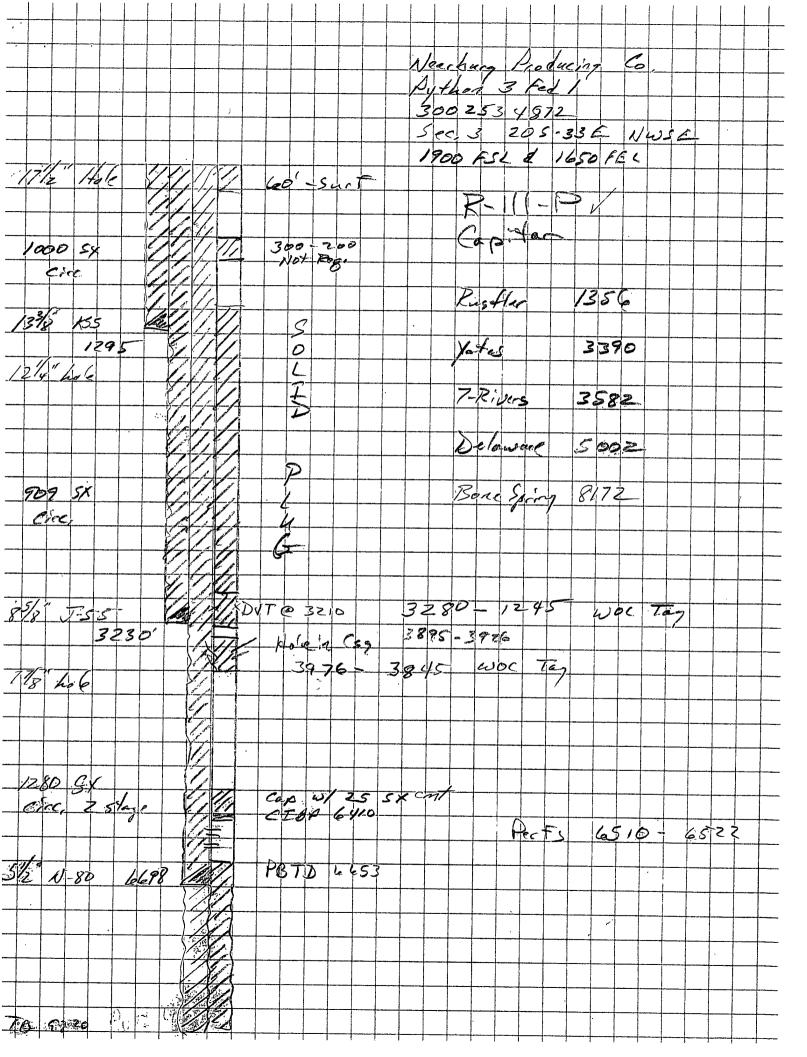

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

J. Amos 3/6/11

Requirements for ground level dry hole markers <u>Well Identification Markers</u> Conditions of Approval (COA)

The BLM Carlsbad Field Office (CFO) Conditions of Approval (COA) Requires that ground level dry hole markers be placed on well within the Lesser Prairie Chicken habitat area. The dry hole markers will be to the following specifications. The operator will construct the markers as follows:

- 1. An 8 inch X 8 inch steel plate 1/8 to 3/16 of an inch thick is to be placed on the old dry hole marker stand pipe 2 inches from ground level, in the Lesser Prairie Chicken habitat area.
- 2. Steel plate may be welded or bolted approximately 2 inches from ground level on the stand pipes. If plates are bolted to the stand pipe, the person installing the plate will be required to weld a pipe collar on the plate and place a minimum of two set screws/bolt on each collar. Aluminum data plates may be bolted with minimum ¼ inch bolt and locking nuts or self tapping fine threaded screws. A minimum of one in each corner is to be installed on each plate.
- 3. An 8 inch x 8 inch aluminum plate, which is 12 gauge or .080 sign material (1/8 inch aluminum plate may be used in place of the .080 plate) with the required information for that well stamped or engrayed in a minimum 3/8 inch tall letter or number.
- 4. The following information will be stamped or engraved on the 8 inch X 8 inch aluminum plate in the following order.
 - a. First row: Operators name
 - b. Second row: Well name and number
 - c. Third row: Legal location to include ¼ ¼, Section, Township, and range. If the legal location cannot be placed on one row it can be split into two rows with the ¼ ¼ (example: 1980 FNL 1980 FWL) being on the top row.
 - d. Fourth row: Lease Number and API number.
 - i. Example marker plate: (attached)

NMOCD Order No. R-12965 also required the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a ground level dry hole marker was installed as required in the COA's from the BLM.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To. 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Terry Gregston Environmental Protection Specialist 575-234-5958

Bobby Ballard Environmental Protection Specialist 575-234-2230

Randy Rust Natural Resource Specialist 575-234-5943

Linda Denniston Environmental Protection Specialist 575-234-5974

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Justin Frye Environmental Protection Specialist 575-234-5922 Cody Layton Natural Resource Specialist 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Todd Suter Surface Protection Specialist 575-234-5987

Doug Hoag Civil Engineering Technician 575-234-5979

Tanner Nygren Natural Resource Specialist 575-234-5975

John Fast Natural Resource Specialist 575-2345996