

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

HOBBS OCD
APR 11 2012
RECEIVED

WELL API NO. 300-025-40178
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Collins Heirs
8. Well Number #1
9. OGRID Number 018100
10. Pool name or Wildcat: Nadine West

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator Primero Operating Inc.	
3. Address of Operator PO Box 1433, Roswell, NM 88202-1433	
4. Well Location Unit Letter <u>K</u> : <u>1650</u> feet from the <u>S</u> line and <u>1700</u> feet from the <u>W</u> line Section <u>4</u> Township <u>20S</u> Range <u>38E</u> NMPM <u>Lea</u> County	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4258 GR	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: Completion ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

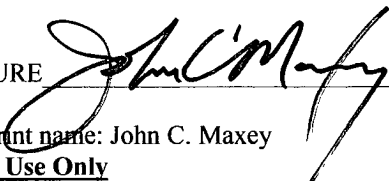
3/15/2012 MIRUPU. Set CBP @ 7190' and perf Drinkard 6960-64, 72-76, 84-86, 90-94, & 7004-08. Acidize perfs with 2000 gal 15% NEFE AIR 4 bpm @ 7000 psi. ISIP 5360, no 15 min. Set CBP @ 6860'.

Perf Tubb 6347, 50, 54, 56, 58, 6402, 04, 06, 14, 16, 18, 22, 24, 30, 32, 34, 36, 38, 6604, 08, 26, 28, 30, 32, 34, 36, 64, 66, 68, 70, 98, 6700, 02, 10, 12, 14, 20 @ 1 spf. Acidize with 2000 gal 15% NEFE AIR 12 bpm down casing, frac w/ 85k# 20/40 and 43k# 20/40 resin coated sand in 46k gal 25# gel. Sand ramped 2 - 6 ppg. AIR 40 bpm @ 3632, ISIP 4527. Set CBP @ 6247.

Perf Blinebry 5976, 78, 80, 82, 84, 86, 88, 90, 6036, 38, 44, 46, 54, 56, 58, 60, 62, 68, 70, 72, 6120, 22, 26, 28, 34, 6136, 64, 66, 68, 70, 72, 74, w/ 1 spf. Acidize with 2000 gal 15% NEFE AIR 12 bpm down casing, frac w/ 111k# 20/40 and 43k# 20/40 resin coated sand in 51k gal 25# gel. Sand ramped 2 - 5 ppg. AIR 45 bpm @ 3724, ISIP 3673. Set CBP @ 6247.

RIH w/ bit on tubing and drill out composite plugs @ 6860' and 6247'. RIH to CBP of 7190' and circ hole clean. POH. RIH with tubing pumping assembly, R&P, hang well on. Set pumping unit and initiate pump testing. Recovering load water.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE 

TITLE: Consulting Petroleum Engineer

DATE: 1/26/2012

Type or print name: John C. Maxey
For State Use Only

E-mail address: jcm@maxeyengineering.com PHONE: 575-623-0438

APPROVED BY:  TITLE
Conditions of Approval (if any):

PETROLEUM ENGINEER

DATE APR 23 2012