Form 3160-5 (April 2004)

## OCD-HOBBS **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

FORM APPROVED OM B No 1004-0137 Expires: March 31, 2007

APR 2 4 2012

5. Lease Serial No.

NMNM91015, 91016, 91017


ED

	his form for proposals to vell. Use Form 3160-3 (AP			6. If Indian, Al	llottee or Tribe Name	KECEI		
SUBMIT IN TRIPLICATE- Other instructions on reverse side.				7. If Unit or CA/Agreement, Name and/or No.				
1. Type of Well ☐ ☐ Gas Well ☐ ☐ Other  2. Name of Operator BC Operating, Inc.					8. Well Name and No. Rhodes NCT Copp-Fed Com 1-1;1-2,1-3			
Location of Well (Footage, Sec.,		432 004 7070			ol, or Exploratory Are tes Seven Rivers	a		
•	1-1: J-27-26S-37E; Rhodes NCT	Coop Fed Com 1-2	e: G-27-26S-37E; V	11. County or P				
12. CHECK A	PPROPRIATE BOX(ES) TO IN	IDICATE NATU	RE OF NOTICE, RI	EPORT, OR O	THER DATA			
TYPE OF SUBMISSION		TY	PE OF ACTION					
Notice of Intent Subsequent Report	Acidize Alter Casing Casing Repair	Deepen Fracture Treat New Construction	Production (Star Reclamation Recomplete	rt/Resume)	Water Shut-Off Well Integrity Other add leases t	es to surface		
Final Abandonment Notice	Change Plans Convert to Injection	Plug and Abandon Plug Back	Temporarily Aba . Water Disposal	andon	commingle	permit		
was approved for surface of #25 and #20 WH Rhodes E NMNM91015 (Rhodes I NMNM91017 (Rhodes I NMNM91017 (Rhodes I A map showing the well losubmission. All production approximately 1800-2000 I	ederal leases listed below to the stommingling Rhodes Yates Seven B.  NCT Coop Fed Com 1-1: J-27-26  NCT Coop Fed Com 1-2: G-27-21  NCT Coop Fed Com 1-3: B-27-20  cations as well as an updated facin is allocated based on monthly webO/month, 37.0 gravity. Because or oduction life of the wells. Other	Rivers - #7 WH 6S-37E, 30-025-320 6S-37E, 30-025-321 6S-37E, 30-025-321 lity diagram descrived the total for the number of	Rhodes A with product 95) 096) (26) ibing the proposed op- udes oil and water. A wells on these leases, it	etion from #23, # eration in detail ll of these wells of the well of these wells of these wells of the well of these wells of these wells of the well	431, #28, #30, #24, # are included with the combined produce	21, #29, his		
requested that we add then	eases were already included in the n. All interest owners were conta	cted with the origi	nal permit filing.					
BC OPERATING  4. I hereby certify that the foreg		APPROVE	1 OPErator	rof A	11 wells			
Name (Printed/Typed)	ong is true dilu correct	mut -	•					
Linda Gregg .		litle R	egulatory Analyst					
Signature Xinela	Suger	Date	03.	/08/2012				
<u> </u>	THIS SPACE FOR FEI	DERAL OR S	TATE OFFICE L	JSE	-			
proyedby inditions of approval, it any ascentify that the applicant holds legal nich would entitle the applicant to	/s/ JD Whitlo gradual. Approval of this notice does or equitable title to those rights in the conduct operations thereon.	not warrant or	ffice (FS	Date	4/22/1	Z		
	43 U.S.C. Section 1212, make it a crim	ne for any person kn	owingly and willfully to	make to any depa	artment or agency of t	he United		


ATTACHED Guidelines

(Instructions on page 2)

APR 2 5 2012

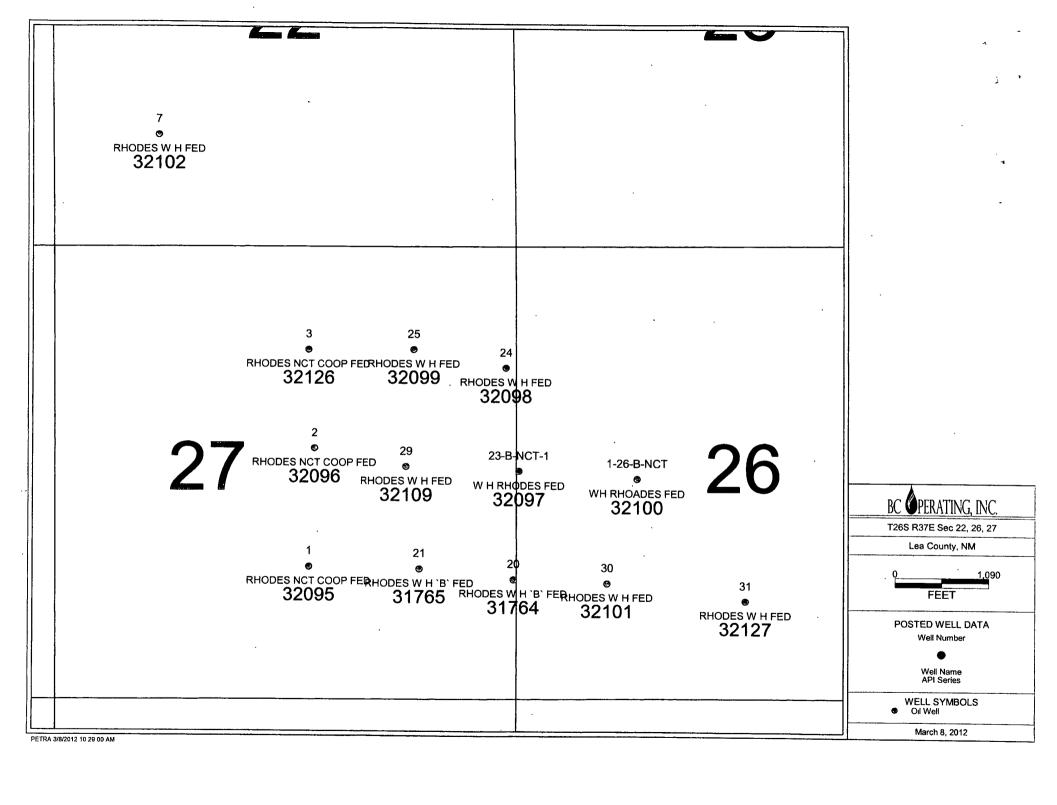




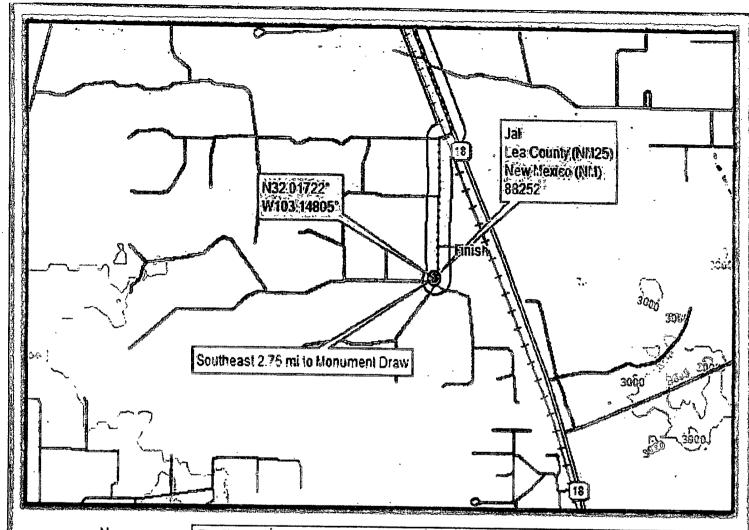



Turn Dist	Turn	Road	Total Distance
	Depart Jal (S)	58 <b>20</b> 5 (5 3rd St)	0.00 m
0.04 mi	Turn left (E)	E Utah Ave	0.04 mi
0.32 mi	Turn right (S)	SR 18	0.36 mi
538 mi	Turn right (WSM)	<unnamed></unnamed>	6.75 mi
0.89 mi	Continue straight (S)	Arrive at Finish	7.55 mi

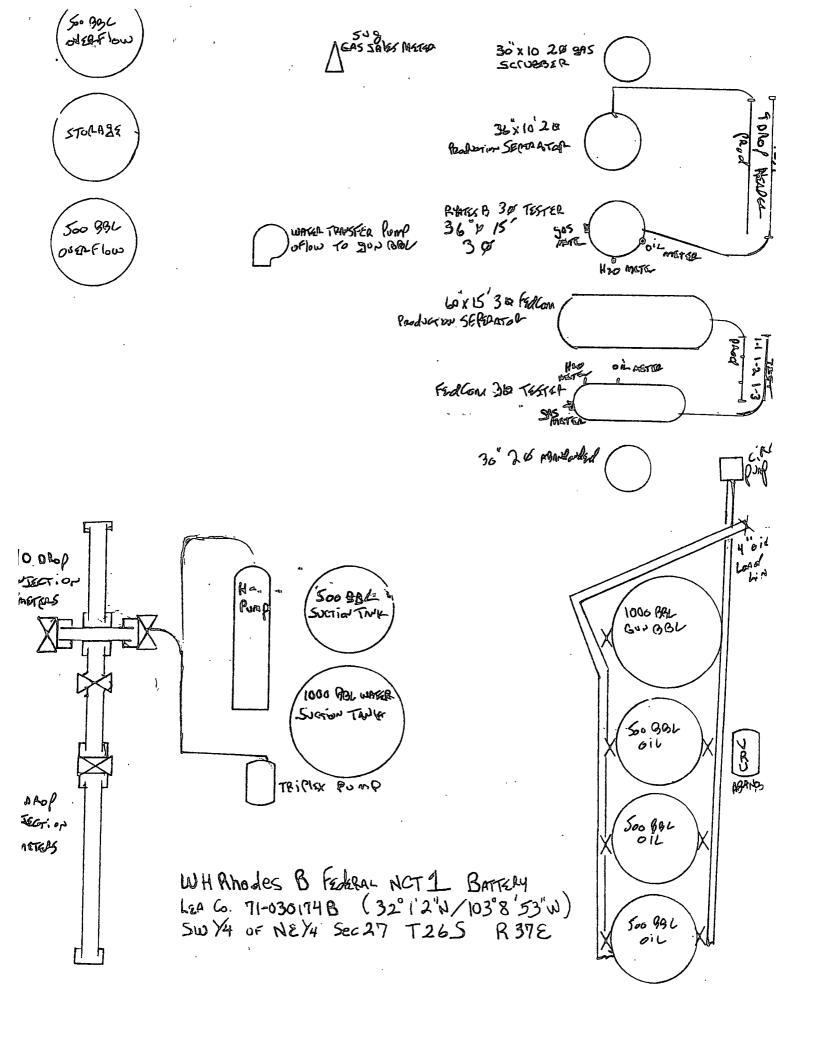

## WH Rhodes Yates B Federal NCT 1 Battery Lea Co New Mexico, 71-030174B, SW ¼ of NE ¼ Sec 27, T26S R37E

Rhodes Yates B-1 wells go through production side of 9 drop header into the primary vessel (36" x 10'2 phase vertical). The gas is stripped off this vessel and goes directly to the gas sales meter. The combined liquids go directly to the 1000 bbl gun bbl and are separated. Oil is dumped into the oil sales tanks and the water is pushed over the water leg to the 500 bbl suction tank on North side of the battery.

During testing of wells the fluids go into a 3 phase vertical (36" x 15"). Oil, water and gas are measured with meters. Gas goes directly into gas sales meter. The fluids are recombined after testing and are dumped into the 1000 bbl gun bbl where they are separated once again going into the water and oil tanks.

Vessels not in use: 30" x 10' vertical 2 phase by Gun BBL / Vapor Recovery Unit

Rhodes Yates Fed Com wells (1-1, 1-2, 1-3) are in a 3 drop header isolated from other production.

The primary production vessel is a (60" x 15') horizontal 3 phase unit. Gas is stripped from the vessel and goes directly to gas sales meter and liquids are dumped directly to the 1000 bbl gun bbl and are separated.


The Fed Com tester is a 3 phase horizontal (36" x 10"). Oil, water and gas are measured with meters. Gas goes directly into gas sales meter. The fluids are recombined after testing and are dumped into the 1000 bbl gun bbl where they are separated once again into water and oil tanks.

There is a 30" x 10' 2 Phase vertical Gas Scrubber on the East end of the Production vessels to capture any fluids that might carry over in the event of a vessel malfunction. The fluids that are captured are then dumped mechanically back into the 1000 gun bbl.


There is an injection station on the North end of the Battery where an H-Pump ( primary SWD pump ) and Triplex ( secondary SWD pump ) are located. The suction tanks are 1000 bbl fresh water and 500 bbl produced water tanks. Then injection header has individual meters going from the header to the wells. There is an 18 drop header on the West End and a 10 drop header on the East end. There is a Master Meter on the H-Pump for daily total volumes. When the primary pump is down the Triplex is activated and there is also a Master Meter for this pump .

There are two 500 bbl overflow tanks on the NE end of the battery when the system overflows. There is a centrifugal pump that transfers captured waters back into the 1000 gun bbl. There are no overflow pits on site.

Oil tanks are sealed on BS&W lines and on Sales lines and on the load line going to the fence line. These seals are in place and only the BS&W seal may be broken to circulate off bottoms. After tank bottoms are drawn off the seal is replaced. After working the tanks then the oil hauler is called. Plains PPL seals the load line valve as well as all 3 oil tank load valves. There are some 2" valves where head switches were located and they are sealed as well by BC Employees. These seal stay in place. There is a trapper enclosure to catch oil @ the load line valve during oil sales.

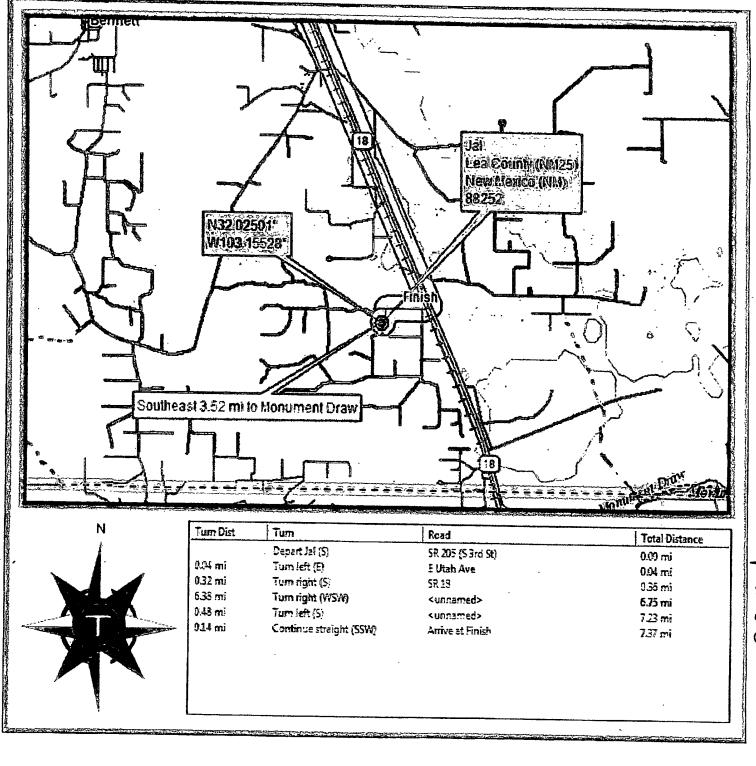

Chades BNCT-Z

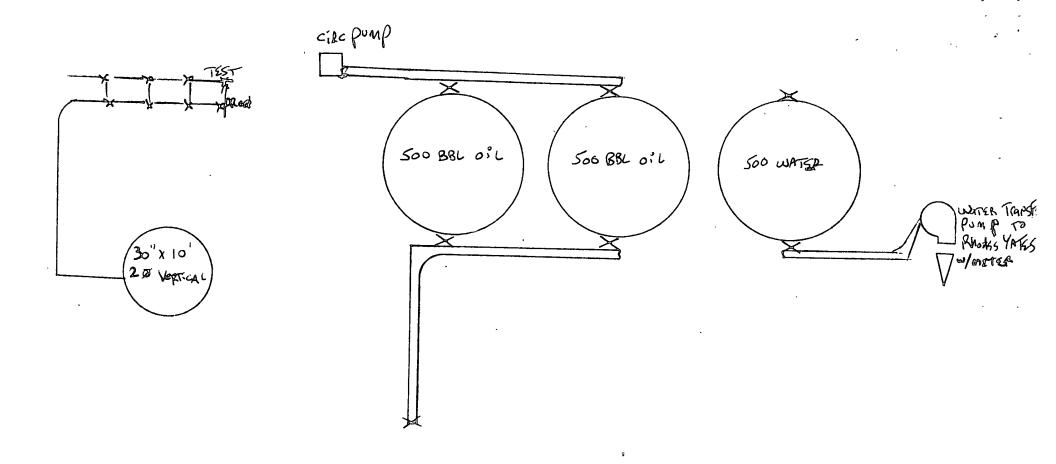

WH Rhodes B FEDERAL NCT-2 BATTERY 1 71-030174-B hea Co. NEY4 OF SEY4 Sec. 28 T265 R37 E 32°0'42"N / 103°9'43"W

IMORIUM BATTELY - NO PRODUCTION WELL PHA'D - WATER TRANSFER STATION ONLY

## Bureau of Land Management Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## **Guidelines for Off-Lease Measurement, Storage and Surface Commingling Approvals**

At a minimum the following information must be included with any application to combine, store or measure production off-lease:

- 1. A formal request (Sundry Notice Form 3160-5 or letter) for approval to combine, store, or measure production off-lease with an appropriate explanation and diagram(s) describing the proposed operation in detail.
- 2. A map showing the lease numbers and location of all leases and wells that will contribute production to the proposed commingling, off-lease measurement, and/or storage facility. All lease numbers, unitized or communitized areas, producing zones or pools must be clearly illustrated or detailed by suitable means. Any wells or leases proposed to be added to an approved commingling and off-lease storage and or measurement facility must be approved by the Authorized Officer prior to their being included in the facility.
- 3. An updated facility diagram which clearly identifies and places all equipment that will be utilized. A diagram which identifies all flow lines, sales points and give location of gas sales (transfer point) meter if it is not at this facility. Include gas sales meter station name and number and location of meter to include ¼ ¼, Section, Township and Range.
- 4. Estimated monthly production from each contributing well, including type of product, gravity, and/or BTU content.
- 5. Details of the proposed method for measuring and allocating production for each lease involved. Include calculated "beneficial use" volumes both on and off-lease.
- 6. A statement that all interest owners have been notified of the proposal.
- 7. Evidence that Federal or Indian royalties will not be reduced through approval of the application, and the proposed commingling of production is in the interest of conservation and will not result in improper measurement of production.
- 8. Detailed economic justification, when the application to combine production is based on economic necessity, i.e., that approval is necessary to extend the economic life of the Federal or Indian Lease(s). Commingling with State or Fee wells will be on a very limited basis and will have to prove this is the only economical way to keep that well/lease from being plugged.

Approval for combining production from various sources is a privilege which is granted to lessees for the purpose of aiding conservation and extending the economic life of leases. Applicants should be cognizant that failure to operate in accordance with the provisions outlined in the Authorized Officer's conditions of approval and/or subsequent stipulations or modifications will subject such approval to revocation.

hydrocarbon production from	(Operate the following form	or's Name) is requesting approven nation(s) and well(s):	al for surface cor	mmingling and	off-lease storage a	and measurem	nent of
Federal Lease No							
Well Name	API No.	Loc: 1/4 1/4 Sec.Twp.Rng.	<u>Formation</u>	BOPD	Oil Gravity	<u>MCFPD</u>	<u>BTU</u>
4-Deep Pockets 16 Federal	30015xxxxx	SWSW,Sec.15,T16S,R30E	Delaware	12	45.2/@60°	102	1315
			· .				
						-	
With hydrocarbon production	from:				,		
Federal Lease No.		<del></del>					
Well Name	API No.	Loc: 1/4 1/4 Sec.Twp.Rng.	<u>Formation</u>	BOPD.	Oil Gravity	<u>MCFPD</u>	<u>BTU</u>
4-Deep Pockets 16 Federal	30015xxxxx	SWSW,Sec.15,T16S,R30E	Delaware	12	45.2/@60°	102	1315
				•			
The storage and measuring fa Lea/Eddy (circle one), New Mo	acility is located a exico. BLM will b	t	S, R hange in the fac	E, on Lease ility location.	e No		

Details of the proposed method for allocating production to contributing sources are as follows: