
Submit 1 Copy To Appropriate District	State of New Mexico		Form C-103	
Office <u>District I</u> – (575) 393-6161	Energy, Minerals and Natural Resources		Revised August 1, 2011	
1625 N. French Dr., Hobbs, NM 8824 ACBBS OCD			WELL API NO.	
District II – (575) 748-1283 811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISION		DIVISION	30-025-05864	
61) 5. 1 list bt., 74tosia, 14th 40210		cis Dr.	5. Indicate Type of Lease	
1000 Rio Brazos Rd., Aztec, NM 87410 L			STATE K FEE 6. State Oil & Gas Lease No.	
District IV - (505) 476-3460 Santa Fe, NM 8/505 1220 S. St. Francis Dr., Santa Fe, NM		.		
87505 RECEIVED			B 2441	
SUNDRY NOTICES AND REPORTS ON WELLS			7. Lease Name or Unit Agreement Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			East Eumont Unit	
1. Type of Well: Oil Well Gas Well Other Injection		8. Well Number 105		
2. Name of Operator		9. OGRID Number 192463		
OXY USA WTP Limited Partnership				
3. Address of Operator		10. Pool name or Wildcat		
P.O. Box 50250 Midland, TX 79710		Eumoal Tates TRan		
4. Well Location				
Unit Letter C: 330 feet from the North line and 2304 feet from the west line				
Section 2 Township 205 Range 37E NMPM County Lea				
11. Elevation (Show whether DR, RKB, RT, GR, etc.)				
"种种"的"种种"的"种种"的"种种"的"种种"的"种种"的"种种"的"种种"				
12 Check An	propriete Roy to Indicate N	ature of Notice	Report or Other Data	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data				
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:				
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ REMEDIAL WOR				
TEMPORARILY ABANDON				
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐ CASING/CEMEN		JOB - D		
DOWNHOLE COMMINGLE			;	
OTHER: CIBP - MIT -TAStatus				
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date				
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of				
proposed completion or recompletion.				
	~	•	<u> </u>	
7/3/12 MIRU PU, NDWH, rel pkr, NU BOP, POOH w/ tbg & pkr until got to FG lined tbg, order slip type.				
7/5/12 Continue to POOH w/ FG lined tbg. RIH W/ 4-3/4" bit, 4-3/4" string mill to 3692'. POOH w/ tbg, bit & mill. RIH				
w/ CIBP & set @ 3641', loaded & tested CIBP to 500#, held OK. Circ well w/ pkr fluid.				
RDPU.				
This Approval of Temporary				
	Abandonment Expires 26-01			
			* 1 No. of Street Street Street	
Smud Data	Die Beleese De	to.	to tree to degree of the properties of the state of the s	
Spud Date:	Rig Release Da	ie.		
-				
				
I hereby certify that the information ab	ove is true and complete to the be	est of my knowledge	e and belief.	
	/ /			
CICNATURE	i mari i d	egulatory Advisor_	DATE 710/12	
SIGNATURE	TITLE R	egulatory Advisor	DATE MOLIA	
Type or print name E-mail address: david stewart@oxy.com PHONE: _432-685-5717_				
For State Use Only				
APPROVED BY: TITLE DIST. MATE 1-12-2012				
Conditions of Approval (if any);				
\leftarrow \sim				

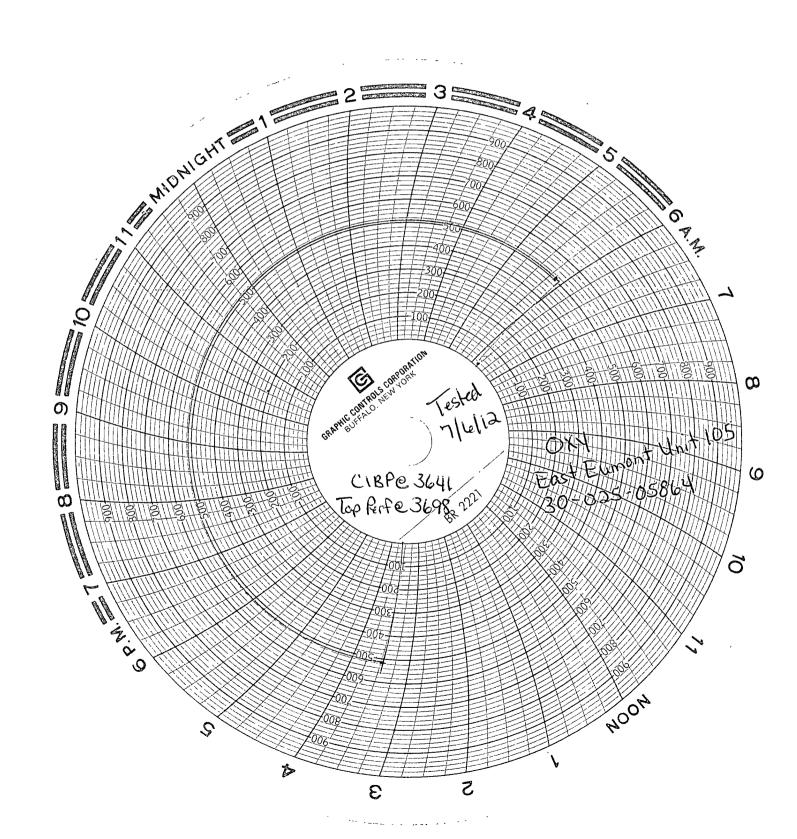

TD-3860'

12-1/4" hole @ 421' 8-5/8" csg @ 421' w/ 325sx-TOC-Surf-Circ

7-7/8" hole @ 3860' 5-1/2" csg @ 3858' w/ 1200sx-TOC-Surf-Circ

CIBP @ 3641'

Perfs @ 3678-3830'