

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

OIL CONSERVATION DIVISION

DISTRICT I
1625 N French Dr, Hobbs, NM 88240

HOBBS OCD

1220 South St. Francis Dr.
Santa Fe, NM 87505

DISTRICT II
1301 W Grand Ave, Artesia, NM 88210

JUL 19 2012

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals)		WELL API NO 30-025-29754
1 Type of Well Oil Well ☐ Gas Well ☐ Other ☒ Injector		5 Indicate Type of Lease STATE ☒ FEE ☐
2 Name of Operator Occidental Permian Ltd.		6 State Oil & Gas Lease No
3 Address of Operator HCR 1 Box 90 Denver City, TX 79323		7 Lease Name or Unit Agreement Name South Hobbs (G/SA) Unit
4 Well Location Unit Letter C 1166 Feet From The North 2411 Feet From The West Line Section 4 Township 19-S Range 38-E NMPM Lea County		8 Well No. 216
11 Elevation (Show whether DF, RKB, RT GR, etc) 3610' GL		9 OGRID No 157984
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____		10 Pool name or Wildcat Hobbs (G/SA)

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG & ABANDONMENT ☐
PULL OR ALTER CASING ☐	Multiple Completion ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: _____	☐	OTHER: Clean out/Plug back/Sqz perms/OAP/AT	☒

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
1. RUPU & RU.
 2. ND wellhead/NU BOP.
 3. POOH w/tubing and injection packer.
 4. RIH w/bit. Tag @4217'. POOH w/bit.
 5. Dump bail 15.5 gal buckets of pea gravel to plug back well. Break circulation and clean out pea gravel from 4115-4154'. RU wireline and tag gravel @4154'. Dump 10' of cement on top of pea gravel to 4144'. RD wireline.
 6. RIH w/CICR set @4050'. RU HES & pump 300 sxs of cement into perms from 4060-4136'. Reverse out 15 bbl of cement. RD HES.
 7. RIH w/bit & drill collars. Tag cement @4046'. RU power swivel & drill cement & CIRC from 4046-4135'. Drill new formation from 4135-4210' (TD). RD power swivel. POOH w/bit & drill collars.
 8. RU wireline & perforate casing at 4060-64, 4070-79'. RD wireline
 9. RIH w/test packer set @4042'. RU HES & pump 750 bbl of 15% NEFE acid. RD HES. POOH w/test packer & RBP.

see attached sheet for additional data

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or

closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A Johnson TITLE Administrative Associate DATE 07/16/2012
TYPE OR PRINT NAME Mendy A Johnson E-mail address: mcndy_johnson@oxy.com TELEPHONE NO 806-592-6280

For State Use Only

APPROVED BY [Signature] TITLE Dist. MGR DATE 7-23-2012
CONDITIONS OF APPROVAL IF ANY


JUL 23 2012

SHU 216

10. RIH w/Arrowset 1-X Double grip packer set on 121 jts of 2-3/8" IPC tubing. Packer set @3925'
11. ND BOP/NU wellhead.
12. Test casing to 540 PSI for 30 minutes and chart for the NMOCD.
13. RDPU & RU. Clean location and return well to injection.

RUPU 04/17/2012

RDPU 05/01/2012

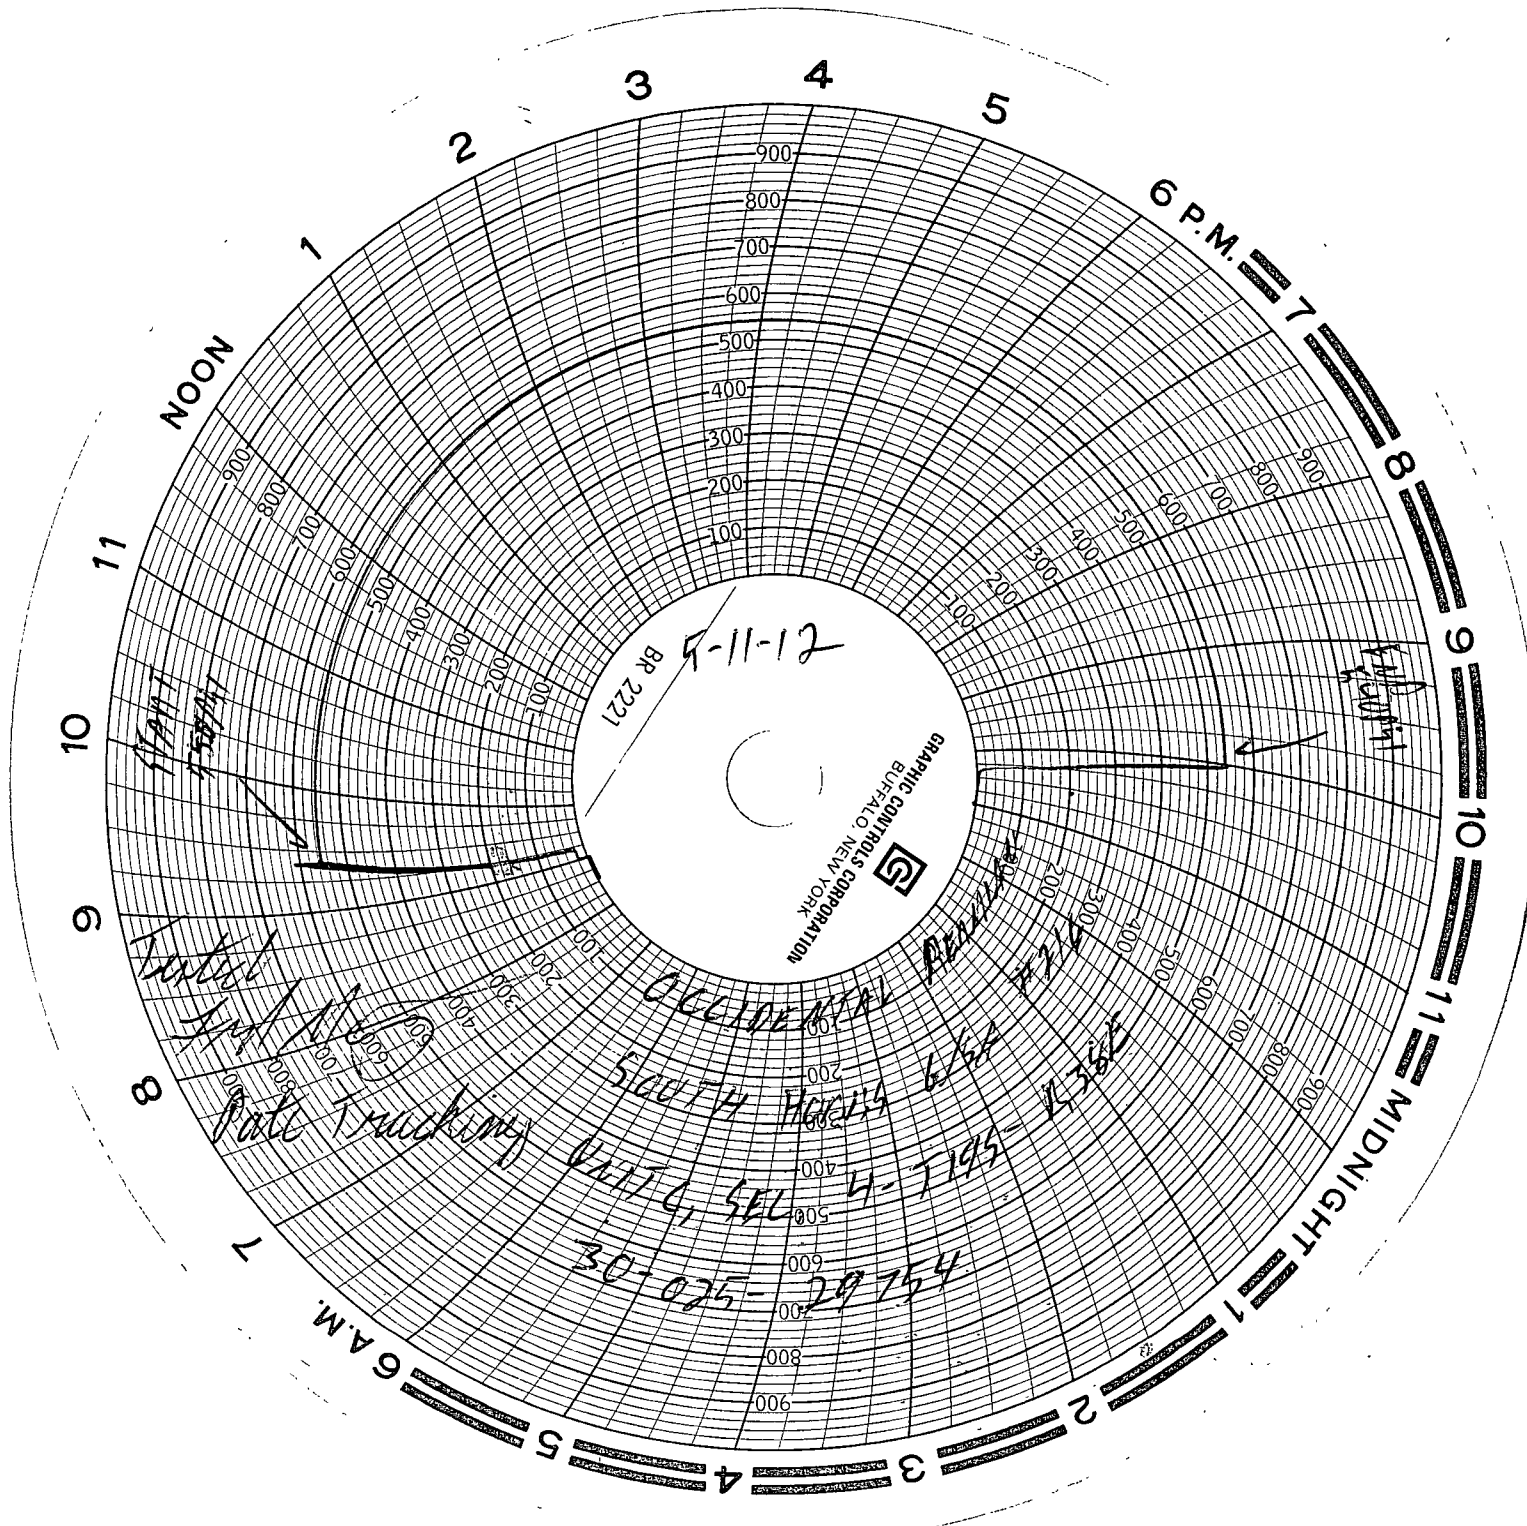

5-11-12

BR 2221

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

OCCIDENTAL AIRWAYS

SOUTH 4 HIGHWAY 6/6A

KING, SEL 4-7195

30-025-29754

Date Trucking

Tutal

Luf Me

HANT

Kurt

Kurt


May 23, 2012

Work Plan Report for Well:SHOU-216C04

PKR

Status-Guiberson VI

Wellbore Diagram

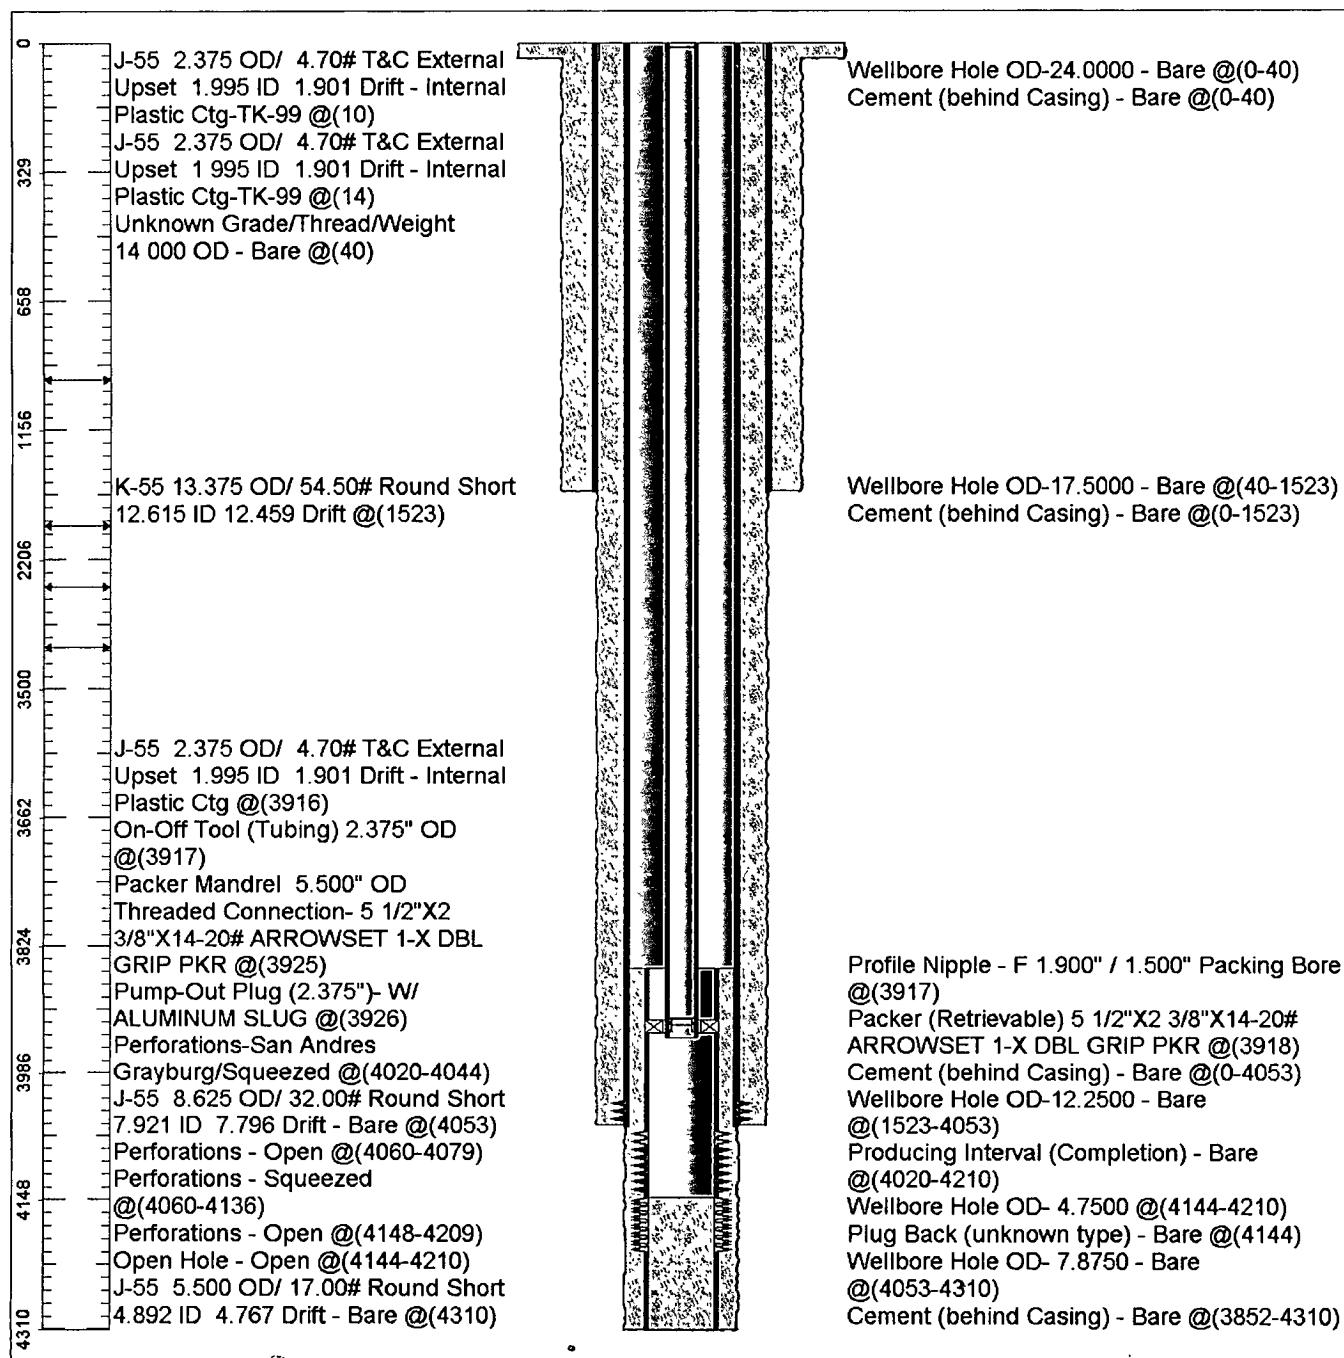

Survey Viewer