

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N French Dr., Hobbs, NM 88240  
District II  
1301 W Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87401  
District IV  
1220 S. St Francis Dr., Santa Fe, NM  
87505

State of New Mexico  
Energy, Minerals and Natural Resources  
OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103  
June 19, 2008

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS )		WELL API NO. 30-025-10255
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator John H. Hendrix Corporation		6. State Oil & Gas Lease No.
3. Address of Operator P. O. Box 3040, Midland, TX 79702-3040		7. Lease Name or Unit Agreement Name Cossatot I
4. Well Location Unit Letter <u>D</u> : <u>660</u> feet from the <u>North</u> line and <u>330</u> feet from the <u>West</u> line Section <u>13</u> Township <u>22S</u> Range <u>37E</u> NMPM Lea County		8. Well Number <u>2</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3336' GL		9. OGRID Number <u>012024</u>
		10. Pool name or Wildcat Blinebry and Tubb

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☒ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☐  
CASING/CEMENT JOB ☐

OTHER: Return to Production



OTHER:



13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. MIRU. GIH and retrieve RBP @ 5000'.
2. CO to Model D pkr @ 5409', and retrieve or drill out Model D.
3. CO to Model D pkr @ 5756', and retrieve or drill out Model D.
4. Clean out to PBTD @ 6208'.
5. Acidize existing Blinebry and Tubb perms w/3500 gal 15% HCl nefe acid.
6. Swab back to clean. GIH w/production equipment. Install pumping unit and return well to production.
7. Test well as DHC Blinebry and Tubb producer.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Carolyn Doran Haynes TITLE Engineer DATE 07/24/12

Type or print name Carolyn Doran Haynes E-mail address: cdoranhaynes@jhnc.org PHONE: 432-684-6631


For State Use Only

APPROVED BY: [Signature] TITLE PETROLEUM ENGINEER DATE JUL 26 2012  
Conditions of Approval (if any).

JUL 26 2012

## Cossatot I #2

**660' FNL & 330' FWL, Sec 13, T22S, R37E, Lea County, New Mexico**

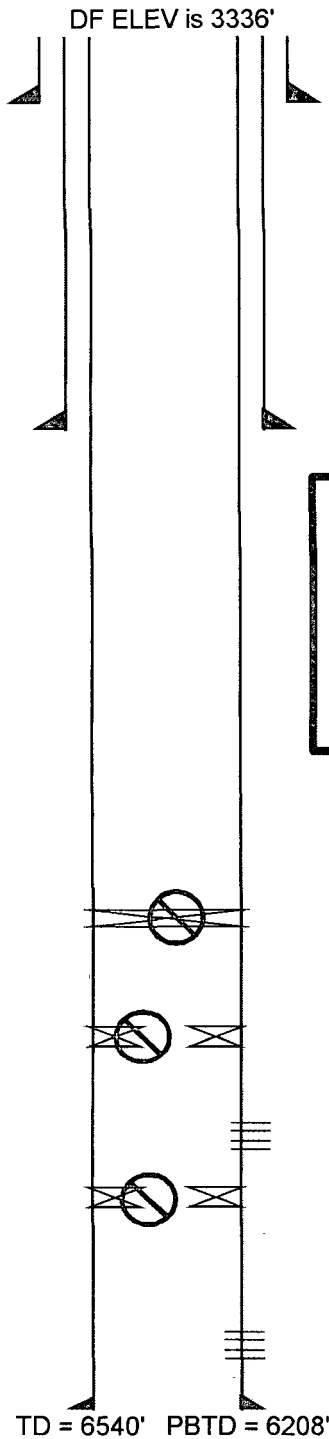

17" hole  
13 3/8" csg @ 168 w/ 150 sx circ

API # 30-025-10255  
OGRID # 012024

8 5/8" 26# csg @ 2699' cmt w/450 sx circ by calc

Proposed to DHC Blinebry and Tubb zones

Pull RBP, both Model D pkrs.  
Clean out to PBTB. Acidize.  
GIH w/ tbg and pump and rods

TOC 3942' by calc

RBP @ 5000'

Baker model "D" Pkr @ 5409'

10rd NUE perf nipple  
Blinebry Perfs @ 5530-5665'

Baker "D" Pkr @ 5756' ID = 2.688"  
Profile nipple w/ plug

Tubb Gas Perfs @ 6036-6108'  
5 1/2" 17# csg @ 6372' w/350 sx

Drawn	BY
2012	CDH
Proposed	

**John H. Hendrix Corporation**  
110 North Marienfeld Suite 400  
Midland, TX 79702

**Cossatot I #2**  
660' FNL & 330' FWL  
SEC 13, T22S, R37E  
Lea County New Mexico